

This is a digital copy of a book that was preserved for generations on library shelves before it was carefully scanned by Google as part of a project to make the world's books discoverable online.

It has survived long enough for the copyright to expire and the book to enter the public domain. A public domain book is one that was never subject to copyright or whose legal copyright term has expired. Whether a book is in the public domain may vary country to country. Public domain books are our gateways to the past, representing a wealth of history, culture and knowledge that's often difficult to discover.

Marks, notations and other marginalia present in the original volume will appear in this file - a reminder of this book's long journey from the publisher to a library and finally to you.

Usage guidelines

Google is proud to partner with libraries to digitize public domain materials and make them widely accessible. Public domain books belong to the public and we are merely their custodians. Nevertheless, this work is expensive, so in order to keep providing this resource, we have taken steps to prevent abuse by commercial parties, including placing technical restrictions on automated querying.


We also ask that you:


- + *Make non-commercial use of the files* We designed Google Book Search for use by individuals, and we request that you use these files for personal, non-commercial purposes.
- + Refrain from automated querying Do not send automated queries of any sort to Google's system: If you are conducting research on machine translation, optical character recognition or other areas where access to a large amount of text is helpful, please contact us. We encourage the use of public domain materials for these purposes and may be able to help.
- + *Maintain attribution* The Google "watermark" you see on each file is essential for informing people about this project and helping them find additional materials through Google Book Search. Please do not remove it.
- + *Keep it legal* Whatever your use, remember that you are responsible for ensuring that what you are doing is legal. Do not assume that just because we believe a book is in the public domain for users in the United States, that the work is also in the public domain for users in other countries. Whether a book is still in copyright varies from country to country, and we can't offer guidance on whether any specific use of any specific book is allowed. Please do not assume that a book's appearance in Google Book Search means it can be used in any manner anywhere in the world. Copyright infringement liability can be quite severe.

About Google Book Search

Google's mission is to organize the world's information and to make it universally accessible and useful. Google Book Search helps readers discover the world's books while helping authors and publishers reach new audiences. You can search through the full text of this book on the web at http://books.google.com/

Digitized by GOOGLE

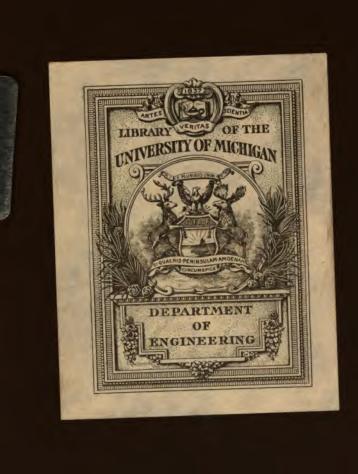



TH 233/ 1899

DESIGN OF ELECTRICAL MACHINERY

VOLUME III

ALTERNATORS, SYNCHRONOUS MOTORS, ROTARY CONVERTERS



75 K.V.A. Engine-driven Alternating-current Generator (Westinghouse Co.) ${\it Frontispiece}$



DESIGN

OF

ELECTRICAL MACHINERY

A TREATISE FOR THE USE, PRIMARILY, OF STUDENTS IN ELECTRICAL ENGINEERING COURSES

Vol. III

ALTERNATORS, SYNCHRONOUS MOTORS, ROTARY CONVERTERS

RΥ

WILLIAM T. RYAN, E.E.
Assistant Professor of Electrical Engineering, The University of Minnesota

FIRST EDITION
FIRST THOUSAND

NEW YORK

JOHN WILEY & SONS

LONDON: CHAPMAN & HALL, LIMITED

1912

DESIGN OF ELECTRICAL MACHINERY

- Vol. I. Direct Current Dynamos. 8vo, ix + 109 pages, profusely illustrated. Cloth, \$1.50 net.
- Vol. II. Alternating Current Transformers. 8vo, vii + 119 pages, profusely illustrated. Cloth, \$1.50 net.
- Vol. III. Alternators, Synchronous Motors and Rotary Converters. 8vo, vii + 129 pages. 104 figures. Cloth, \$1.50 net.

Copyright, 1912

BY

WILLIAM T. RYAN

SCIENTIFIC PRESS
ROBERT DRUMMOND AND COMPANY
BROOKLYN; N. Y.

PREFACE

THE purpose of this volume is to treat alternating-current generators, synchronous motors, and rotary converters. It contains what the author believes will be of most service to the student who is just entering upon his experience as a designer.

A more comprehensive study of the principles and phenomena underlying the calculations should be made by means of lectures, recitations, through the medium of references, etc.

Good electrical apparatus cannot be designed by any set of rules, and it must be recognized that it is not, in general, feasible to develop a finished commercial designer in a college course. However, there are certain fundamental scientific principles which can be laid down definitely and taught with precision. The student should bear in mind that while there is much in this volume that is of practical value, the main object is to present as clearly and briefly as possible the fundamental principles on which the designer necessarily rests. He should also bear in mind that he cannot expect to get any more than a training that will be of value and assistance to him, if at any time in his later experience he should decide to become a designer.

An electrical designer must also be a mechanical designer. This point is very often overlooked by the beginner. It is possible to devise some very wonderful designs from an electrical standpoint, but which when the mechanical features are considered are absolutely impractical.

Direct-current dynamos and alternating-current transformers were considered in the preceding volumes. Alternating-current generators and synchronous motors are, of course, practically one and the same problem from the standpoint of design. Only these points wherein a rotary is essentially different from either the synchronous motor or a direct-current generator are considered.

Special attention has been given to the arrangement of the work with regard to the order of the process of carrying out the calculations.

The author has drawn very largely upon information obtained from the manufacturing companies. He desires to acknowledge his indebtedness to the above companies, and to express his appreciation of their courtesy for permission for use of illustrative cuts, drawings, etc. Also to many others whose valuable suggestions have been utilized in preparing this work.

WILLIAM T. RYAN.

University of Minnesota, Minneapolis, Minn., September, 1912.

CONTENTS

CHAPTER I	
Types of Alternating-current Generators and Their Characteristics	1
CHAPTER II	
METHOD OF DESIGNING ALTERNATING-CURRENT GENERATORS AND SYNCHRONOUS MOTORS	27
CHAPTER III	
DESIGN OF ROTARY CONVERTERS	90
CHAPTER IV	
A 180-KILOWATT, 3-PHASE, 2200-VOLT, 600 R.P.M., 60-CYCLE, BELTED-TYPE ALTERNATOR	102
vii	

DESIGN OF ELECTRICAL MACHINERY

VOLUME III.—ALTERNATORS, SYNCHRONOUS MOTORS, ROTARY CONVERTERS

CHAPTER I

TYPES OF ALTERNATING CURRENT GENERATORS AND THEIR CHARACTERISTICS

A NUMBER of types of alternating current generators have been designed and constructed, but, as in many other lines of apparatus, there has been a gradual elimination and standardization, until at present nearly every alternating current generator is of the revolving field type. Alternating current generators, like direct current dynamos, have field poles and an armature; but the commutator is replaced by slip rings, which either receive direct current for exciting the rotating field or deliver alternating current to brushes rubbing on them when the armature rotates. The absence of a commutator eliminates many of the problems met with in the design of a direct current machine; however, the questions of regulation, wave form, armature inductance, etc., present problems which are equally as formidable.

Alternating current generators are usually classified as follows:

- (1) Revolving field type.
- (2) Revolving armature type.
- (3) Inductor type.

A classification might also be made upon the current generated, as, single-phase, two-phase, three-phase, six-phase, etc. Any one of the three types may, of course, be either single-phase or polyphase. The number of phases does not affect the design as much as might at first be supposed, except in the calculation of the space required for armature conductors, heating effects, regulation, and armature reaction, as will be seen later.

Still another classification and a much better one for the purpose of design is as follows:

- (1) Bracket type.
- (2) Two-bearing pedestal type.
- (3) Three-bearing pedestal type.
- (4) Water-wheel type.
- (5) Engine type.
- (6) Turbine type.

Figs. 1 to 12 illustrate these different types. In case of engine-type generators, the manufacturer is usually required to furnish only the stator and rotor, the extra bearing pedestal, etc., being supplied by the manufacturer of the engine. Alternating-current generators are usually rated in kilo-volt amperes, (K.V.A.), instead of in kilowatts. Very often the same machine has two ratings. For example, the armature and field of a certain 100 K.V.A. machine is guaranteed not to increase in tempera-

ture more than 30° C. This same machine is rated at 120 K.V.A. and the ultimate temperature rise of the armature and field coils is given as 40° C. If the load is 125 K.V.A. the two-hour limit is given as 45° C. The 25 per cent overload ultimate temperature rise on the 40° C. machine is specified as 55° C. The momentary overload which a machine will take care of is specified at from 150

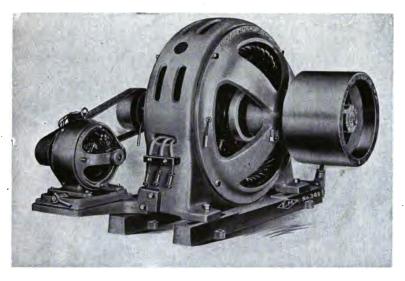


Fig. 1.—Bracket Type Alternating-current Generator (Electric Machinery Co.).

per cent to 200 per cent of normal load. The guaranteed regulation of the 30° C. machine referred to above was 6 per cent on normal load (100 K.V.A.) unity power factor and of the 40° C. machine, 8 per cent (120 K.V.A.). Small machines have poorer inherent regulation than large machines. Eight to 10 per cent is very good for a 25 K.V.A. machine running at say 1200 r.p.m. Five to 6 per cent

regulation would be expected for a 200 K.V.A. alternator running at say 600 r.p.m. Large slow-speed machines should give still better results. Sometimes machines are purposely designed with a rather poor inherent regulation and then used in connection with the Tirrill or some other voltage



Fig. 2.—Bracket-type Alternator (Westinghouse Co.).

regulator. Ordinarily an alternator is designed for an ultimate temperature rise of 40° C. The A.I.E.E. standardization rules are:

"General. The temperature of electrical machinery under regular service conditions should never be allowed

to remain at a point at which permanent deterioration of its insulating material takes place.

"In commutating machines, rectifying machines, pulsating-current generators, synchronous machines, synchronous commutating machines, and unipolar machines, the

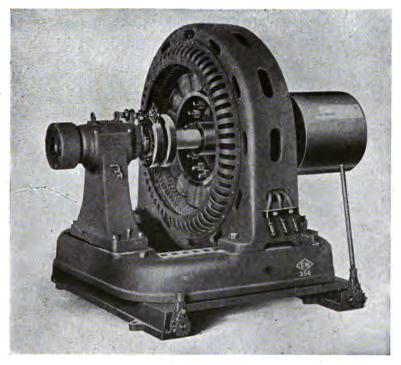


Fig. 3.—Two-bearing Pedestal-type Alternator (Electric Machinery Co.).

temperature rise in the parts specified should not exceed the following:

"Field and armature, 50° C.

"Collector rings, 65° C.

"Bearings and other parts of the machine, by thermometer, 40° C.

"Large Apparatus. Large generators, motors, transformers or other apparatus in which reliability and reserve overload capacity are important, are frequently specified not to rise in temperature more than 40° C. under rated load, and 55° C. at 25 per cent rated overload.

"Normal Conditions. Overload guarantees should refer to normal conditions of operation regarding speed, fre-



Fig. 4.—Two-bearing Pedestal Generator with Direct-connected Exciter, 200 K.V.A., 600 R.P.M. (Westinghouse).

quency, voltage, etc., and to non-inductive conditions in alternating-current apparatus, except where a phase displacement is inherent in the apparatus.

"Overload Capacities Recommended. The following overload capacities are recommended:

"a. Generators. Direct-current generators and alternating-current generators 25 per cent for 2 hours.

"b. Motors. Direct-current motors, induction motors, and synchronous motors, not including railway and other motors intended for intermittent service, 25 per cent for 2 hours, and 50 per cent for 1 minute. (The additional temperature rise at 25 per cent overload not to exceed 15° C. above those specified for rated loads.) The values 40° C. for the armature and field coils and 55° C. at 25 per cent overload are recommended for most purposes."

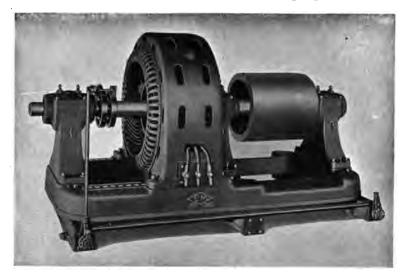


Fig. 5.—Three-bearing Pedestal Type (Electric Machinery Co.).

Effective E.M.F. Generated. It will be assumed that the flux density around the armature varies from point to point in accordance with the sine law. If the conductors of a coil side are concentrated in a single narrow slot the effective E.M.F. is given by the equation

$$(1) E_a = \frac{2.22 \phi f Z}{10^8 a},$$

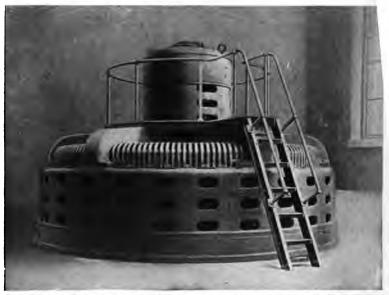


Fig. 6.—An 1875-K.V.A., 6600-volt, Three-phase, Water-wheel Generator (Westinghouse).

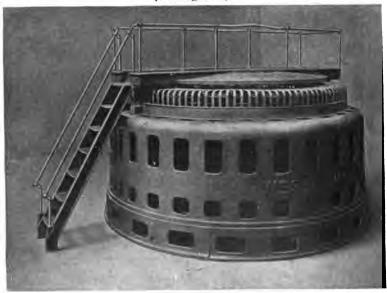


Fig. 7.—A 5000-K.V.A., 6000-volt, 3-phase, Water-wheel Generator (Westinghouse).

where $\phi = \text{maxwells of flux per pole}$;

f = frequency in cycles per second;

Z = number of inductors in series, usually is the number per phase;

a = number of armature circuits per phase.

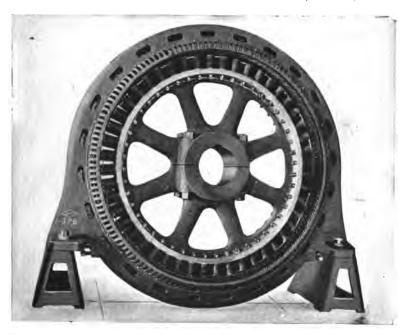


Fig. 8.—Slow-speed Engine-type Alternator (Electric Machinery Co.).

If the coil side is distributed between two or more slots the E.M.F. will be reduced. The E.M.F. for the wires in as many slots as there are poles may be calculated by formula (1), and can then be compounded by the parallelogram method, taking into consideration the phase difference due to the displacement of the slots.

Suppose, for example, that the coil side is placed in two

slots, and that the distance between the two slots is equal to one-third of the pole pitch. (See Fig. 13.)

The whole winding may be considered as made up of two parts and the E.M.F. in each part would be given by Eq. (1). When we compound two equal electromotive




Fig. 9.—Stator of 200-K.V.A., 225-R.P.M. Engine-type Alternator (Electric Machinery Co.).

forces having a phase difference $\frac{\pi}{3}$ or 60° we get a resultant which is equal to $\sqrt{3}$ or 1.73 times either component.

Therefore for two slots per pole per phase, where the distance between the slots is 60° the value 2.22 becomes



Fig. 10.—Stator Turbine-type Alternator-(Westinghouse).

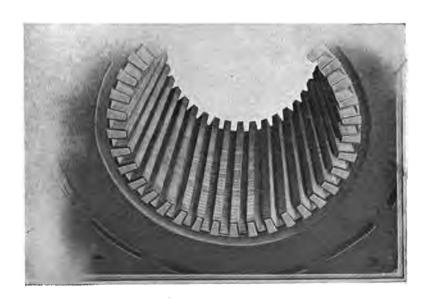

 ${\bf Fig.~11.} {\bf - Stator~Turbine-type~Alternator~(Westinghouse)}.$

 $2.22\sqrt{3}$ divided by 2 or 1.92, and the equation for the effective E.M.F. would be

(2)
$$E_a = \frac{1.92 \phi f Z}{10^8 a},$$

where, ϕ , f, Z and a have the same significance as in Eq. (1).

We will next consider the case of a distributed winding, that is, where there are so many equally spaced slots that the winding is practically equivalent to one in which the

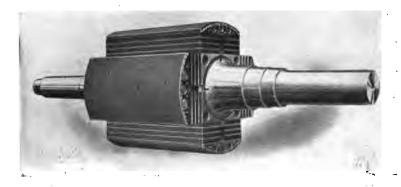


Fig. 12.—Rotor Turbine-type Alternator (Westinghouse).

wires lie side by side upon the surface of the armature. Let each coil side occupy $\frac{\alpha}{\pi}$ of the space between two adjacent poles. (See Fig. 14.)

If the wires were all simultaneously under the center of a pole the E.M.F. would be given by the equation


$$E_a = \frac{2.22 \phi fZ}{10^8 a}.$$

Assuming that the E.M.F. of each wire varies sinusoidally, reaching its maximum value under the middle of a pole, it will be reduced from this maximum value to a value which may be represented by

$$\frac{1}{\alpha} \int_{-\frac{1}{2}\alpha}^{+\frac{1}{2}\alpha} \cos \alpha d\alpha = \frac{\sin \frac{1}{2}\alpha}{\frac{1}{2}\alpha}.$$

The effective E.M.F. will then be

(3)
$$E_a = 2.22 \frac{\sin \frac{1}{2}\alpha}{10^8 a} \phi f Z.$$

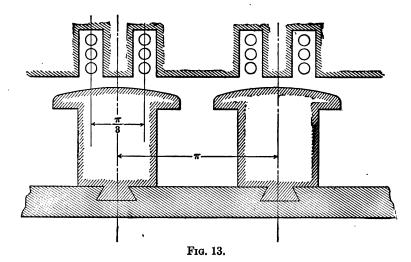


If we have one narrow slot per pole per phase then α is a very small angle, and since for very small angles the sine of the angle, is practically equal to the angle itself in π measure the quantity $\frac{\sin \frac{1}{2}\alpha}{\frac{1}{2}\alpha}$ would be equal to unity, and we obtain from Eq. (3), Eq. (1).

For a three-phase distributed winding where each coilside has a width equal to one-third the pole pitch

$$\alpha = \frac{\pi}{3} = 60^{\circ},$$

$$\sin \frac{1}{2}\alpha = \sin 30^{\circ} = 0.5,$$

$$\frac{\sin \frac{1}{2}\alpha}{\frac{1}{2}\alpha} = \frac{0.5}{\frac{\pi}{6}} = .955.$$

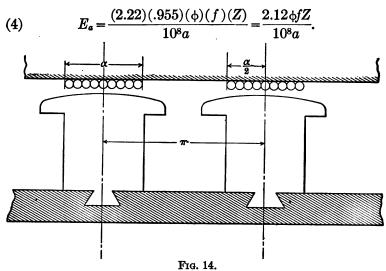

If we had a single-phase winding uniformly distributed over the armature surface then,

$$\frac{\sin \frac{1}{2}\alpha}{\frac{1}{2}\alpha} = \frac{\sin 90^{\circ}}{\frac{\pi}{2}} = \frac{2}{\pi} = .636.$$

(5)
$$E_a = \frac{(2.22)(.636)(\phi)(f)(Z)}{10^8 a} = \frac{1.41 \phi f Z}{10^8 a}.$$

A general statement of the equation for the effective E.M.F. would be as follows:

(6)
$$E_a = \frac{K \phi f Z}{10^8 a},$$

where,

$$K = \frac{2.22 \sin \frac{1}{2}\alpha}{\frac{1}{2}\alpha}.$$

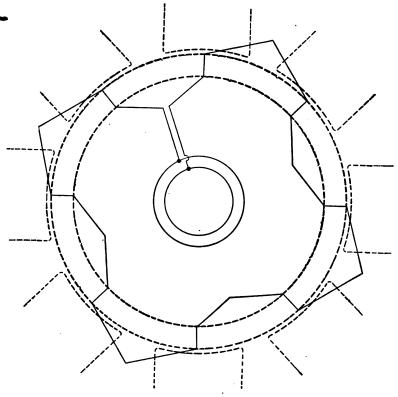


Fig. 15.—Single-phase Open-winding, One Slot per Pole.

The value of K will vary from 1.41 for a uniformly distributed single-phase winding, to 2.22 for a concentrated

winding. K should be determined for the particular case under consideration and then substituted in the general equation for effective E.M.F.

The various types of alternator armature windings may be divided into open-type windings and closed-type windings. Fig. 15 shows a single-phase open winding with one slot per pole.

The most familiar type of closed winding is found in the rotary converter. This is simply an ordinary D.C.

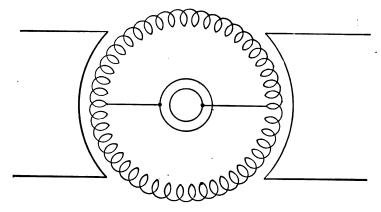


Fig. 16.

generator with taps taken from certain points on the armature winding. If single phase and bipolar, we would tap two diametrically opposite points on the armature winding, as indicated in Fig. 16.

If the machine is multipolar and is lap wound, the connections to the slip rings would be joined to all the equipotential points on the winding, so that each slip ring would have as many connections as there are pairs of poles,

or $\frac{a}{2}$.

The effective alternating E.M.F. is equal to .707 times the direct E.M.F.

The connections to the slip rings for a three-phase bipolar rotary converter are shown in Fig. 17. The alternating E.M.F. is 0.61 times the direct E.M.F.

For a four-phase machine, the alternating E.M.F. would be 0.50 times the direct E.M.F. and for a six-phase machine, the ratio would be 0.353.

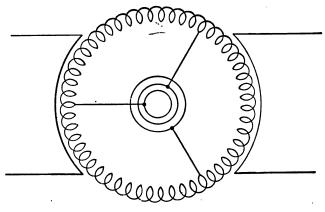


Fig. 17.

A four-pole three-phase rotary would have two connections to each slip ring if it were provided with a lap winding, three if it had six poles, etc., and there would be as many armature circuits per phase as there are pairs of poles.

Fig. 18 illustrates a two-phase open-type winding for an 8-pole machine with one slot per pole per phase.

Fig. 19 illustrates a three-phase open-type winding for an 8-pole machine with one slot per pole per phase. The three electromotive forces are 120 electrical degrees apart. It should be considered as three separate single-phase windings and then the three windings may be connected in either star or delta. If they are connected in star, the E.M.F. between the slip rings will be $\sqrt{3} = 1.73$ times the E.M.F. induced in one of the three separate single-phase

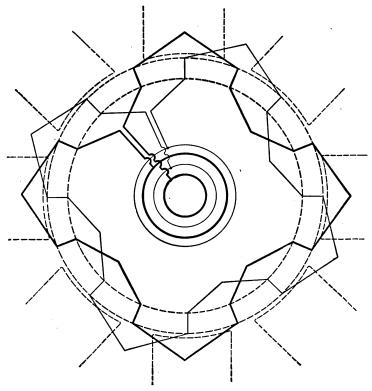


Fig. 18.—Two-phase Open-type Winding.

windings. If connected in delta, the E.M.F. will be equal to that which would be produced by one of the three windings, but the current in each of the three leads coming from the armature will be $\sqrt{3} = 1.73$ times the current in each one of the three windings.

The ratio of pole face to pole pitch varies with different designers. The larger the percentage of pole face to pole pitch the greater the magnetic leakage. It is usually con-

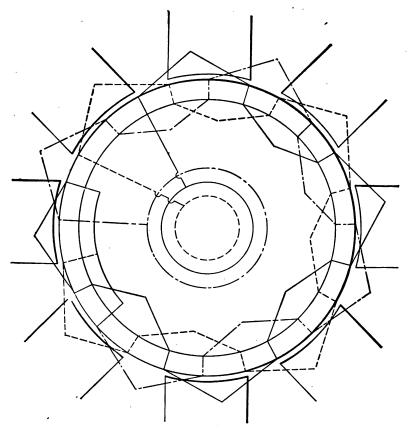



Fig. 19.—Three-phase Open-type Winding.

sidered good practice to keep the percentage of the armature covered by the poles down to between 60 and 65 per cent.

The number of slots per pole for two- and three-phase machines must be divisible by the number of phases, and when the same stampings are to be used for both twoand three-phase machines must be divisible by six.

According to Rushmore (Trans. A.I.E.E., Vol. XXI) most engine-type alternators are built with six or twelve slots per pole, twelve slots per pole being used where the kilowatts output per pole are high, and it is not desirable to increase the length of the armature to the amount necessary for six slots. Nearly all engine-driven alternators have six slots per pole. Many three-phase alternators, however, are designed with nine slots per pole or three per pole per phase.

E.M.F. Diagrams. If the coefficient of self induction of an alternator armature were constant at all loads, no matter what the power factor or excitation were, the vector diagram would be as follows:

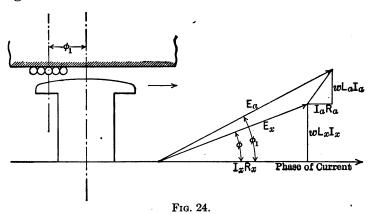

The E.M.F. E_a which is induced in the armature is the hypothenuse of a right-angled triangle one side of which is equal to the sum of the internal and external ohmic drops, and the other to the total inductive pressure drop, both internal and external.

The angle ϕ_1 is the angle by which the current lags behind the induced E.M.F. Where the angle $\phi_1 = 0$, the current would be a maximum when the center of the pole coincided with the center of a coil side. The angle ϕ_1 means then that the center of the pole has gotten by the center of a coil-side by this angle, before the current reached its maximum value.

When an alternator is working under load, the factors affecting the voltage drop are (1) armature resistance, (2) armature reactance, and (3) demagnetization or magnetization of the armature ampere turns, depending on the power factor.

We will now construct the E.M.F. diagram as follows:

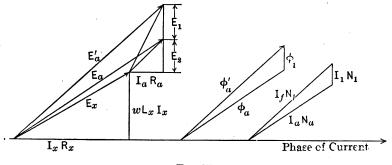


Fig. 25.

 $E_{a'} = \text{E.M.F.}$ which would be induced were there no armature resistance, reactance, or magnetization;

 $E_a = \text{actual E.M.F. induced};$

 E_1 represents the effect of the armature ampere turns on the flux;

 E_2 represents the leakage or armsture reactance drop.

The electromotive forces E_a' and E_1 are, of course imaginary, as is also the flux ϕ_a' and ϕ_1 . The ampere turns

 I_1N_1 and I_1N_1 , however, are real quantities, and act on a common magnetic circuit in such a way that their resultant produces the actual flux ϕ_a .

According to Thomälen, for single-phase machine the armature reaction in ampere turns per pair of poles is:

(7)
$$I_1 N_1 = \frac{0.9 I_a Z}{2p},$$

where I_1N_1 = number of ampere turns per pair of poles;

Z = number of wires in series on the armature;

p = number poles;

 I_a = effective value of the armsture current.

In the above formula it has been assumed that the coil-side is under a pole all the time. If the percentage of the armature surface covered by the pole shoes is $66\frac{2}{3}$ per cent, then according to Kapp,

(8)
$$I_1 N_1 = \frac{.736 I_a Z}{2n},$$

and if 50 per cent of the armature surface is covered by the poles, then,

(9)
$$I_1 N_1 = \frac{0.8 I_a Z}{2p}.$$

For values in between 50 and $66\frac{2}{3}$ per cent it is sufficiently accurate to interpolate.

For a three-phase machine in which the polar arc is two-thirds of the pole pitch the armature reaction is given as:

(10)
$$I_1 N_1 = \frac{2.12 I_a Z}{2p},$$

where Z = number of wires in series per phase, and I_a , I_1 , N_1 , and p have the same significance as before.

 I_1N_1 = armature reaction in ampere turns per phase per pair of poles.

The effect of armature reaction is to cross magnetize as long as E_a and I_a are in phase. If the current lags 90 degrees behind the E.M.F. then the armature reaction would be directly opposed to the field magnets. If the current leads the E.M.F. then this demagnetizing effect becomes negative, and the E.M.F. may rise instead of falling off with the load.

Synchronizing Power. If two or more alternators are working in parallel, they must of course run in synchronism. The mechanical engineer is often puzzled when he observes the fact that the connecting rods of two engines driving alternators in parallel will remain in step perfectly hour after hour. The mutual influence which the generators exert on one another, tending to maintain synchronism, is known as their synchronizing power.

It is assumed in the following that the bus-bar E.M.F., E_x , is not affected by the machine we have under consideration.

In Fig. 26 E_a is the induced E.M.F. in the machine under consideration. E_x is the bus-bar voltage, I_aR_a and ωL_aI_a are the ohmic and inductive drops respectively in the armature under certain conditions of load.

Fig. 27 is the same except that it is drawn for a larger load, therefore for more current. The values E_a and E_x are the same in both figures. In Fig. 27 O' is used as a center and an arc struck with E_a . O'B' is made equal to I'_aR_a and B'O equal to $\omega L_aI'_a$.

Then with O as a center and E_x as a radius an arc is struck intersecting the arc struck from O' with E_a at C. Then CB is made equal to O'B' and BD equal to B'O and E_a drawn from D to O, thus completing the diagram.

Fig. 26 and Fig. 27 differ in one very important point, namely—the angle α between E_a and E_x has increased. A study of Figs. 26 and 27 indicate to us at once that as the load is increased, there is an increase in the angle

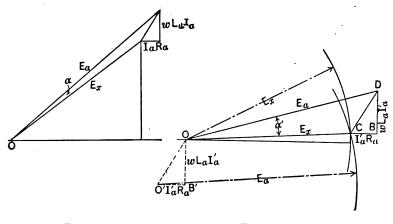


Fig. 26. Fig. 27.


between E_a and E_x , or vice versa. Therefore if the engine driving the alternator tends to increase in speed, it is automatically given a heavier load, and if it tends to decrease in speed, it is given a smaller load, hence is kept in synchronism with the other engines by this synchronizing power of the armature. It is further seen that the machine has its greatest synchronizing power when the inductive reactance of the armature is equal to its resistance; also that its synchronizing power disappears when the armature inductance is zero.



Fig. 28.—50-K.V.A., 2400-volt, Three-phase, 60-cycle Generator (Westinghouse).



Fig. 29.—Vertical-type Water-wheel Generator (Electric Machinery Co.).

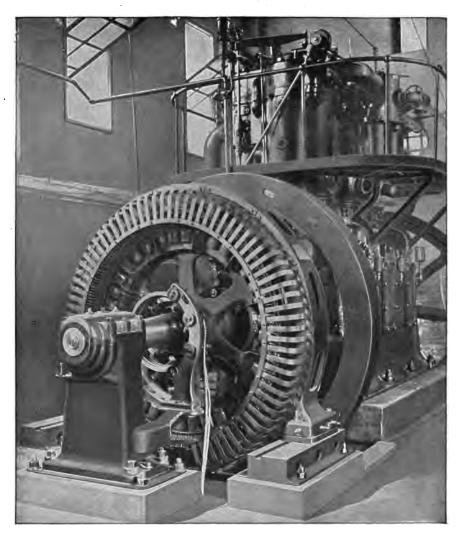

t Fig. 30.—260-K.V.A., 4000-volt, Three-phase, 60-cycle Generator Driven by Gas Engine (Westinghouse).

CHAPTER II

METHOD OF DESIGNING ALTERNATORS AND SYNCHRONOUS MOTORS

GIVEN the output, voltage, number of phases, frequency, type, efficiency, required regulation, allowable temperature rise, etc., the design is proceeded with as follows: bearing in mind, of course, that in some places it will be necessary to make estimates in order to proceed with the design, which later on are corrected. This cannot be avoided. In the following method an attempt has been made to so arrange the order of the process of making the calculations that this necessity of making estimates of later results is reduced to a minimum.

(A) Type

If the machine is a very small one, it may be of the revolving armature type, otherwise the revolving field type is usually selected. The design of a revolving armature alternator is very similar to the design of a direct-current generator. About the only difference is that slip rings are provided instead of a commutator, and the number of poles must be equal to two times the frequency divided by the number of revolutions per second. This usually means more poles than would ordinarily be provided on a direct-current generator. The prevailing peripheral velocities

of alternator armatures are therefore higher than for D.C. machines.

The method of design laid down in Volume I, with the modifications pointed out above and a knowledge of voltage and phase relationships, as given in Chapter I of this volume will suffice for the design of the revolving armature type. What follows will refer primarily to the revolving field types.

(B) Speed and Frequency

The speed depends to a considerable degree upon the frequency. The frequency is usually determined from the conditions under which the machine is to be operated. If the load is to be entirely or largely a lighting load the frequency is usually made 60 cycles per second. If the load is entirely motors, or rotary converters, or if the power output is transmitted a very long distance, say 150 miles at a potential of, say, 150,000 volts, it is usually generated at a frequency of 25 cycles per second. Table I gives the relationship between output and speed for 60-cycle generators of different types. Table II covers 25-cycle machines.

(C) Number of Poles

The number of poles is fixed by the frequency and the speed, hence is also determined from Tables I and II.

 ${\bf TABLE\ I}$ Relation Between Output and Speed for 60-cycle Alternators

Output in K.V.A.	Speed, r.p.m. Belted Type.	Speed, r.p.m. Engine Type.	Speed, r.p.m. Water Wheel
, 10	1800		
50	1200	360	
100	900	300	. 720
200	600	240	514
300	514	200	450
400	450	180	400
500	380	150	360
600	360	138	327
800	300	120	277
1000	277	100	240
1200		90	214
1500		90	187
2000	,	82	187
3000		75	150

TABLE II

RELATION BETWEEN OUTPUT AND SPEED FOR 25-CYCLE ALTERNATORS

Output in K.V.A.	Speed, r.p.m. Belted Type.	Speed, r.p.m. Engine Type.	Speed, r.p.m. Water Wheel.
10	750		
50	750		
100	500	167	500
200	500	150	500
300	375	136	375
400	375	125	300
500	300	116	300
600	250	107	250
800	214	100	250
1000	187	93	214
1200		88	214
1500		82	187
2000		75	187
3000		75	167

(D) Diameter and Length of Armature

(11)
$$D^{2}L = \frac{(Q)(K.V.A.)(10^{4})}{r.p.m.},$$

where D =outside diameter of armature laminations in inches;

L =length of armature iron including ventilating ducts in inches;

Q =an output coefficient.

In Tables III, IV and V are given the output coefficients for 60-cycle alternators.

TABLE III
OUTPUT COEFFICIENTS FOR HIGH-SPEED ALITERNATORS

Output in K.V.A.	Q	Output in K.V.A.	Q
10	20.0	300	4.4
25	10.0	500	4.1
50	8.0	800	3.9
. 75	6.8	1000	3.8
100	6.0	2000	3.65
150	5.1	3000	. 3.5
200	4.7	5000	3.45

TABLE IV

OUTPUT COEFFICIENTS FOR SMALL ENGINE TYPE OR LOW-SPEED BELTED
ALTERNATORS

SPEED 360 то 120 R.P.M.

Output in K.V.A.	Q	Output in K.V.A.	Q
50	6.00	350	3.4
100	4.80	400	3.3
150	4.20	450	3.2.
200	4.00	500	3.12
250	3.70	550	3.06
300	3.60	600	3.0

TABLE V

Output Coefficients for Large High-speed Alternators

speed 720 to 450

Output in K.V.A.	Q	Output in K.V.A.	$oldsymbol{Q}$
1000	3.8	3500	3.49
1500	3.7	4000	3.46
2000	3.6	5000	3.42
2500	3.55	6000	3.32
3000	3.51	7500	3.20

TABLE VI
OUTPUT COEFFICIENTS FOR LARGE SLOW-SPEED ALTERNATORS

Output in K.V.A.	Q	Output in K.V.A.	Q_{\perp}
1000	2.7	3500	2.42
1500	2.6	4000	2.38
2000	2.55	5000	2.30
2500	2.50	6000	2.22
3000	2.46	7500	2.16

Having determined the product D^2L , we must next assume either D or L. We have the choice of either taking a large diameter and making the armature short, or taking a small diameter and making the armature long. In machines of small diameter, the poles are crowded together, giving poor opportunity for regulation. With large diameters, the field coils are farther apart, the peripheral speed is higher, therefore the cooling of the armature is much greater. But again, machines of larger diameter require heavier castings, and therefore present greater difficulties in handling. Tables VII and VIII are intended to be used as a guide in deciding on the diameter. Table VII was made up from an actual line of machines made by a reputable manufacturing company.

The outside diameter is to the outside of the armature laminations, and the inside diameter is the bore of the stator.

TABLE VII

DIAMETERS, LENGTHS, AND OUTPUT COEFFICIENTS OF ALTERNATOR
ARMATURES

Output, K.V.A.	Outside Diam., Inches.	Inside Diam., Inches.	Length Armature, Inches.	Speed, r.p.m.	Frequency Cycles per Second.	Q
30	25 5	1811	4	1200	60	10.3
50	$27\frac{1}{2}$	20	41/2	1200	60	8.2
75	34	26.4	5	900	60	7.05
100	34	26.4	6	900	60 .	6.25
150	39	30₹	7 5 16	900	60	6.65
150	481	40 1	53	600	60	5.45
200	481	40 5	7	600	60	5.00

TABLE VIII. (ESTERLINE)

DIAMETERS OF BELTED ALTERNATOR ARMATURES

Output in K.V.A.	Outsi	de Diameter in I	nches.	Ratio of Leng of C	th to Diamete Fore.
K.V.A.	Min.	Mean.	Max.	Min.	Max.
30	14	17	23	.75	.33
50	16	20	29	.71	.31
75	20	28	35	.67	.28
100	22	34	40	.63	.26
150	26	42	4 6	.58	.23
200	· 36	51	58	.55	.22

TABLE IX

DIAMETERS, LENGTHS, AND OUTPUT COEFFICIENTS OF ENGINE TYPE ALITERNATORS

Output, K.V.A.	Outside Diam., Inches.	Inside Diam., Inches.	Length Armature, Inches.	Speed, r.p.m.	Frequency Cycles per Second.	Q
50	44	37.72	5	300	60	5.8
$55\frac{1}{2}$	44	38.2	5½	277	60	5.3
75	48.5	41.62	5½	300	60	4.9
75	48.5	42.22	5.75	277	60	4.95
100	56	49.25	5.75	300	60	5.4
100	56	49.72	4.50	257	60	5.25
111	62.5	55.72	5.50	225	60	4.46
400	128.5	120.	7	120	60	3.48
500	108	99.35	8.75	150	60	3.06
600	128.5	119	7.50	150	60	3.10
850	128.5	120	12	120	60	2.78
1250	153	144	12	100	60	2.25



Fig. 31.—Stator Frame, End Plate, Laminations (Westhingouse) .



Fig. 32—Engine-type Generator Stator, 75 K.V.A. (Westinghouse).

TABLE X

Diameters, Lengths, and Output Coefficient for Large Alternators

Output, K.V.A.	Outside Diam., Inches.	Inside Diam., Inches.	Length Armature, Inches.	Speed, r.p.m.	Frequency Cycles per Second.	Q
1500	128.5	116.75	181	225	60	4.55
2000	128.5	117.615	20.5	200	60	3.40
2500	128.5	110.25	20.5	360	60	4.20
3000	128.5	116.75	20.5	300	60	3.40
3000	128.5	117	20.5	240	60	2.72
3600	128.5	110.5	20.5	225	60	2.94
3750	128.5	109	18.5	360	60	2.94
3940	128.5	110.5	20.5	400	40	3.45
12500	182.	128.5	30	300	50	2.38

(E) Number of Inductors

(12)
$$Z_t = \frac{(\pi)(D_1)(IC)}{I_a};$$

where $Z_t = \text{total number of armature inductors}$;

 $I_a = \text{current in amperes};$

 D_1 = inside diameter of the armature = the bore;

IC = the product of current and conductors per inch of armature periphery.

The diameter D which we have determined by Eq. (11) is the outside diameter of the laminations. By referring to the several tables in which both inside and outside diameters are given, we can find a machine of approximately the same outside diameter, frequency and speed as the machine under consideration, and from the inside diameter which is given, estimate very closely what the bore of our machine should be. Later on, we may have to increase or

decrease it a little, in order to give the armature magnetic circuit the proper sectional area.

IC is in a sense a design coefficient and increases in about the same proportion as Q decreases.

Values of IC for commercial machines are indicated by Tables XI and XII.

Output, K.V.A.	IC.	Output, K.V.A.	IC.
10	200	125	475
25	350	150	500
50	390	175	525
75	415	200	550
100	450	225	590

Output, K.V.A.	IC.	Output, K.V.A.	IC.
50	450	400	660
100	495	450	675
150	520	500	695
200	560	550	700
250	590	600	705
300	615	1000	710
350	640	5000	725

As an illustration of the above, a certain 3600-K.V.A., 6600-volt, 3-phase, 60-cycle, 225-r.p.m. alternator was calculated as follows: D_1 was 115 inches. The number of armature ampere turns per inch of periphery = IC was

assumed as approximately 700. The normal current per phase (open-type star winding) was:

$$I_a = \frac{(3600)(1000)}{(6600)(1.73)} = 316$$
 amperes.

$$Z_i = \frac{(\pi)(115)(700)}{316} = 800.$$

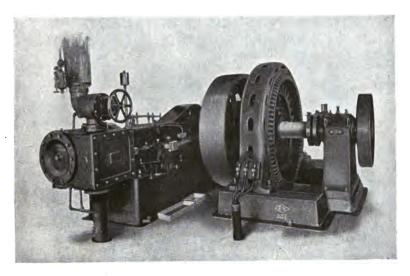


Fig. 33.—High-speed Engine-type Alternator (Electric Machinery Co.).

Next the number of armature slots have to be assumed. There are 32 poles and 3 phases. The total number of slots should be a multiple of the three phases and 32. Assuming 2 slots per pole per phase, the total number of slots is 32 times 2 times 3=192 slots; 800 divided by 192 gives the number of conductors per slot. The nearest whole number is 4. The total number of conductors will therefore be $4\times192=768$ —instead of 800 as assumed.

(F) Flux

Some years ago air-gap densities of 5000 to 6000 lines of force per square cm. were used. Now it is not unusual to find air-gap densities of from 10,000 to 12,000 lines of force per square cm. for belt-driven and engine-type alternators and up to nearly double this amount for turbine-type alternators. It is desirable that such a value be chosen for the air-gap density as will almost saturate the teeth, but at the same time, it must be remembered that this also tends to increase the leakage. Tables XIII and XIV are given as a guide:

TABLE XIII

AIR-GAP DENSITIES IN GAUSSES, 25-CYCLE ALTERNATORS, BELTED OR
ENGINE TYPE

K.V.A. Capacity.	Density, Lines per Sq. Cm.	K.V.A. Capacity	Density, Lines per Sq. Cm.
10	6000	2000	10000
50	7000	3000	10500
100	8000	4000	10800
300	8500	5000	11000
500	9000	10000	12000
1000	9500		

TABLE XIV

Air-gap Densities, in Gausses, 60-cycle Alternators, Belted of Engine Type

K.V.A. Capacity.	Density, Lines per Sq. Cm.	K.V.A. Capacity.	Density, Lines per Sq. Cm.
10	4500	2000	7500
50	5200	3000	7900
100	6000	4000	8200
300	6400	5000	8500
500	6750	10000	9000
1000	7100		

We have determined the frequency and the total number of conductors. The flux ϕ , for no load, is now determined from the formula:

(13)
$$E_a = \frac{(K)(\phi)(f)(Z)}{10^8 a},$$

where $\phi = \text{flux per pole at no load}$ and K, f, Z and a have the same significance as assigned in Chapter I.

It is suggested that ϕ be calculated for a value of E_a , that is, in from 5 to 8 per cent in excess of the normal noload voltage, so that ϕ as calculated for no load will approximate quite closely the actual flux per pole at normal load, and with normal terminal voltage.

Knowing the flux, we next determine:

(G) Breadth and Circumferential Width of Pole

$$(14) W_2 = \frac{\Phi}{WR},$$

where $\phi = \text{flux per pole}$;


B = no-load air-gap density (see Tables XIII and XIV); W = breadth of pole; usually is equal to the length

of the armature laminations, therefore usually is equal to L;


 W_2 = circumferential width of pole.

 W_2 = should come out not less than 55 per cent or more than, say, 72 per cent of the pole pitch. Otherwise it will be necessary to keep readjusting our calculations until a value within these limits is attained.

While W should be equal to L the pole may be a little narrower than the length of the armature, if it is necessary.

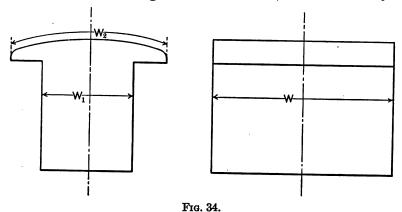

About the proportion shown in the following figure is sometimes used.

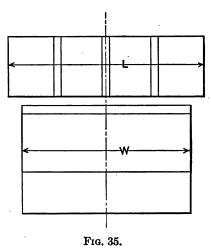

We have assumed so far that we have a sinusoidal distribution of the flux. This is not quite true in actual

machines, but is usually so very close that it will not greatly affect the results of our work, as to the E.M.F. and number of inductors, except in special cases. It is, however, very important that we determine the field and voltage forms, as a bad wave form is often very undesirable.

(H) Determination of Field and Voltage Forms

The author is indebted to an engineer formerly employed by the Westinghouse Company for the following method of determining the field form:


Draw two adjacent poles to any convenient scale, or rather just one pole as indicated in Fig. 36. Divide the pole pitch into 24 equal parts. Let S be the air-gap at the center of the pole. Let b_x be the mean width of a tube of force, and S_x its mean length. The magnetic conductivity is proportioned to b_x/S_x . The field density on the armature surface is proportioned to

$$\frac{b_x}{A_x S_x}$$
.

Let the maximum field density under the pole be 100. Use S as unity in measuring S_x . The density B_x at any point X would be

$$B_x = 100 \frac{1}{S_x} \frac{b_x}{A_x}.$$

Since in most cases $\frac{b_x}{A_x}$ is practically equal to unity, it is sufficiently accurate to measure the length of the central

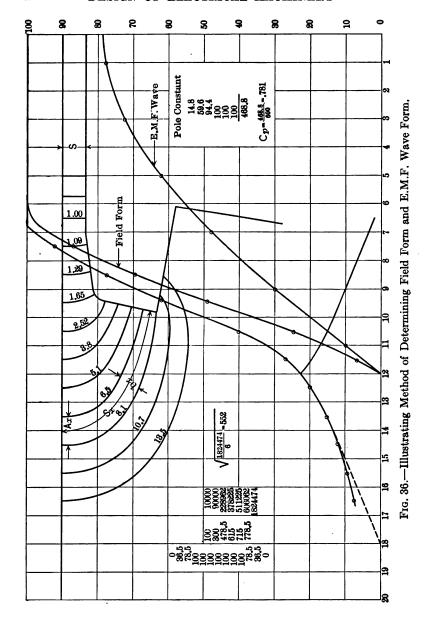

line of force in the tube in the units of S and make the field density B_x inversely proportional to this length.

$$B_x = \frac{100}{S_x}.$$

With this construction we can plot the field form of one pole's magnetic flux in the percentage of maximum density. As the fluxes of adjacent poles of opposite polarity are superposed on each other, the actual field form is obtained by subtracting the field densities of the two poles where they overlap. The method of construction is indicated by Fig. 36.

Let C_p = the pole constant, then (see Fig. 37)

 $C_p = \frac{\text{area enclosed by the actual field form}}{\text{area rectangle } ABCD}$

$$C_p = \frac{\int_0^{\frac{\alpha}{2}} B_x d\alpha}{\frac{\alpha}{2} B_{\text{max}}}.$$

Also


$$B_{\rm av.} = \frac{\int_0^{\frac{\alpha}{2}} B_x d\alpha}{\frac{\alpha}{2}},$$

therefore

$$C_p = \frac{B_{\text{av.}}}{B_{\text{max.}}}.$$

In the actual construction as in Fig. 36 we usually divide the base line into six equal divisions, and then take the average of the six middle ordinates in order to get $B_{\rm av}$. C_{ν} for a sine wave is equal to 1 divided by $\frac{\pi}{2}$, or is equal to .637.

E.M.F. Wave Form. The wave form of E.M.F. induced in the armature through the relative motion of the field and conductors can be constructed from the field form. The E.M.F. wave induced in each single conductor is exactly of the same shape as the field form itself. For more than one conductor, the resultant will be the sum of the values, therefore the resultant form of E.M.F. wave depends on the

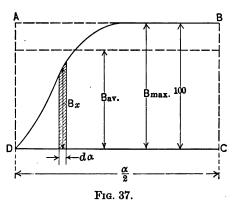

number and distribution of conductors forming one group or winding element.

It can be shown that if there are six or more slots per pole the wave form is practically independent of the number of conductors, that is, it may be constructed by using any convenient number. Twelve is a very convenient number to use. This gives 4 slots per pole per phase for three phase and six slots per hole per phase for two-phase machines. In single-phase machines it is usual to take into consideration the actual distribution of conductors.

The fundamental idea of construction is that we move the group of conductors in the magnetic field and determine the number of lines of force each conductor cuts. Adding these figures with their respective plus or minus signs, we obtain a value proportional to the E.M.F. induced in the whole group of conductors. In Fig. 36 is shown the construction for a three-phase alternator, assuming twelve slots or conductors per pole, and an open-type star winding. Eight conductors one-twelfth of a pole pitch apart are therefore assumed.

A study of Fig. 36 will very quickly show how the E.M.F. wave was constructed for this particular machine. The values of the E.M.F. are relative values only, and are expressed in terms of magnetic field density. The max. value of the E.M.F. wave shown in Fig. 36 is 778 and the square root of the mean squared value is 552; 552 divided by 778 gives us .702 (.707 is the value for a sine wave), hence we see that the E.M.F. wave approaches very closely to a sine wave, even though the field form does not.

The case considered above should give the designer an understanding of the fundamental ideas of the procedure, so that for any given machine under consideration he can devise his own method of constructing the E.M.F. wave from the field form. He should keep changing the shape of the pole, if necessary, until one is obtained that will produce, very closely, a sine wave.

The author's attention was recently called to an alternator in which the ninth harmonic was very pronounced. The machine had nine slots per pole, or three slots per pole per phase. Open slots were used, and the pole covered such a percentage of the armature surface that at one instant there would be six teeth and five slots under a pole,

whereas at the next instant there would be five teeth and six slots. Furthermore, the air-gap was of uniform width. The result was that the magnetic reluctance and hence the field strength varied considerably with the position of pole wheel. The result of course was very pronounced tooth harmonics. If a gradually increasing air-gap from the center of the pole toward each edge were employed, the tooth harmonics would probably have been avoided. We ought therefore to draw the field form with the pole in several different positions with respect to the armature, and make the pole of such a shape that we get the same strength of field for the various positions.

Coefficient of Chording.—The chording of the winding reduces the number of effective conductors in the ratio of the sine of one-half the electrical degrees between the two sides of the coil, or,

$$X = \sin \frac{\delta}{2},$$

where X =coefficient of chording, $\delta =$ angle between two sides of coil. (See Fig. 38).


(I) Number of Slots

The number of slots per pole for two- and three-phase machines must be divisible by the number of phases, and when the same stampings are to be used for both two- and three-phase machines, the number of slots per pole must be divisible by six. This means either six or twelve slots. Six are used unless the K.V.A. per pole are very high. On three-phase machines either six or nine slots per pole are usually used.

Slots may be divided into three classes:

- 1. Open slots;
- 2. Partially closed slots;
- 3. Closed slots.

Open slots permit the use of machine-wound coils, hence the coils may be entirely insulated before placing them in the slots. The self-induction due to slot leakage is of course less. There are more likely to be tooth har-

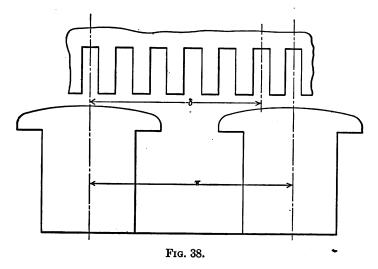

monics introduced into the E.M.F. wave form. The air-gap is somewhat less than in the case of closed or partially closed slots.

Partially closed slots require a great deal of care in construction. They decrease the magnetic reluctance, and the possibility of tooth harmonics is much reduced. The principal objection to partially closed or closed slots is, of course, the poorer regulation.

As the number of slots is increased the cost of the shop

work is increased. Filing of slots should be avoided as much as possible, therefore the additional allowance made in slot width for filing becomes more important as the dimensions of the slots are made smaller by increasing their number.

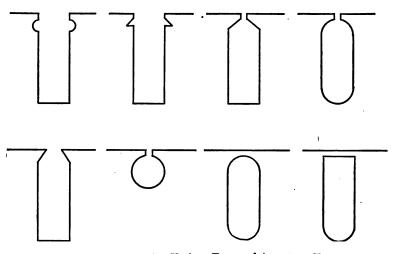


Fig. 39.—Illusurating Various Forms of Armature Slots.

(J) Dimensions of Armature Inductors

Find the required dimensions of the armature inductors from the following formula:

$$A_w = \frac{I_a}{k},$$

where A_w = area in square inches of armature inductor; I_a = current in amperes in each winding element; k = current density in amperes per square inch. For high-speed well-ventilated machines, k = 2200 to 2500; for low-speed well-ventilated machines, k = 1800 to 2200.



Fig. 40.—Stator with Assembled Core (Westinghouse).

(K) Insulation of Armature Inductors

The insulation of the armature coils is one of the most critical features of an alternator. The problem is much the same as in direct-current armatures, except that the voltages are often much higher. In order to obtain as high a space factor as possible in the armature slots, it is essential to select the very best materials. Careful attention should

also be given to the order of arrangement of the insulating materials, so that those which are strong dielectrically but weak mechanically are protected by those suitable for withstanding mechanical strains.

For slot linings, such materials as presspahn, leatheroid, horn fiber, red rope paper, and manilla paper are suitable. Great care must be taken to subject all slot-linings to



Fig. 41.—Rolled Steel Plate Spider with Field Coils Assembled (Westinghouse).

thorough drying and waterproofing processes. One very effective process is to subject them to prolonged soaking in hot linseed oil.

Mica and micanite should be used for slot linings in high-voltage machines only. For materials to be used to bind the conductors together into coils, there are several available, as for example cotton tape, linen tape, treated cloth tape, or cambric treated with one of various kinds of varnishes, impregnated manila paper, mica paper, oiled unbleached cotton, or a cotton covering acting as a skeleton for any one of several varnishes. The insulation around the individual conductors in no case should be less than a double cotton covering, and it should be filled with a good insulating varnish.

For further information see Turner and Hobart's book on "The Insulation of Electric Machines."

The width of a slot is generally made about equal to the width of a tooth, and its depth from two to three and one-half times its width. The magnetic density in the teeth must not tend to oversaturate them, but on the other hand should nearly saturate them so as to prevent a shifting of the lines of force as the pole approaches and leaves a tooth.

In order to get the average length of one turn lay off the armature coil to scale on a drawing board. An even number of slots per pole per phase will give coils all of which are interchangeable, so that only one mold is required. The use of this coil is practically limited to armatures having open slots. It is illustrated by Fig. 42.

The coils shown in Fig. 43 are simpler in shape but there are as many different forms required as there are coils per pole per phase.

Calculate the length of conductor in each coil. The total length of conductor in each phase will then be the number of coils in that phase times the length of conductor in each coil. This resistance, R_a , will be the resistance of one phase. For a three-phase star-connected winding, the resistance, R_a , between adjacent slip rings would be twice R_a , etc.



Fig. 42.—Interchangeable Armature Coils (Electric Machinery Co.).

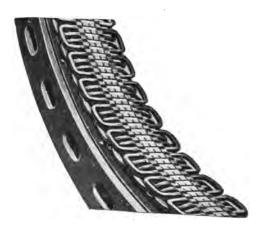


Fig. 43.—Non-interchangeable Armature Coils.

The heat loss in each phase of the armature will be $I_a^2R_{a'}$ where I_a is the current in each phase. For two phase the total I^2R loss will be (2) $(I_a^2R_{a'})$; for three phase, (3) $(I_a^2R_{a'})$, etc.



Fig. 44.—Cast Spider, Dovetailed Pole (Westinghouse).

(L) Iron Losses in the Armature

$$A_c = \frac{\phi}{2B_c},$$

where $A_c = \text{cross-section}$ of the armature core below the teeth; $B_c = \text{magnetic}$ density in the core below the teeth; $\phi = \text{useful}$ flux per pole (actual flux minus the leakage).

(17) Depth of core below teeth = $\frac{A_e}{L}$,

where L = length of armsture laminations + (insulation + ventilating ducts).

For 25-cycle alternators, B_c should not exceed from 70,000 to 75,000 lines of force per square inch; for 60-cycle machines it should not exceed from 45,000 to 55,000. A density of from 100,000 to 110,000 is usually employed



Fig. 45.—Rotor Core with Pole Pieces Assembled on Spider (Westinghouse). in the teeth, and from 85,000 to 95,000 lines of force per square inch in the pole cores.

The length and width of the teeth, the area of the core, and the area of the core below the teeth and the length of the armature being known, the volume of the core in cubic inches may be calculated.

(18)
$$W_c = (V_c)(.277);$$

where W_c = weight of core in lbs.; V_c = volume of core in cu.in.

There are two sources of iron losses in the armature. These sources are, first, the energy spent in continually reversing the magnetism in the armature core as the armature revolves. It is called hysteresis. Second, that used in setting up useless currents in the iron. It is called eddy current loss.



Fig. 46.—A Rolled Steel Plate Spider (Westinghouse).

Fig. 47.—A Cast-steel Spider (Westinghouse).

Although a number of very eminent scientists worked for years on the problem of hysteresis, it remained for an engineer of our time to establish the laws. In 1892 Mr. C. P. Steinmetz gave out the results of his experiments, showing that the energy dissipated by hysteresis varies directly as the frequency of the reversals, directly as the total mass of iron, and approximately, as the 1.6 power

of the magnetic density. This law he expressed by the following empirical formula:

(19)
$$P_h = \mu B^{1.6} fV:$$

where P_h = hysteresis loss in ergs;

 μ = coefficient of hysteresis;

f = frequency in cycles per second;

V =volume of iron in cu.cm.

The coefficient of hysteresis depends upon the physical and chemical qualities of the iron. For good armature iron it varies from .0012 to .0020. A fair value for good iron is .0015.

Reducing to practical units and inserting .0015 for μ we get,

(20)
$$P_c = \frac{(1.24)(B_c^{1.6})(f)(V_c)}{10^{10}};$$

where P_c = hysteresis loss in the portion of the armature below the teeth;

 B_c = magnetic density in lines per sq.in.;

 V_c = volume in cubic inches;

f = frequency in cycles per sec.

(21)
$$P_{t} = \frac{1.24B_{t}^{1.6}fV_{t}}{10^{10}};$$

where P_t = hysteresis loss in watts in the teeth;

 B_t = average density in the teeth;

 V_t = volume of the teeth.

$$(22) P_a = P_c + P_t,$$

where P_a = total hysteresis loss in the armature.

From his experiments, Steinmetz also found that the energy consumed by eddy currents induced in a body of iron varies as the square of the magnetic density, as the square of the frequency and in direct proportion to the



Fig. 48.—Laminated Steel Spider (Westinghouse).

Fig. 49.—Pole Piece Showing Dovetail Projection (Westinghouse).

volume of the iron. This he expressed by the following empirical formula:

(23)
$$P_{e} = (\eta)(B)^{2}(f)^{2}(V),$$

where $P_e = \text{eddy current loss in ergs}$; $\eta = \text{eddy current constant}$,

depending upon the thickness and the specific electrical conductance of the material. For the numerical value of this constant Steinmetz gives the following formula:

(24)
$$\eta = \frac{\pi^2}{6} d^2 Y 10^{-9} = 1.645 d^2 Y 10^{-9};$$

where d =thickness of iron laminæ in cm.

Y = electrical conductivity in mhos;

Y = 100,000 for ordinary armsture iron.

Inserting the value of η with reference to iron and reducing to practical units the following formula is obtained:

(25)
$$P_c' = \frac{(4.2)(d^2)(B_c)^2(f)^2 V_c}{10^{11}},$$



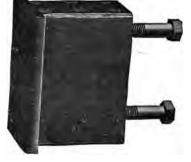


Fig. 50.—Cast Spider, Laminated Rim (Westinghouse).

Fig. 51.—Pole Piece with Bolts (Westinghouse).

where $P_c' = \text{eddy current loss in that portion of the armature below the teeth in watts;}$

d =thickness of iron laminations in inches (.014 is a fair value);

 B_c = magnetic density in the armature below the teeth;

f =frequency of reversals in cycles per second;

 V_c = volume of core below the teeth in cu.in.

(26)
$$P_{t'} = \frac{(4.2)(d^2)(B_t)^2(f)^2(V_t)}{10^{11}},$$

where $P_{i'}$ = eddy current loss in the teeth in watts; B_{i} = average density in the teeth; V_{i} = volume of the teeth in cu.in.

$$(27) P_a' = P_c' + P_t',$$

where $P_a' = \text{total eddy current loss in the armature.}$

$$(28) P_a^{\prime\prime} = P_a + P_a^{\prime},$$

where $P_a^{"}$ = total iron loss in the armature.

The American Society for Testing Materials have made a number of experimental determinations of the core losses in various armatures and have published curves in their proceedings which show the relationship between the losses per unit volume of the iron and the product of kilo-gausses and frequency. The author believes it is better for the student to work out the losses by means of the above formulas, as he will then get a definite idea as to just how the iron losses are distributed between the various parts of the magnetic circuit, and also just what proportion of them are due to hysteresis and to eddy currents.

(M) Temperature Rise in the Armature

The amount of the total energy consumed in an armature is $I_a{}^2R_a + P_a{}^{\prime\prime}$. The amount of heat liberated depends upon the area of its radiating surface, upon its circumferential velocity, and upon the ratio of radiating area to the pole area.

As a result of a very elaborate series of tests made at Cornell University the following conclusions were drawn. (See Transactions A.I.E.E., Vol. X, page 349.)

1. An increase of the temperature of the armature causes an increased radiation of heat per degree rise in



Fig. 52.—Rotor of 200 K.V.A. Sychronous Motor (Westinghouse).

temperature, but the ratio of increase diminishes as the temperature increases, and an increase of the amount of heat generated in the armature increases the temperature of the armature, but less proportionally.

2. An increase in the peripheral velocity increases the amount of heat liberated per degree rise in temperature, but the ratio of increase becomes less with higher speeds.

3. The effect of the field poles is to prevent the radiation of heat.

Mr. Alfred E. Wiener, by combining these results with data and tests of various machines found the values given in Table XV.

TABLE XV
SPECIFIC TEMPERATURE RISE IN ARMATURES

Peripheral velocity in feet per second $-V_p$.		rature recess $C = t$		unit of	energy	loss, in	
	Ratio of pole area to total radiating surface.						
	.8	.7	.6	.5	.4.	.3	
0	110°	100°	95°	90°	86°	83°	
10	80	74	70	67	64	62	
20	64	61	58	56	54	52	
30	55	53	51	49	48	46	
40	50	48	47	46	45	44	
50	48	47	46	45	44	43	
75	47	46	45	44	43	42	
100	46	45	44	43	42	41	
150	45	44	43	42	41	40	

The product of the specific temperature increase and the specific loss gives the rise in temperature.

(29)
$$T_{a} = t_{a} \frac{P_{a}^{"} + I_{a}^{2} R_{a}}{S_{a}},$$

where T_a =rise in temperature of armature in degrees centigrade;

 t_a = specific temperature increase;

 $S_a = \text{total radiating surface of armature in square inches};$

 $P_a'' + I_a^2 R_a = \text{total energy loss in the armature};$ $\frac{P_a'' + I_a^2 R_a}{S_a} = \text{specific energy loss.}$

The radiating or cooling surface of an armature is that portion of its superficial area which is in direct contact with



Fig. 53.—Generator Rotor with Collector Rings (Westinghouse).

the surrounding air. The shape and construction of the armature, and the size and arrangement of the field determine this radiating portion of the armature.

$$(30) S_a = S + S_1 + S_2 + S_3,$$

where S = external cylindrical surface of the armature in square inches;

 S_1 = internal cylindrical surface of the armature core in square inches;

 S_2 = radiating surface of the core and conductors at the two ends of the armature;

 S_3 = radiating surface presented by one side of a ventilating duct.

(31)
$$V_{p} = \frac{SV + S_{1}V_{1} + S_{2}V_{2} + S_{3}V_{3}}{S + S_{1} + S_{2} + S_{3}},$$

where V_p = average peripheral velocity of the radiating surface of the armature;

V =peripheral velocity of S;

 V_1 = peripheral velocity of S_1 ;

 V_2 = peripheral velocity of S_2 ;

 V_3 = peripheral velocity of S_3 .



Fig. 54.—Rotor with Squirrel-cage Winding (Westinghouse).

If the temperature rise does not come up to nearly the specified value, the current density in the armature inductors may be increased. If the temperature rise is too high it will be necessary to either increase the area of the armature

inductors, or increase the radiating surface by putting in more air ducts or by doing both.

The radiation coefficients of the stationary armature



Fig. 55.—Bearings Type G Generators, Rear Bearing and Halves of Collector Side Bearing (Westinghouse).



Fig. 56—Bearing Housing Open, Showing Bearing and Oil Rings, Bracket Type (Westinghouse.)

should be considered as if the armature were revolved, and the field pole held stationary, because of the fact that the poles drive the air through and around the armature at almost the same peripheral velocity that would be obtained were the armature rotated.

(N) Diameter of Shaft

The diameter of the shaft within the core may be found by the formula,

$$(32) D_c' = K_1 \sqrt[4]{\frac{W}{r.p.m.}},$$

where W =output of the machine in watts;

 K_1 = constant depending on the output of the machine. (See Table XVI.)

TABLE XVI
SHAFT CONSTANTS

Capacity in Kilo-watts.	K_1 .	Capacity in Kilo-watts.	K_1 .
1	.9	100	1.3
5	1.0	200	1.4
10	1.1	500	1.5
50	1.2	1000	1.6

The diameter of the bearing portion of the shaft may be obtained from the formula:

(33)
$$D_b = 0.8K_1 \sqrt[4]{\frac{W}{\text{r.p.m.}}},$$

where D_b = diameter of the bearing portion of the shaft in inches.

The length of the bearing may be found from the formula:

$$(34) L_b = K_2 D_b \sqrt{\text{r.p.m.}},$$

where L_b = length of the wearing portion of the bearing in inches;

 $K_2 = \text{constant.}$ (See Table XVII.)

TABLE XVII. (ESTERLINE)

Capacity in Kilo-watts.	K ₂ High Speed.	K ₂ Low Speed.
1	.075	.100
5	.100	.150
10	.115	.175
50	. 125	.200
100	. 150	.225
1000	. 200	.275

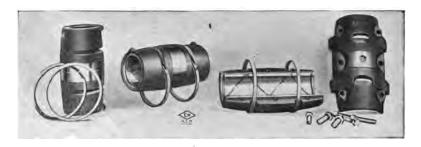


Fig. 57.—Bearings used on High Speed Generators (Electric Machinery Co.).

(O) Cross-section of Pole Core

If ϕ is the flux in the air-gap under one pole at no load, the corresponding full-load value of the flux in the pole core will be:

$$\phi' = \phi \lambda,$$

where

$\lambda = leakage coefficient.$

λ varies from about 1.15 to 1.40 in modern commercial machines. Ordinarily, 1.25 would be a safe value to use.

Crocker gives the following formula for an approximate determination of the leakage coefficient of revolving field alternators.

(36)
$$\lambda = 1 + \frac{(6)(g)(d)}{(a)(m)},$$

where g = length of air-gap; d = pole core height; a = length of pole arc;m = number of phases.

$$A_p = \frac{\phi'}{B_p},$$

where A_p = area of pole core; B_p = magnetic density in the pole core.


The breadth W, may be made equal to the length L, of the armature or a little shorter if desired, then:

$$W_2 = \frac{A_p}{W}.$$

If the core is laminated, an allowance of about 8 per cent should be made for the insulation between laminations. The pole-core density is usually from 65,000 to 85,000 lines of force per square if they are made of cast iron, and from 85,000 to 95,000 if sheet steel is used.

There is not very much difference in the cost of solid and of laminated poles. The advantages of solid poles are:


- 1. Their damping effect.
- 2. Can be more reliably fixed on the pole wheel in case of high-speed machines.
- 3. The section can be made oval is desired, thus giving increased economy in copper.

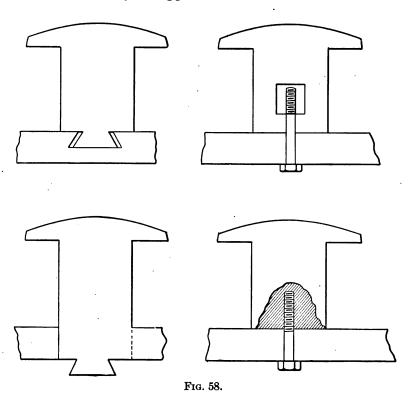

With laminated poles, it is easier to perfect the design as regards the shape of the pole piece, and the pole wheel is more apt to run true and keep its shape.

In Fig. 58 is shown different methods of fixing the pole to the pole wheel.

In small machines the pole cores and the magnetic circuit below the pole cores are stamped out of one piece of iron as indicated in Fig. 59.

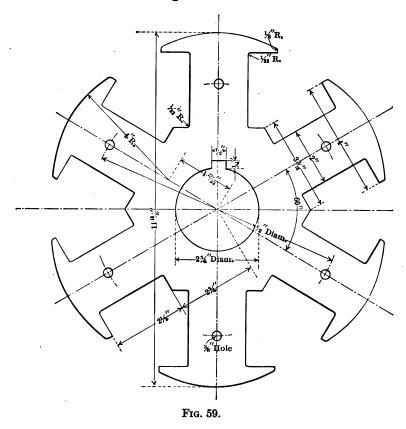

(P) Armature Inductance

The armature inductance due to armature reactance should be calculated before the field winding is designed. Since commercial alternators do not have a uniform magnetic reluctance, a perfectly distributed winding, nor a

sinusoidal flux distribution, an exact predetermination of the regulation without making any tests is impossible.

The following method of predetermining the armature inductance should give results approximating fairly closely actual results.

The inductance of the slots covered by a pole, and those not so covered will be calculated separately.

The reluctance of the path of the lines of force about one uncovered slot is given by the following formula:

(39)
$$R_{i} = \frac{1}{\frac{dL_{a}}{2b'} + \frac{d'L_{a}}{B} + \frac{2wL_{a}}{A\pi}},$$

where R_i = reluctance of the flux paths of one slot;

A =tooth pitch in cms.;

w =width of a tooth at the top in cms.;

B = width of a slot at the top in cms.;

d = depth of the coil in the slot;

d' = depth of the slot above the coil;

b =the width of the slot at the bottom;

b' = the width of the tooth at the bottom;

 L_a = the length of the armature laminations in cms.

The coefficient of self-induction is numerically equal to the number of lines of force one ampere will produce times the number of turns divided by 10⁸, therefore,

$$(40) L_l = \frac{(\phi_l)(t)}{108},$$

where ϕ_i = the number of lines of force produced by one ampere;

t = number of turns in the coil is equal to the number of conductors per slot;

 $L_i =$ inductance in henrys,

 \mathbf{and}

(41)
$$\phi_{i} = \frac{(1.257)(t)}{R_{i}}$$

To this flux must be added that linked with the end connections of the coil. This varies from 0.45 to 0.75 maxwell per ampere turn per centimeter of the length, L_{\bullet} , of the end connections.

The average value is usually not far from 0.55, hence,

(42)
$$\phi_{l} = t \left(\frac{1.257}{R_{l}} + 0.55 L_{e} \right).$$

The minimum value of the inductance will of course occur when the maximum number of slots are uncovered. In a three-phase machine, there may be a time when all the conductors in a winding element would be uncovered. Therefore the minimum inductance would be approximately equal to:

$$L_{\min} = (L_l)(n)(n'),$$

where L_i = inductance of one uncovered slot;

n =number of slots per pole per phase;

n' = number of winding elements in series, is the number of poles for an open type winding;

 $L_{\min} = \min \max \text{ armature inductance.}$

For covered slots the inductance will be greater, since the flux passes from the top of a tooth to the pole face, and makes its return circuit through the pole face back to an adjacent slot. The reluctance for a covered slot is:

(43)
$$R_{i}' = \frac{1}{L_{a}\left(\frac{d}{2b'} + \frac{d'}{B} + \frac{w+A}{4g}\right)'},$$

where L_e = the length of the end connections in cms.; g = length of air-gap in cms.

The equation for ϕ_l and L_l are the same as for the uncovered slots. The maximum inductance is

(44)
$$L_{\text{max.}} = (L_{l'})(n)(n')$$

where L_{l}' = the inductance for one covered slot.



Fig. 60.—A 6000-K.V.A. 6600-volt, Three-phase, 60-cycle Horizontal Waterwheel Generator (Westinghouse).

The average value $L_{\rm av.}$, is obtained by multiplying $L_{\rm min}$ by the percentage of the armature which is not covered by the poles and $L_{\rm max.}$ by the percentage which is. For example if the inductance is 10 henrys assuming all the slots to be uncovered and 15 henrys when they are all covered, and the poles cover two-thirds of the surface of the armature, the average inductance would be, one-third of 10 plus two-thirds of 15=13.33 henrys.

The total armature reactance is

$$(45) X_a = 2\pi f L_{\text{av.}}.$$

The armature reactance drop is

 $(46) E_2 = I_a X_a,$





Front. Rear. Frg. 61.—Collector Rings (Westinghouse).



Fig. 62.—Collector Rings, Brush Holders and Supporting Brackets (Electric Machinery Co.).

where E_2 = armature reactance drop per phase (see vector diagram in Chapter I).

 $X_a = \text{armature reactance per phase}$,

f =frequency,

 $L_{\rm av}$ = armature inductance.

As an example of the calculation of armature inductance we will take the following:

The dimensions are:

$$d = 3.60 \text{ cms.}$$
 $L_e = 45.00 \text{ cms.}$ $A = 4.62$ " $t = 24$ $g = .50$ " $n = 2$ $d' = 1.20$ " $n' = 14$ $m = 2$ $m' = 2$ m

The reluctance of the path of the lines of force about one uncovered slot is:

$$R_{i} = \frac{1}{\frac{(3.60)(15)}{(2)(2)} + \frac{(1.2)(15)}{2.25} + \frac{(2)(2.5)(15)}{(4.62)(\pi)}},$$

$$R_{i} = .0375 \text{ oersted},$$

$$\phi_{i} = 24 \left[\frac{1.257}{.0375} + (0.55)(45) \right],$$

$$\phi_{i} = 1398,$$

$$L_{i} = \frac{(1398)(24)}{10^{8}} = .000335 \text{ henry},$$

$$L \text{ min.} = (.000335)(2)(14) = .00938 \text{ henry},$$

$$R_{i}' = \frac{1}{15\left(\frac{3.6}{(2)(2)} + \frac{1.2}{2.25} + \frac{2.5 + 4.62}{(4)(50)}\right)'},$$

$$R_{i}' = .0133 \text{ oersted},$$

$$\phi_{i} = 24\left[\frac{1.257}{.0133} + (0.55)(45)\right],$$

$$\phi_{i} = 2862,$$

$$L_{i}' = \frac{(2862)(24)}{10^{8}} = .000687,$$

$$L_{\max} = (.000687)(2)(14) = .0192.$$

The poles cover 65% of the armature, therefore,

$$L_{\text{av.}} = (.65)(.0192) + (.35)(.00938),$$

= .01496 henry.

The armature reactance per phase would be

$$x_2 = (2)(\pi)(60)(.01496),$$

 $x_2 = 5.62 \text{ ohms},$
 $E_2 = (30)(5.62) = 168.6 \text{ volts}.$

(Q) Armature Magnetization

The armature reaction in ampere turns may be calculated by means of the formulas given in Chapter I.

These give the result in ampere turns per pair of poles. Since there are as many magnetic circuits as there are poles, and as we usually calculate the number of field ampere turns per pole, it will be found most convenient to divide the results given by these formulas by two, so as to get the armature reaction in ampere turns per pole;

(R) Cross-section of the Wheel Rim

The cross-section of the wheel rim for a multi-polar machine will be

$$A_{w} = \frac{\Phi'}{2B_{w}},$$

where $\phi' = \text{flux per pole}$;

 B_w = magnetic density in the wheel rim.



Fig. 63.—Brush Holder Bracket Stand (Westinghouse).

If the wheel rim and the pole cores are made of the same material the magnetic density employed in the wheel rim is usually only about 80 to 90 per cent of what it is in the pole core. For a cast-steel wheel rim use 65000 to 75000 lines of force per square inch. For cast iron, from 40000 to 45000.

(S) Air-gap

The air-gap to be used depends very largely upon the required regulation. A long air-gap means more field ampere turns in proportion to the armature ampere turns, therefore better regulation, especially on low power factors. On the other hand, a long air-gap increases the leakage.

As a general rule, about 75 per cent of the field ampere turns should be required to drive the flux through the airgap. This may require an air-gap as small as one-eighth



Fig. 64.—Bed Plate for Bracket Type Generator (Westinghouse).

of an inch, or as large as three-quarters of an inch. For small machines three-sixteenths to three-eighths is common. For large machines it usually lies between three-eighths and three-quarters.

Where good regulation is necessary, it is usually found advisable to make the ratio between the armature and field ampere turns about one to three.

(T) Exciting Ampere Turns

Lay off one of the magnetic circuits on a drawing board to scale, and prepare a table as follows:

Part.	Magnetic Density.	Length of Mean Line.	Ampere Turns per Inch.	Total Ampere Turns.
Arm. core Teeth Air-gap Pole shoe Pole core Wheel rim				
Total				

As the quantities indicated are obtained insert them in the above table; changes made necessary by further adjustments in the design can quickly and very easily be made by referring back to this table.

The ampere turns may be obtained either from tables or by the following formula:

$$NI_m = \frac{.8 \phi_m L_m}{A_m y},$$

where NI_m = ampere turns necessary to force the flux through the part of the circuit under consideration;

 ϕ_m = corresponding number of lines of force;

 $L_m = \text{mean length in cms.};$

 $A_m = \text{area in sq. cm.};$

y =permeability.

If the dimensions are given in inches, then

$$NI_m = \frac{.3133 \phi_m L_m}{A_m y}.$$

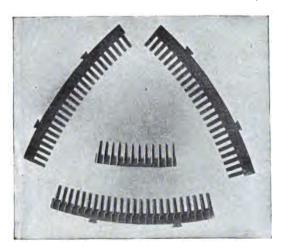


Fig. 65.—Segments of Core Laminations, Finger Plate and Ventilating Finger Plate (Westinghouse).



Fig. 66.—Rotor Construction (Electric Machinery Co.).

TABLE XVIII

PERMEABILITY OF DIFFERENT KINDS OF IRON AT VARIOUS MAGNETIZATIONS

Density, Lines per Square Inch.	Annealed Wrought Iron.	Commercial Wrought Iron.	Gray Cast Iron.	Cast Steel.	Sheet Steel
20000	2600	1800	850	2500	2400
25000	2900	2000	800	2600	2500
30000	3000	2100	600	2750	2625
35000	2950	2150	400	2700	2750
40000	2900	2130	250	2650	2860
45000	2800	2100	140	2600	2975
50000	2650	2050	110	2475	3100
55000	2500	1880	90	2300	3000
60000	2300	1850	70	2100	2900
65000	2100	1700	50	1800	2775
70000	1800	1550	35	1475	2660
75000	1500	1400	25	1160	2500
80000	1200	1250	20	1000	2400
85000	1000	1100	15	850	1900
90000	800	900	12	750	1400
95000	530	680	10	690	1100
100000	360	500	9	590	900
, 105000	260	350		525	480
110000	180	260		475	310
115000	120	190	• • •	425	178
120000	80	150	• • •	390	145
125000	50	120		350	99
130000	30	100		250	69
135000	20	85		150	40
140000	15	75	•••	100	20

By means of the above equations find the number of ampere turns required to force the no-load flux through

- 1. The armature core;
- 2. The teeth;
- 3. The air-gap;
- 4. The pole shoe;
- 5. The pole core;
- 6. The wheel rim.

Add these together, thus obtaining the number of noload ampere turns per pole.

In order to have plenty margin on low-power factors,

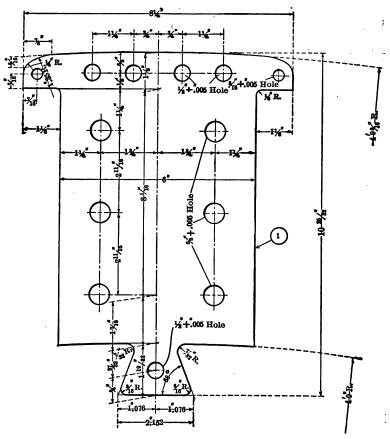


Fig. 67.—Pole Piece of a Large Generator (Westinghouse).

the field voltage required at no load should not be more than 50 per cent of the exciter voltage. If a 110-volt exciter is used, the required exciter voltage at no load should be taken as 55 volts. For a 220-volt exciter this value may be doubled. Then for a 110-volt exciter, the E.M.F. per pole would be 55 divided by the number of poles, or,

$$(50) E_f = \frac{E_e}{p},$$

where $E_f = E.M.F.$ per pole; p = number of poles; $E_e = E.M.F.$ of exciter.

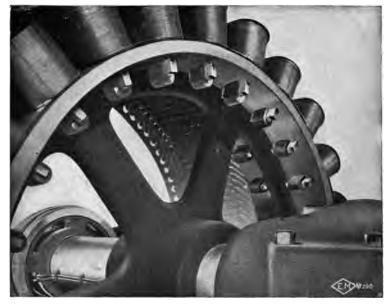


Fig. 68.—Illustrating Method of Fastening Field Coils (Electric Machinery Co.).

For the first trial, get the capacity of the exciter by multiplying the average of the per cent limits given in Table XIX by the capacity of the alternator. The current in the field coils will then be this capacity in watts divided

by the normal voltage of the exciter. The resistance of the field coils should then be kept down to such a point that only about one-half the exciter voltage is required to supply the required field current at no load.

Assume what you consider is a reasonable depth of field winding after consulting other designs, and calculate the length of a mean turn. Allow about 1200 circular mils per ampere, select such a size wire, that it will have a resistance R_t that will permit a current to flow that will give the required number of ampere turns when the current is multiplied by the number of turns which can be accommodated



Fig. 69.—Edge Wound Strap Field Coil (Westinghouse).

in the space available. If the circular mils per ampere are in the neighborhood of 1200, the temperature rise will probably come out about right. Different sizes of wire will have to be tried, and the space available for accommodating the winding may have to be changed in order to accommodate the required number of turns. Since we have allowed 1200 circular mils per ampere, at no load, the current density will probably not exceed 800 circular mils per ampere at full load, therefore should be liberally enough designed.

Check the field coil for temperature rise by the following formula, which is based on Timmerman's experiments, at Cornell University. (See Trans. A.I.E.E., page 342, Vol. X.)

$$T_s = \frac{83W_p}{S_n},$$

where T_s = temperature rise of the field coil in degrees C.; W_p = loss per pole in watts;

 S_p = total radiating surface, of the coil in square inches;

T. should not exceed approximately 20° C. at no load. After the regulation has been determined, T. should again be calculated for the field amperes required at full load, and 80 per cent power factor and should not exceed 40° C.

The usual limits of the excitation losses is indicated by the following table:

TABLE XIX

EXCITATION LIMITS OF ALTERNATORS

Output of Alternator in K.V.A.	Usual Limits in Per Cent.	Output of Alternator in K.V.A.	Usual Limits in Per Cent.
10	2.00 to 5.00	500	.55 '' 2.25
50	1.75 to 4.00	750	.50 " 2.00
100	1.25 to 3.75	1000	.50 '' 1.75
200	1.10 " 3.00	5000	.45 '' 1.50
300	.85 '' 2.65	10000	.40 '' 1.25
400	.60 '' 2.50		

(U) Field Loss

The watts lost in the field coils will be:

 $(52) W_f = I_f^2 R_f,$

where $W_I = \text{field loss in watts}$;

 I_f = current in field;

 R_f = resistance of field winding.

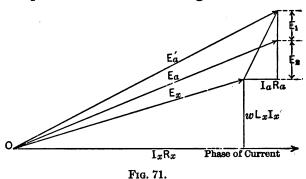


Fig. 70.—Illustrating Armature Winding having Interchangeable Coils (Electric Machinery Co.).

(V) Regulation

The E.M.F., E_1 , which in the vector diagram in Chapter I represented the effect of armature reaction, is the E.M.F. which we would have if the ampere turns of the armature only were the magnetizing force. Therefore E_1 may be calculated by substituting in the formula for the E.M.F. of the

machine, the value of ϕ that would be produced if the magnetizing force were the number of ampere turns in the armature winding only. Since this flux is always combined with the flux produced by the field, the permeabilities used should be those which correspond to full load conditions. By referring back to the table under the heading, Exciting Ampere Turns, we can quickly and easily get the flux by using the information given in this table. We now know all the components of the vector diagram of electromotive




forces. Calculate E_a for normal E.M.F. at the terminals of the machine as per the above diagram. (Fig. 71.)

Calculate what field current will be required to produce the E.M.F. E_a , also the E.M.F. E_a' , that this field current would produce if the load were all thrown off. The regulation in per cent will then be:

(53) Regulation =
$$\left(\frac{E_a' - E_x}{E_x}\right)$$
100,

where $E_x = \text{normal terminal E.M.F.}$;

 $E_{a'} = \text{E.M.F.}$ that would be produced at no load by the field current required to give E_x when the machine is loaded.

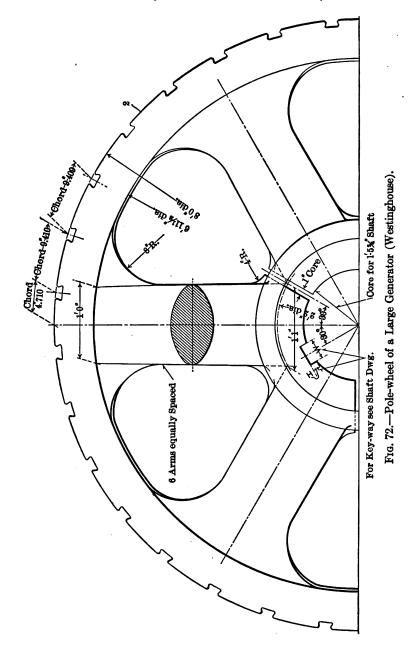

Calculate the regulation for $\frac{1}{4}$, $\frac{1}{2}$, $\frac{3}{4}$, $1\frac{1}{4}$ and $1\frac{1}{2}$ loads, and for unity power factor. Also calculate the regulation for full load and for 80 per cent power factor.

(W) Efficiency

Assume the windage and bearing friction losses and calculate the efficiency at various loads. These losses are very difficult to predetermine with even a reasonable degree of accuracy. They vary widely in similar machines of the same type, speed and capacity. For high-speed belt-driven machines, ranging in speed from 900 r.p.m. to 1200 r.p.m. those losses should range from 1.5 to 3.5 per cent. For engine-type machines running at from 125 to 360 r.p.m. they should range from $\frac{1}{2}$ of 1 per cent to 1.5 per cent. For very large slow-speed machines with good alignment it might be even less.

The efficiency may be obtained by the following formula:

(54) Efficiency =
$$\frac{\text{output}}{\text{output} + \text{losses}}$$
.

Tabulate the losses and efficiency as follows:

		7	
`.		<i>.</i> *	

The temperature rise of the armature and of the field at various loads should be calculated by the methods already given and curves plotted showing the results.

The remaining mechanical details are to be worked out on the drawing board as the work proceeds.

CHAPTER III

DESIGN OF ROTARY CONVERTERS

The design of a rotary converter is carried out along the same lines as that of a direct-current generator, except that not nearly so much armature copper is required because of the fact that the current the machine requires as a synchronous motor offsets to a greater or less degree, depending upon the number of phases and the power factor, the current which the machine delivers as a direct-current generator. Also, collector rings must be added to conduct the alternating current to the proper points in the armature winding, and the number of poles is usually fixed by the frequency.

The design of direct-current generators was covered in Volume I, and synchronous motors in Chapter II of this volume, therefore it will be necessary to discuss only a few points in connection with rotaries.

Since the speed is not fixed by any type of prime mover, the speed is usually higher and the poles fewer with more slots per pole per phase. For example, a certain 300-kilowatt, 3-phase rotary has 4 poles and runs at 750 r.p.m. and there are 8 armature slots per pole per phase.

The following relation exists between the armature copper losses in a D.C. generator and in a rotary converter. Assuming the losses in a direct-current generator equal to unity, the losses in a rotary for unity power factor are as follows:

90



Single-phase = 1.38Two-phase = 1.38Three-phase = 0.56Four-phase = 0.38Six-phase = 0.27

For 80 per cent power factor, the values are as follows:

Single-phase = 2.50Two-phase = 2.50Three-phase = 1.23Four-phase = 0.94Six-phase = 0.77

The alternating E.M.F. available between adjacent slip rings in rotary converters in terms of the direct voltage is as follows:

> Single-phase = 0.707Two-phase = 0.707Three-phase = 0.61Four-phase = 0.50Six-phase = 0.353

The above values are based on a sinusoidal field. For a rectangular field with the poles covering about 70 per cent of the armature surface, they would be about 5 per cent higher.

A six-phase rotary may be supplied from a three-phase line through three transformers as indicated in Fig. 73 and Fig. 74.

Rotary converters of any considerable output are usually six-phase. Six-phase rotary converters have the following advantages.

- (1) A higher rating, therefore they are smaller and cheaper for a given output.
- (2) The magnetizing effects of the currents in the armature are more nearly balanced, therefore the commutation is better.

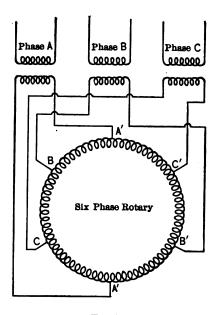


Fig. 73.

(3) They run more stably than rotaries with fewer phases. There is less tendency to "hunt."

Damper Winding.—In order to prevent hunting, it is essential that the poles of a rotary converter be equipped with a damper winding. Hunting is usually started by some outside force, as, for example, a sudden increase in the load on the rotary which makes its armature drop back relative to the synchronous relation of the field. The next instant it will swing ahead, and unless some force tends to

make it retain its fixed relative position it will continue to surge back and forth. The damper winding on the field poles has this retaining force, since for any relative move-

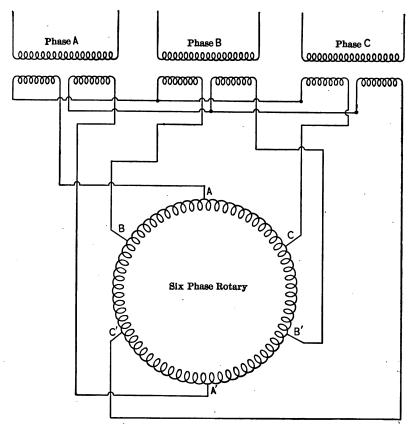


Fig. 74.

ment between the rotation of the armature and of the field, an E.M.F. will be induced in the bars of the damper winding which will cause a current to flow that will set up a field that will counteract the field set up by the surging. An excellent damper winding is obtained by putting on a winding similar to that used on the armature of the squirrel-cage type of induction motors.

The rotary may be started from the direct-current side similar to a direct-current motor and synchronized on the

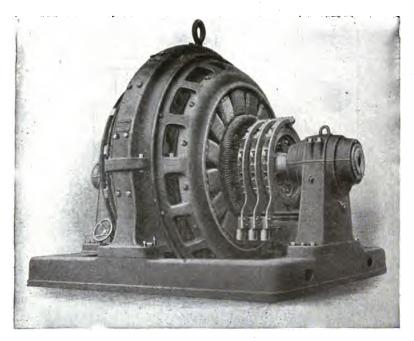


Fig. 75.—1000 K.W. Six-phase Rotary Converter (Westinghouse).

alternating-current side the same as an alternating-current generator, or it may be started by means of a small induction motor, connected direct to the shaft of the rotary. After being brought up to speed it has to be paralleled both on the direct-current and alternating-current side; or it may be started as an induction motor by impressing alternating current on the armature of the converter. The

damper winding will then act as the secondary of an induction motor, and the converter will speed up. This is a most convenient way of starting and the method most commonly used.

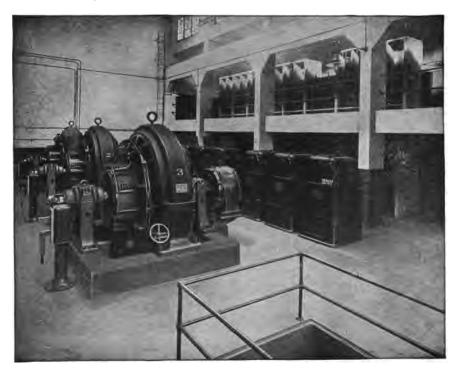


Fig. 76.—Rotaries in Sub-station, Capitol Traction Co., Washington, D. C. (Westinghouse).

Compounding of the Rotary Converter

It has been said that the ratio between the alternatingcurrent voltage and the direct-current voltage of a rotary is fixed. A certain amount of variation may be obtained through variation of the exciting current of the rotary, in conjunction with reactance available in the armature circuit. This is to be understood as follows:



Fig. 77.—Self-starting Rotary Converter 750 K.W. Six-phase, 60-cycle (Westinghouse).

A rotary converter running off the alternating-current circuit may be regarded as a synchronous motor. There



Fig. 78.—Rotor with Synchronous Regulator Armature and Starting Motor Rotor, 770 K.W. (Westinghouse).

is a certain fixed field current at which the rotary will draw the smallest alternating current from the line. This corresponds to unity power factor. If this field current is changed, the current from the line is changed also. By increasing the field current, the rotary is made to draw a leading current from the alternating-cur-



Fig. 79.—3000 K.W. Self-starting Rotary Converter, 600-volt (Westinghouse).

rent circuit, and by decreasing the field current, it is made to draw a lagging current from the circuit.

Assume now that the rotary is over-excited. It delivers a leading wattless current to the line. This current in conjunction with reactance in the circuit will cause an

inductive drop in the rotary armature which has an influence upon the impressed alternating-current voltage of the converter. This effect is to raise the impressed rotary voltage. Similarly underexcitation will cause a lowering of the impressed voltage. Thus a certain amount of variation can be obtained by introducing wattless currents in the rotary armature and by providing for a certain amount of reactance. Of course such a procedure tends to increase



Fig. 80.—Oscillator and Speed Limit Device, Switch Open (Westinghouse).

the heating of the converter armature and causes the converter to operate at power factors other than unity. However, it is possible to obtain a certain amount of automatic regulation in this manner without injury to the rotary or without bad effects upon the circuit on which it operates.

It is not unusual to provide a series field winding on the poles which automatically increase the excitation, as the load comes on and tends to hold up the voltage on the direct-current side, even if the alternating-current voltage should drop off slightly on account of the line drop. Fur-

thermore, there is often provided from 10 to 25 per cent reactance in the converter circuit.

Oscillators.—In order to prevent the brushes wearing channels in the commutator and collector rings, some form of oscillating device should be provided to produce a periodic axial movement of the armature and shaft. In Fig. 80 is shown a Westinghouse oscillator.

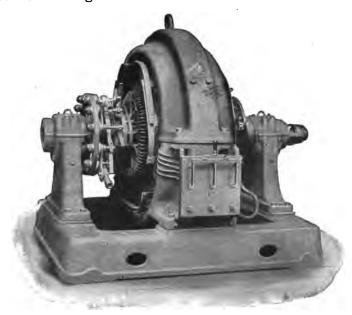


Fig. 81.—Self-Starting Rotary, 200 K.W., 600-volt, 60-cycle (Westinghouse).

It consists of a steel plate with grooved ball race and ball backed by a spring. As the grooved plate is not quite parallel to the end of the shaft, when the rotary is properly installed with the armature slightly inclined toward the oscillator, the hardened steel ball is caught at the lowest point between the race and the end of the shaft. As the



armature revolves, the ball is carried upward, and the spring compressed. The reaction of the spring forces the shaft away and the ball falls back to its normal position. Thus, a periodic longitudinal motion, of a frequency determined by the natural period of the motor, is imparted to



Fig. 82.—Stator of 3000 K.W., Six-phase Rotary Converter (Westinghouse).

the armature as it revolves and uniform wear of commutator and collector rings is assured.

Overspeeds.—As a safeguard against overspeeds in rotary converters, a safety device consisting of a spring-closed knife switch actuated by a centrifugal tripping mechanism

is attached to the same end of the shaft as the oscillator. The knife switch is held open by a pivoted latch so arranged that when the simple centrifugal governor attached to the shaft operates at a predetermined speed, it trips the latch and releases the spring, thus insuring a quick and positive closing of the switch. This switch is contained in a metal box attached to the bearing housing and completes an auxiliary circuit through the tripping coils of the direct-current circuit-breakers.


Field Break Switch.—If a rotary is started from the alternating current side, it should be provided with a double-throw field switch so that during starting the field may be opened in several places, so as to reduce the strain on the insulation that might otherwise result from the high voltage induced in the field coils. When the alternating-current switches are closed on a self-starting rotary, the rotary is virtually a transformer, the armature winding acting as the primary, and the field winding as the secondary. This transformer action becomes less and less as the speed increases and entirely disappears at synchronism, but at the instant of the potential induced in the field coils may easily reach a dangerous value unless the field circuit is opened.


CHAPTER IV


A 180 K.V.A., 600 R.P.M., THREE-PHASE, 2200-VOLT, 60-CYCLE, TWO-BEARING PEDESTAL TYPE ALTERNATING CURRENT GENERATOR.


The author is indebted to Mr. Truman Hibbard of the Electric Machinery Co., Minneapolis, Minn., for the set of actual working drawings shown in this chapter.

LOCATION SKETCH

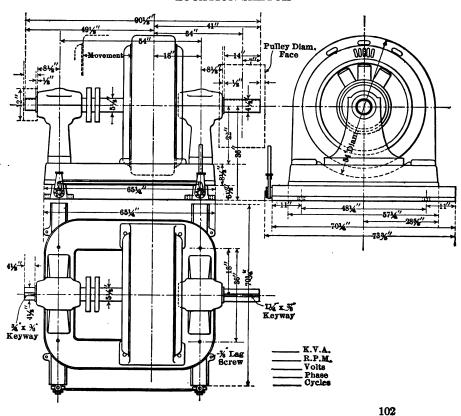

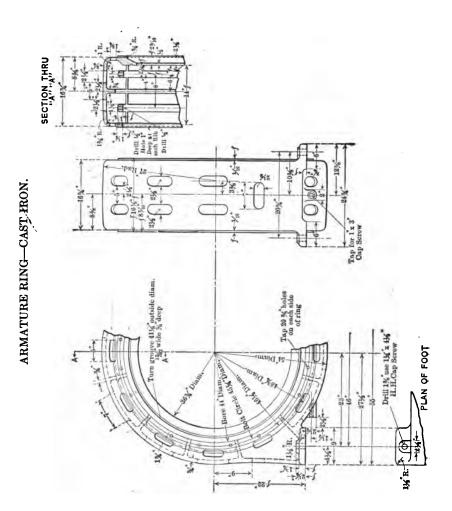


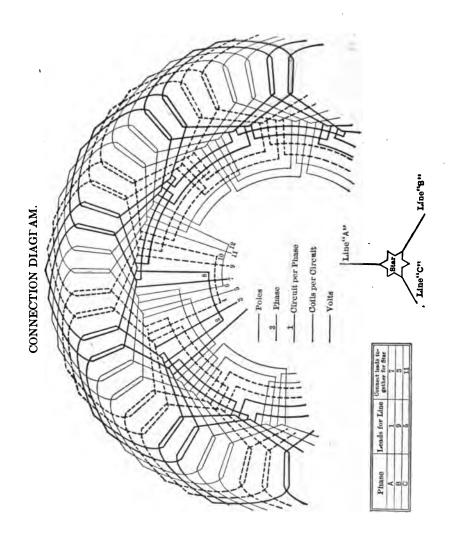


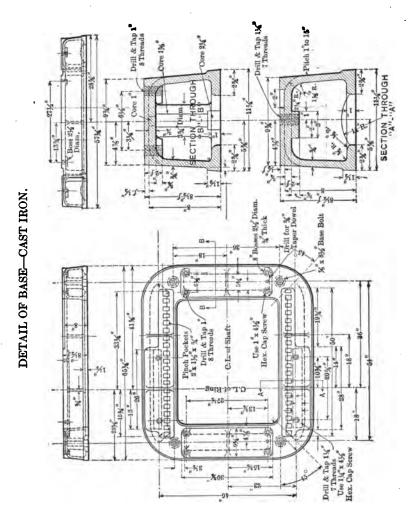


Digitized by Google


ASSEMBLED ARMATURE.

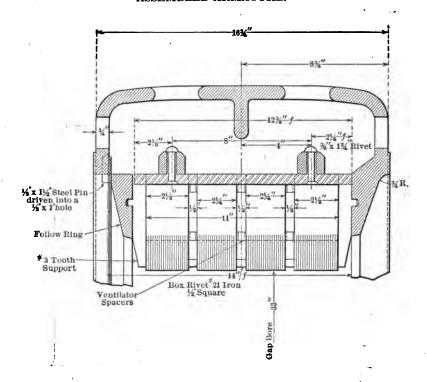


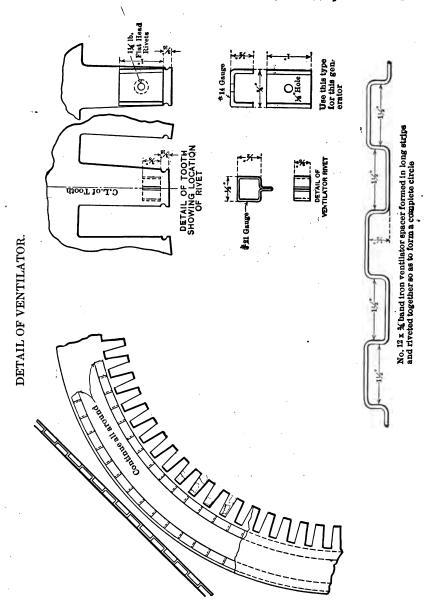


POLE PIECE PUNCHING.

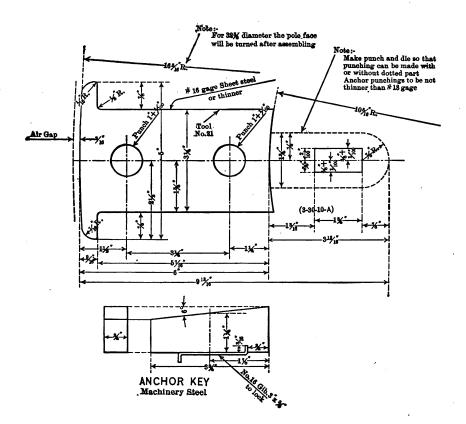


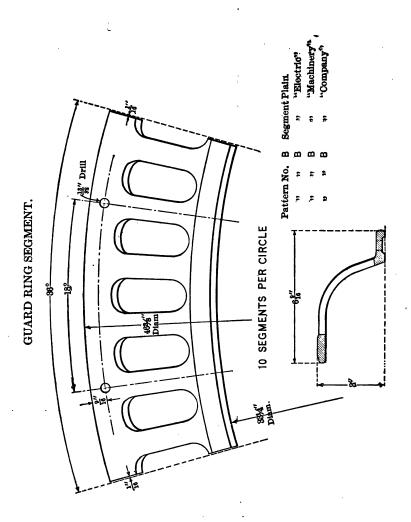


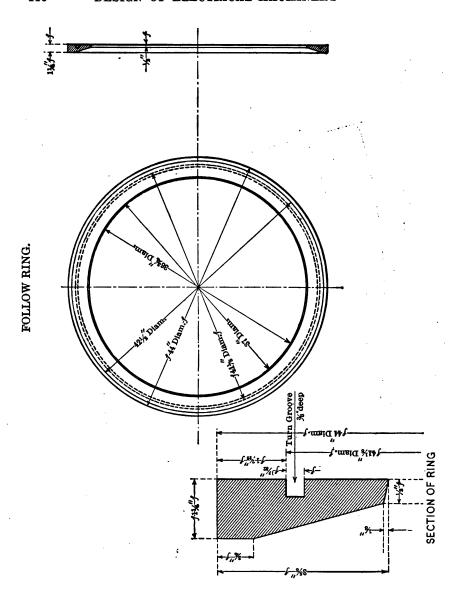



ARMATURE TOOTH SUPPORT.

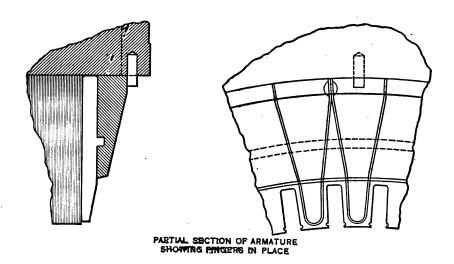

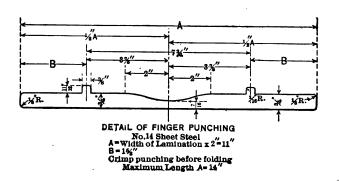


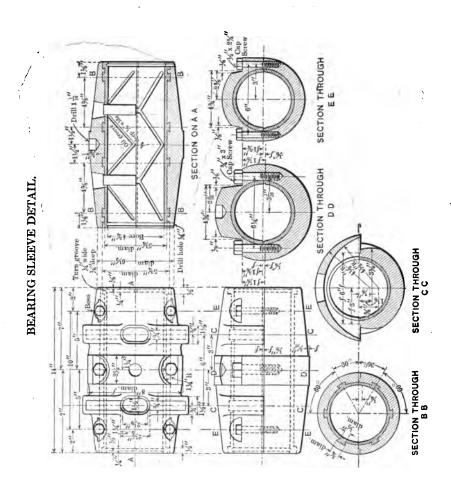


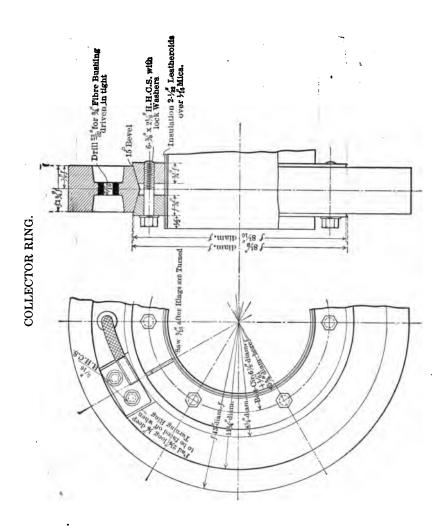


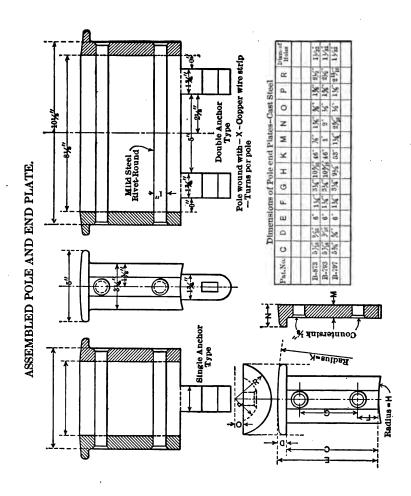


RAIL DETAILS—CAST IRON.

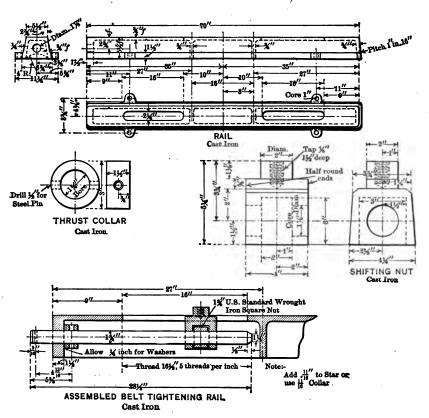


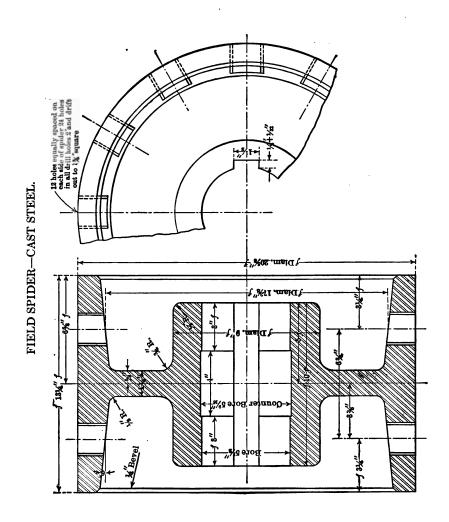


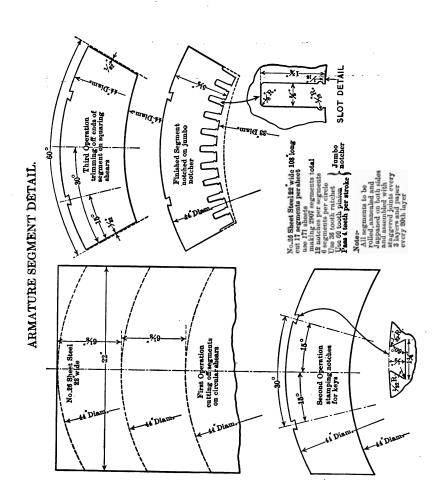



FIELD FLANGE—CAST BRASS.

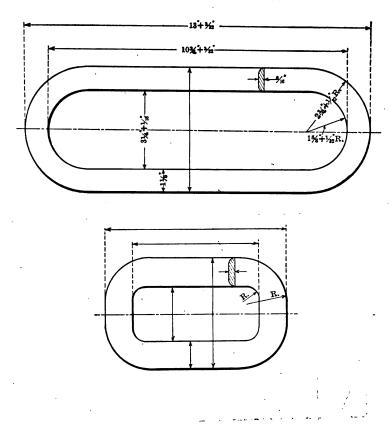

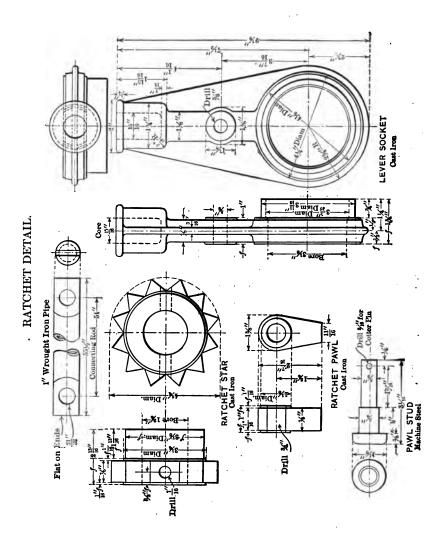

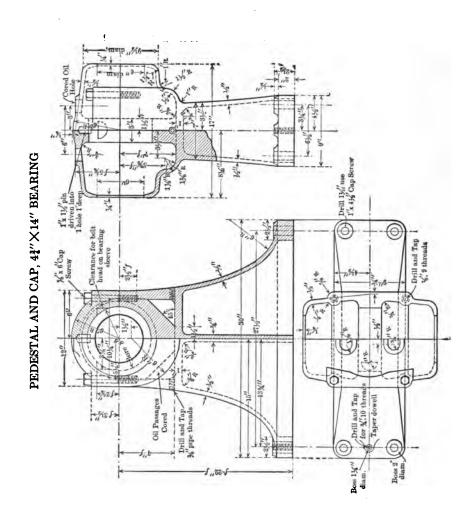

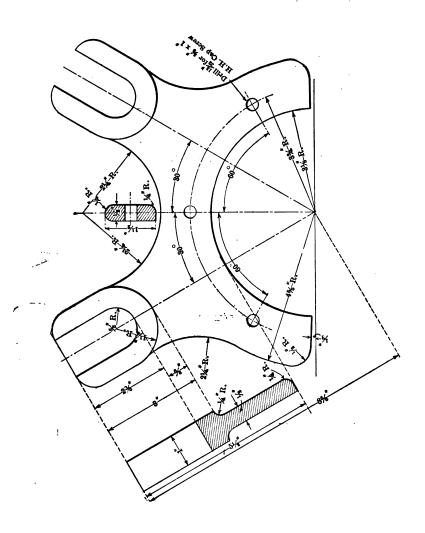

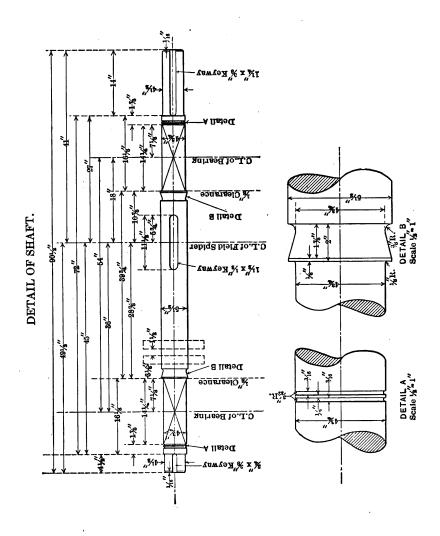

A

	A				
				PAG	æ
	length of				77
"",	ampere turns required for			. 7	78
Alternato	or, bracket type			. 2,	4
"	, two-bearing pedestal type			2, 5,	6
"	, three-bearing pedestal type			. 2,	7
"	, engine type				
"	, turbine type			2, 1	11
"	, water-wheel type			. 2,	8
"	, efficiency of			8	88
"	, losses in			8	88
	, rating of				3
"	regulation of				85
Alternato	ors in parallel			:	23
	turns, calculation of				78
Armature	e assembled, example of			10	06
<i>``</i>	, energy losses in				62
"	coils				52
"	conductors, size of				48
i i	" , number of				35
ü	", diameter of				48
"	, inductance				-0 86
"	, length of				35
"	magnetic density in				54
"	ring, example of				03
"	segment detail, example of			,	
44.	tooth support, example of				
"	windings				
	wandango	•	•	,	

INDEX

В

PAG	łΕ
Base for alternator, example of 7	77
Bearings, diameter of	35
'' , example of	6
", length of	36
Bearing friction, see Losses.	
Bearing sleeve detail, example of	12
	58
Dozen pero process to the contract of the cont	39
Brush yoke, example of	
Drush yoke, example of	.1
•	
\mathbf{c}	
	36
	38
	53
	78
" temperature rise	33
·	30
	30
, <u>, </u>	2
	ــ 16
	17
	17
	16
	50 37
	52
00110, 01111011101111111111111111111111	
Collector ring, example of	
	38
Connection diagram	
Converter, armature heating	
, supposite the second)1
" , design of	90
", E.M.F. relations in 9	91
'' , speed limit device	98
)4
	53
Oppor 200000,	35
	53
Currents eddy, see Eddy currents.	. •
	18
Current density 4	rO

D

	PAGI
Damper winding	92
Demagnetizing action of armature	
Depth of armature core	53
Delta connection	
Density of current	
" magnetization	54
Diagram, one-phase winding	
", two-phase winding	
", three-phase winding	
" , closed-coil winding	
Diameter of armature core	30, 32, 33, 35
" shaft	
Dynamo, illustrative design	
", Electric Machinery Co. examples, 3, 5	, 7, 9, 10, 25, 37, 52, 73, 79
	82, 85
", Westinghouse Co. examples, 4, 6, 8, 1	
	4, 55, 57, 58, 60, 62, 63, 64, 72
	, , , , , , , , ,
_	
${f E}$	
Eddy currents	57
Efficiency	
E.M.F. generated in armature	
", relations in converters	
"" wave form	
Emission of heat from armature	
Energy loss, specific armature loss	
Exciter	
Exciting ampere turns.	

.	
Ei-14 busch meitab	101
Field break switch	
density	
nange, example of	
TOTH	
1088	
spicier, example of	
Flux density in air-gap	
" " armature core	
· · · · · · · · nole	

	PAGE
Flux density in pole shoe	7 8
" " teeth	54
" " wheel rim	7 6
Flux leakage	67
Follow ring, example of	110
Foucault currents, see Eddy currents.	
Frequencies, standard	28
Frequency of magnetic reversals	56
Friction losses, see Losses.	
a	
G	
Gap, see Air-gap:	
Generators, rating of	3.6
'' , regulation of	
'' , speed of	
Guard ring segment, example of	
Guard Ing Segment, example of	103
H	
Heating of armatures	61
" " " Gold coils	61
" "field coils. " rotary converter armatures	84
Totary converter armatures	91
Hysteresis, coefficient of	56
, loss in armature core	56
", " teeth	56
en e	
Inductance of armature	69
Inductor type alternator	2
Intensity, see Density.	
Insulating materials	49
Iron losses	53
Iron losses	80
· · · · · · · · · · · · L · · · · ·	
Lagging current, effect on regulation.	23
Laminations, example of armature	79
", " field	
Leakage, coefficient of	67

INDEX	127
	PAGE
Length, of armature core	. 30, 35
", " bearings	66
", " mean turn on armature	51
Location sketch	102
Losses	
M :	
Magnetic flux, see Flux.	
" leakage, see Leakage.	
" permeability	80
Magnetic density in air-gap	
" " armature	
" " pole	
pote	
pole snoe	80
teetп	54
wheel rim	
Magnetizing force, for air-gaps	
", any part of a circuit	
Materials for insulation	
Mesh or delta connection	18
Motor, design of synchronous	1
N	
No load ampere turns	
Number of ampere turns	77
" armature conductors	35
"···· " r.p.m	. 28, 29
" slots per pole per phase	. 20, 46
	,
. 0	
Open-coil windings	5 18 19
Open slots	
Output coefficients	
•	, ,
Oscillator, Westinghouse	
Overload capacities	
Overspeeding of rotaries, prevention of	99
P	

21

PAC	316
	17
Pedestal, example of	0
	30
Permissible temperature rises	5
Pole end plate, example of	4
Poles, example of 58, 68, 8	31
", method of fastening	32
	27
	39
	16
• ,	54
Power losses, see Losses.	, <u>.</u>
· · · · · · · · · · · · · · · · · · ·	21
	11
$oldsymbol{R}_{i}$, $oldsymbol{R}_{i}$, $oldsymbol{R}_{i}$,	
Radiating surface of armature	30
" " field coils	84
Rail details example of	15
Ratchet detail example of	19
	6
Ratio of length of armature core to diameter	
· · · · · · · · · · · · · · · · · · ·	51
	36
Resistance of armeture	
" " fold soils	25
Resistance of armature '' '' field coils Rotary converter, example of	กก
Kotary converter, example of	99 91
, armature nearing	91 95
, compounding of	
, nunting of	92
, overspeeding of	
", starting of	94
${f s}$	
· · · · · · · · · · · · · · · · · · ·	
	38
	53
	48
" " pole	39
	76
	98
Shaft, calculation of	65
", example of	66

INDEX	125
	PAGI
Span, polar	39
Specific energy loss in armature	
Speed, 25-cycle alternators	
", 60-cycle alternators	
", overspeeding of rotaries	100
Spiders, example of	
Synchronizing power	27
S,	
· T	
1	
Table of air-gap densities for 25-cycle alternators	
" diameters of armatures	. 32, 33, 35
" " output coefficients	32, 33, 35
" permeability of different kinds of iron	80
" speed	29
" specific temperature rise	61
" shaft constants	65
Temperature of armature	3, 6
" bearings	É
" collector rings	
" " field	
Thickness of armature laminations	
Types of alternators	
" " armature windings	
" " slots	
. ***	
V	
Ventilator detail, example of	107
W	
Water-wheel type alternators	2.8
Wheel rim, cross-section of	
Wrought iron, permeability of	

SHORT-TITLE CATALOGUE

OF THE

PUBLICATIONS

OF

JOHN WILEY & SONS

New York

LONDON: CHAPMAN & HALL, LIMITED

ARRANGED UNDER SUBJECTS

Descriptive circulars sent on application. Books marked with an asterisk (*).are seld at net prices only. All books are bound in cloth unless otherwise stated.

AGRICULTURE-HORTICULTURE-FORESTRY.

Armsby's Principles of Animal Nutrition		00 00
Budd and Hansen's American Horticultural Manual: Part I. Propagation, Culture, and Improvement		50 50
Part II. Systematic Pomology. 12mo, Bliott's Engineering for Land Drainage. 12mo, Practical Farm Drainage. (Second Edition, Rewritten.). 12mo,	2	00 50
Fuller's Water Supplies for the Farm. (In Press.) Graves's Forest Mensuration	_	00
* Principles of Handling Woodlands	ī	50 59
Grotenfelt's Principles of Modern Dairy Practice. (Woll.)	3	00 50 00
*Kemp and Waugh's Landscape Gardening (New Edition, Rewritten.) 12mo, *McKay and Larsen's Principles and Practice of Butter-making 8vo,	1	50 50
Maynard's Landscape Gardening as Applied to Home Decoration12mo, Record's Identification of the Economic Woods of the United States. (In Press.	.) ¯	50
Sanderson's Insects Injurious to Staple Crops	_	50 00 25
* Solotaroff's Field Book for Street-tree Mapping	Õ	75 00
* Shade Trees in Towns and Cities	2	00 50
Winton's Microscopy of Vegetable Foods	-	50 50
ARCHITECTURE.		٠

* Atkinson's Orientation of Buildings or Planning for Sunlight 8vo,	2 00
Baldwin's Steam Heating for Buildings12mo,	2 50
Berg's Buildings and Structures of American Railroads4to,	5 00

Birkmire's Architectural Iron and Steel8vo.		
Compound Riveted Girders as Applied in Buildings8vo.		00
Planning and Construction of High Office Buildings8vo.		50
Skeleton Construction in Buildings8vo.		00
Briggs's Modern American School Buildings8vo.	4	00
Byrne's Inspection of Materials and Workmanship Employed in Construction.		
16mo.		00
Carpenter's Heating and Ventilating of Buildings8vo.		00
* Corthell's Allowable Pressure on Deep Foundations		25
* Eckel's Building Stones and Clays		00
Freitag's Architectural Engineering	3	50
Fire Prevention and Fire Protection. (In Press.) Fireproofing of Steel Buildings	9	50
Gerhard's Guide to Sanitary Inspections. (Fourth Edition, Entirely Re-	2	90
vised and Enlarged.)	1	5 0
* Modern Baths and Bath Houses8vo.		00
Sanitation of Public Buildings		50
Theatre Fires and Panics	1	50
* The Water Supply, Sewerage and Plumbing of Modern City Buildings,		
8vɔ,	4	00
Johnson's Statics by Algebraic and Graphic Methods8vo	2	
Kellaway's How to Lay Out Suburban Home Grounds8vo,		00
Kidder's Architects' and Builders' Pocket-book		00
Merrill's Stones for Building and Decoration	5 4	00
Patton's Practical Treatise on Foundations	5	00
Peabody's Naval Architecture	7	50
Rice's Concrete-block Manufacture		00
Richey's Handbook for Superintendents of Construction 16mo, mor.		00
Building Foreman's Pocket Book and Ready Reference. 16mo, mor.		00
* Building Mechanics' Ready Reference Series:		
* Carpenters' and Woodworkers' Edition16mo, mor.	1	50
* Cement Workers' and Plasterers' Edition16mo, mor.		50
* Plumbers', Steam-Fitters', and Tinners' Edition16mo, mor. * Stone- and Brick-masons' Edition16mo, mor.		50
* Stone- and Brick-masons' Edition16mo, mor.		50
Sabin's House Painting	1	00
Siebert and Biggin's Modern Stone-cutting and Masonry	1	50
Snow's Principal Species of Wood		50
Sheep		00 50
Law of Contracts		00
Law of Operations Preliminary to Construction in Engineering and	0	00
Architecture8vo,	5	00
Sheep,		50
Wilson's Air Conditioning	1	50
Worcester and Atkinson's Small Hospitals, Establishment and Maintenance,		
Suggestions for Hospital Architecture, with Plans for a Small		
Hospital12mo,	1	25
·		
ARMY AND NAVY.		
ARMI AND NAVI.		
Bernadou's Smokeless Powder, Nitro-cellulose, and the Theory of the Cellu-		
lose Molecule,	2	50
Chase's Art of Pattern Making	2	
Screw Propellers and Marine Propulsion8vo.	3	
* Cloke's Enlisted Specialists' Examiner	2	
* Gunner's Examiner8vo,	1	50
Craig's Azimuth4to,	3	
Crehore and Squier's Polarizing Photo-chronograph8vo,	3	
* Davis's Elements of Law	2	
* Treatise on the Military Law of United States	7	
* Dudley's Military Law and the Procedure of Courts-martialLarge 12mo, Durand's Resistance and Propulsion of Ships8vo,	5	
* Dyer's Handbook of Light Artillery	3	
where a remandor or refer themery	9	J

Eissler's Modern High Explosives	2 00 1 00 1 50 4 00 3 00 6 00 1 00
* Mahan's Permanent Fortifications. (Mercur.). 8vo, half mor. Manual for Courts-martial. 16mo, mor. * Mercur's Attack of Fortified Places. 12mo, * Elements of the Art of War. 8vo, Nixon's Adjutants' Manual. 24mo, Peabody's Naval Architecture. 8vo, * Phelps's Practical Marine Surveying. 8vo, Putnam's Nautical Charts. 8vo, Rust's Ex-meridian Altitude, Azimuth and Star-Finding Tables. 8vo, * Selkirk's Catechism of Manual of Guard Duty 24mo, Sharpe's Art of Subsisting Armies in War. 18mo, mor. * Taylor's Speed and Power of Ships. 2 vols. Text 8vo, plates oblong 4to,	1 50 2 00 4 00 1 00 7 50 2 50 2 00 5 00 0 50 1 50 7 50
* Tupes and Poole's Manual of Bayonet Exercises and Musketry Fencing. 224mo, leather, * Weaver's Military Explosives	0 50 3 00 1 50
ASSAYING.	
Betts's Lead Refining by Electrolysis	4 00 0 75 1 50 3 00 3 00 1 00 1 00 2 50 3 00 4 00
* Seamon's Manual for Assayers and Chemists. Large 12mo, Ulke's Modern Electrolytic Copper Refining. 8vo, Wilson's Chlorination Process. 12mo, Cyanide Processes. 12mo, ASTRONOMY.	2 50 3 00 1 50 1 50
Comstock's Field Astronomy for Engineers. 8vo, Craig's Azimuth. 4to, Crandall's Text-book on Geodesy and Least Squares. 8vo, Doolittle's Treatise on Practical Astronomy. 8vo, Hayford's Text-book of Geodetic Astronomy. 8vo, Hosmer's Azimuth. 16mo, mor. * Text-book on Practical Astronomy. 8vo, Merriman's Elements of Precise Surveying and Geodesy. 8vo, * Michie and Harlow's Practical Astronomy. 8vo, Rust's Ex-meridian Altitude, Azimuth and Star-Finding Tables. 8vo, * White's Elements of Theoretical and Descriptive Astronomy. 12mo,	2 50 3 50 3 00 4 00 3 00 1 00 2 00 2 50 3 00 5 00 2 00
CHEMISTRY.	
* Abderhalden's Physiological Chemistry in Thirty Lectures. (Hall and Defren.)	5 00 1 25 3 00 3 00

Armsby's Principles of Animal Nutrition	\$4	
Arnold's Compendium of Chemistry. (Mandel.)Large 12mo,	3	50
Association of State and National Food and Dairy Departments, Hartford		
Meeting, 19068vo,		00
Jamestown Meeting, 19078vo,		00
Austen's Notes for Chemical Students	1	50
Bernadou's Smokeless Powder.—Nitro-cellulose, and Theory of the Cellulose	_	
Molecule		50
Laboratory Methods of Inorganic Chemistry. (Hall and Blanchard.)	1	25
8vo.	•	00
* Bingham and White's Laboratory Manual of Inorganic Chemistry. 12mo.		00
* Blanchard's Synthetic Inorganic Chemistry		00
* Bottler's German and American Varnish Making. (Sabin.). Large 12mo,		50
Browne's Handbook of Sugar Analysis. (In Press.)	•	00
* Browning's Introduction to the Rarer Elements	1	50
* Butler's Handbook of Blowpipe Analysis	ō	
* Claassen's Beet-sugar Manufacture. (Hall and Rolfe.)	3	00
Classen's Quantitative Chemical Analysis by Electrolysis. (Boltwood.).8vo.		00
Cohn's Indicators and Test-papers12mo,	2	00
Tests and Reagents8vo,	3	00
Cohnheim's Functions of Enzymes and Ferments. (In Press.)		
* Danneel's Electrochemistry. (Merriam.)	1	
Dannerth's Methods of Textile Chemistry12mo,		00
Duhem's Thermodynamics and Chemistry. (Burgess.)	4	
Effront's Enzymes and their Applications. (Prescott.)8vo,		00
Eissler's Modern High Explosives8ve.		00
* Ekeley's Laboratory Manual of Inorganic Chemistry12mo,		00
* Fischer's Oedema8vo,		00
* Physiology of Alimentation Large 12mo, Fletcher's Practical Instructions in Quantitative Assaying with the Blowpipe.	2	00
10		
Fowler's Sewage Works Analyses		50
Properties's Manual of Qualitative Chemical Analysis (Wells)		00
Manual of Qualitative Chemical Analysis. Part I. Descriptive. (Wells.)8vo		
Oughtitative Chemical Analysis (Cohn.) 2 vols	10	50
Quantitative Chemical Analysis. (Cohn.) 2 vols	12	30
Fuertes's Water and Public Health	1	50
Furman and Pardoe's Manual of Practical Assaying8vo,	3	00
* Getman's Exercises in Physical Chemistry12mo,		00
Gill's Gas and Fuel Analysis for Engineers	1	25
Gooch's Summary of Methods in Chemical Analysis. (In Press.)		
* Gooch and Browning's Outlines of Qualitative Chemical Analysis.		
Large 12mo,		25
Grotenfelt's Principles of Modern Dairy Practice. (Woll.)12mo,		00
Groth's Introduction to Chemical Crystallography (Marshall) 12mo,		25
* Hammarsten's Text-book of Physiological Chemistry. (Mandel.)8vo,		00
Hanausek's Microscopy of Technical Products. (Winton.)8vo,		00
* Haskins and Macleod's Organic Chemistry		00
* Herrick's Denatured or Industrial Alcohol8vo, Hinds's Inorganic Chemistry8vc,		00
* Laboratory Manual for Students		00
* Hallaman's Laboratory Manual of Organia Chamistry for Regionary	1	w
* Holleman's Laboratory Manual of Organic Chemistry for Beginners. (Walker.)	1	00
Text-book of Inorganic Chemistry. (Cooper.)8vo,	2	50
Text-book of Organic Chemistry. (Walker and Mott.)8vo,	2	50
* (Ekeley) Laboratory Manual to Accompany Holleman's Text-book of	_	
Inorganic Chemistry	1	00
Holley's Analysis of Paint and Varnish Products. (In Press.)		
Inorganic Chemistry		00
Hopkins's Oil-chemists' Handbook8vo	3	00
Jackson's Directions for Laboratory Work in Physiological Chemistry8vo,	1	25
Johnson's Rapid Methods for the Chemical Analysis of Special Steels, Steel-		
making Alloys and GraphiteLarge 12mo,		00
Landauer's Spectrum Analysis. (Tingle.)8vo,	3	00
Lassar-Cohn's Application of Some General Reactions to Investigations in	_	
Organic Chemistry. (Tingle.)	1	00

Leach's Inspection and Analysis of Food with Special Reference to State		
Control8vo,	\$ 7	50
Löb's Electrochemistry of Organic Compounds. (Lorenz.)8vo,	3	00
Lodge's Notes on Assaying and Metallurgical Laboratory Experiments8vo,	3	00
Low's Technical Method of Ore Analysis8vo,	3	00
Lowe's Paint for Steel Structures	1	00
Lunge's Techno-chemical Analysis. (Cohn.)	1	00
* McKay and Larsen's Principles and Practice of Butter-making 8vo,	1	50.
Maire's Modern Pigments and their Vehicles12mo,	2	00
Mandel's Handbook for Bio-chemical Laboratory12mo,	1	50
* Martin's Laboratory Guide to Qualitative Analysis with the Blowpipe		
12mo,	0	60
Mason's Examination of Water. (Chemical and Bacteriological.)12mo,	1	25
Water-supply. (Considered Principally from a Sanitary Standpoint.)		
8vo.	4	00
* Mathewson's First Principles of Chemical Theory8vo,	1	00
Matthews's Laboratory Manual of Dyeing and Textile Chemistry8vo.		50
Textile Fibres. 2d Edition, Rewritten8vo,		00
* Meyer's Determination of Radicles in Carbon Compounds. (Tingle.)	_	
Third Edition12mo,	1	25
Miller's Cyanide Process		00
Manual of Assaying12mo,		00
Minet's Production of Aluminum and its Industrial Use. (Waldo.)12mo,		50
* Mittelstaedt's Technical Calculations for Sugar Works. (Bourbakis.) 12mo,		50
Mixter's Elementary Text-book of Chemistry		50
Morgan's Elements of Physical Chemistry		00
* Physical Chemistry for Electrical Engineers		50
* Moore's Experiments in Organic Chemistry		50
* Outlines of Organic Chemistry	1	
Morse's Calculations used in Cane-sugar Factories16mo, mor.	ī	50
* Muir's History of Chemical Theories and Laws	4	00
Mulliken's General Method for the Identification of Pure Organic Compounds.	*	w
Vol. I. Compounds of Carbon with Hydrogen and Oxygen. Large 8vo,	5	00
	9	w
	=	~~
		00
* Nelson's Analysis of Drugs and Medicines		00
Ostwald's Conversations on Chemistry. Part One. (Ramsey.)12mo, Part Two. (Turnbull.)12mo,		50
rart 1wo. (1umbuil.)12mo,		00
* Introduction to Chemistry. (Hall and Williams.)Large 12mo, Owen and Standage's Dyeing and Cleaning of Textile Fabrics12mo,		50
		00
* Palmer's Practical Test Book of Chemistry		00
Pauli's Physical Chemistry in the Service of Medicine. (Fischer.)12mo,	I	25
Penfield's Tables of Minerals, Including the Use of Minerals and Statistics		~~
of Domestic Production		00
Pictet's Alkaloids and their Chemical Constitution. (Biddle.)8vo,		00
Poole's Calorific Power of Fuels	3	00
Prescott and Winslow's Elements of Water Bacteriology, with Special Refer-		
ence to Sanitary Water Analysis	1	50
* Reisig's Guide to Piece-Dyeing8vo,	25	00
Richards and Woodman's Air, Water, and Food from a Sanitary Stand-point8vo.	_	~~
point		00
Ricketts and Miller's Notes on Assaying8vo,		00
Rideal's Disinfection and the Preservation of Food8vo,		00
Riggs's Elementary Manual for the Chemical Laboratory8vo,	1	
Robine and Lenglen's Cyanide Industry. (Le Clerc.)8vo,		00
Ruddiman's Incompatibilities in Prescriptions8vo,		00
Whys in Pharmacy	1	
* Ruer's Elements of Metallography. (Mathewson.)	3	
Sabin's Industrial and Artistic Technology of Paint and Varnish 8vo,	3	
Salkowski's Physiological and Pathological Chemistry. (Orndorff.)8vo,	2	50
* Schimpf's Essentials of Volumetric Analysis Large 12mo	1	50
Manual of Volumetric Analysis. (Fifth Edition, Rewritten)8vo, * Qualitative Chemical Analysis8vo,	5	00
* Qualitative Chemical Analysis8vo,	1	25
* Seamon's Manual for Assayers and ChemistsLarge 12mo,	2	50
Smith's Lecture Notes on Chemistry for Dental Students8vo,	2	50
Spencer's Handbook for Cane Sugar Manufacturers16mo, mor.	3	00
Handbook for Chemists of Beet-sugar Houses16mo, mor.	3	00

Stone's Practical Testing of Gas and Gas Meters8vo,	3 50
* Tillman's Descriptive General Chemistry8vo,	3 00
* Elementary Lessons in Heat8vo,	1 50
Treadwell's Qualitative Analysis. (Hall.)8vo,	3 00
Quantitative Analysis, (Hall.)8vo,	4 00
Turneaure and Russell's Public Water-supples8vo,	5 00
Van Deventer's Physical Chemistry for Beginners. (Boltwood.)12mo,	1 50
Venable's Methods and Devices for Bacterial Treatment of Sewage8vo,	3 00
Ward and Whipple's Freshwater Biology. (In Press.)	
Ware's Beet-sugar Manufacture and Refining. Vol. I8vo,	4 00
voi. 11 8vo,	5 00
Washington's Manual of the Chemical Analysis of Rocks	2 00
* Weaver's Military Explosives	3 00 1 50
Short Course in Inorganic Qualitative Chemical Analysis for Engineering	1 50
Students	1 50
Text-book of Chemical Arithmetic	1 25
Whipple's Microscopy of Drinking-water8vo,	3 50
Wilson's Chlorination Process	1 50
Cyanide Processes	1 50
Winton's Microscopy of Vegetable Foods8vo.	7 50
Zsigmondy's Colloids and the Ultramicroscope. (Alexander.) Large 12mo,	3 00
CIVIL ENGINEERING.	
BRIDGES AND ROOFS. HYDRAULICS. MATERIALS OF ENGIN	EER.
ING. RAILWAY ENGINEERING.	DDK-
* American Civil Engineers' Pocket Book. (Mansfield Merriman, Editor-	
in-chief.)	5 00
Baker's Engineers' Surveying Instruments	3 00
Bixby's Graphical Computing Table	0 25
Breed and Hosmer's Principles and Practice of Surveying. Vol. I. Elementary Surveying	
tary Surveying	3 00
Vol. II. Higher Surveying	2 50
Comstock's Field Astronomy for Engineers	3 50 2 50
* Corthell's Allowable Pressure on Deep Foundations	2 50 1 25
Crandall's Text-book on Geodesy and Least Squares	3 00
Davis's Elevation and Stadia Tables	1 00
* Eckel's Building Stones and Clays	3 00
Elliott's Engineering for Land Drainage	2 00
* Fiebeger's Treatise on Civil Engineering8vo,	5 00
Flemer's Phototopographic Methods and Instruments8vo,	5 00
Folwell's Sewerage. (Designing and Maintenance.)8vo,	3 00
Freitag's Architectural Engineering8vo,	3 50
French and Ives's Stereotomy	2 50
* Hauch and Rice's Tables of Quantities for Preliminary Estimates12mo,	1 25
Hayford's Text-book of Geodetic Astronomy8vo,	3 00
Hering's Ready Reference Tables (Conversion Factors.)16mo, mor.	2 50
Hosmer's Azimuth	1 00
Howe's Retaining Walls for Earth	2 00 1 25
* Ives's Adjustments of the Engineer's Transit and Level 16mo, bds.	0.22
Ives and Hilts's Problems in Surveying, Railroad Surveying and Geod-	0 20
esy16mo, mor.	1 50
* Johnson (J.B.) and Smith's Theory and Practice of Surveying. Large 12mo,	
	3 50
Johnson's (L. J.) Statics by Algebraic and Graphic Methods8vo,	2 00
* Kinnicutt, Winslow and Pratt's Sewage Disposal8vo,	2 00 3 00
* Kinnicutt, Winslow and Pratt's Sewage Disposal	2 00 3 00 1 50
* Kinnicutt, Winslow and Pratt's Sewage Disposal	2 00 3 00 1 50 2 50
* Kinnicutt, Winslow and Pratt's Sewage Disposal	2 00 3 00 1 50 2 50 2 00
* Kinnicutt, Winslow and Pratt's Sewage Disposal	2 00 3 00 1 50 2 50 2 00 3 50
* Kinnicutt, Winslow and Pratt's Sewage Disposal 8vo, * Mahan's Descriptive Geometry 8vo, Merriman's Elements of Precise Surveying and Geodesy 8vo, Merriman and Brooks's Handbook for Surveyors 16mo, mor. Nugent's Plane Surveying 8vo, Ogden's Sewer Construction 8vo,	2 00 3 00 1 50 2 50 2 00 3 50 3 00
* Kinnicutt, Winslow and Pratt's Sewage Disposal	2 00 3 00 1 50 2 50 2 00 3 50

* Ogden and Cleveland's Practical Methods of Sewage Disposal for Resi-		•
dences. Hotels, and Institutions	\$ 1	50
dences, Hotels, and Institutions	~~2	00
Patton's Treatise on Civil Engineering8vo, half leather,		50
Reed's Topographical Drawing and Sketching4to,		00
Riemer's Shaft-sinking under Difficult Conditions. (Corning and Peele.).8vo.		
		00
Siebert and Biggin's Modern Stone-cutting and Masonry8vo,		50
Smith's Manual of Topographical Drawing. (McMillan.)8vo,		50
Soper's Air and Ventilation of Subways	2	50
* Tracy's Exercises in Surveying	1	00
Tracy's Plane Surveying		00
Venable's Garbage Crematories in America		00
		00
Methods and Devices for Bacterial Treatment of Sewage8vo,		
Wait's Engineering and Architectural Jurisprudence8vo,		00
Sheep,		50
Law of Contracts	3	00
Law of Operations Preliminary to Construction in Engineering and		
Architecture	5	00
Sheep,		50
Warren's Stereotomy—Problems in Stone-cutting8vo,		50
	4	90
* Waterbury's Vest-Pocket Hand-book of Mathematics for Engineers.	_	
2½ ×5⅔ inches, mor.		00
* Enlarged Edition. Including Tables	1	50
Webb's Problems in the Use and Adjustment of Engineering Instruments.		
16mo. mor.	1	25
Wilson's Topographic, Trigonometric and Geodetic Surveying8vo,		50
whom 3 Topographic, Trigonometric and Geodetic Sarveying	٠	00
BRIDGES AND ROOFS.		
Boller's Practical Treatise on the Construction of Iron Highway Bridges8vo,	2	00
* Thames River BridgeOblong paper,	5	00
Burr and Falk's Design and Construction of Metallic Bridges		00
Influence Lines for Bridge and Roof Computations		00
Du Bois's Mechanics of Engineering. Vol. IISmall 4to,		00
Foster's Treatise on Wooden Trestle Bridges4to,		00
Fowler's Ordinary Foundations8vo,		50
Greene's Arches in Wood, Iron, and Stone8vo,	2	50
Bridge Trusses	2	50
Roof Trusses8vo,		25
Grimm's Secondary Stresses in Bridge Trusses		50
Heller's Stresses in Structures and the Accompanying Deformations8vo,		00
Hener's Stresses in Structures and the Accompanying Deformationsevo,		
Howe's Design of Simple Roof-trusses in Wood and Steel8vo,		00
Symmetrical Masonry Arches8vo,		5 0
Treatise on Arches	4	00
* Hudson's Deflections and Statically Indeterminate Stresses Small 4to,	3	50
* Plate Girder Design Syg	1	
* Plate Girder Design	2	
Johnson, Bryan and Turneaure's Theory and Practice in the Designing of	_	20
	10	^^
Modern Framed StructuresSmall 4to,	10	w
* Johnson, Bryan and Turneaure's Theory and Practice in the Designing of		
Modern Framed Structures. New Edition. Part I8vo,	3	00
* Part II. New Edition8vo,	4	00
Merriman and Jacoby's Text-book on Roofs and Bridges:		
Part I. Stresses in Simple Trusses8vo.	2	50
Part II. Graphic Statics8vo,		50
Part III. Bridge Design	_	50
Part IV. Higher Structures8vo,	Z	50
Ricker's Design and Construction of Roofs. (In Press.)		
Sondericker's Graphic Statics, with Applications to Trusses, Beams, and		
Arches8vo.	2	00
Waddell's De Pontibus, Pocket-book for Bridge Engineers16mo, mor.	2	00
* Specifications for Steel Bridges		50
	•	
HYDRAULICS.		
	_	
Barnes's Ice Formation	3	00
Bazin's Experiments upon the Contraction of the Liquid Vein Issuing from		
an Orifice. (Trautwine.)8vo.	9	00

Bovey's Treatise on Hydraulics	\$ 5	00
Oblong 4to, paper,	1	50
Hydraulic Motors8vo,		00
Mechanics of Fluids (Being Part IV of Mechanics of Engineering) 8vo,		00
Coffin's Graphical Solution of Hydraulic Problems16mo, mor.		50
Flather's Dynamometers, and the Measurement of Power12mo,		00
Folwell's Water-supply Engineering		00
Folwell's Water-supply Engineering. 8vo, Frizell's Water-power. 8vo, Fuertes's Water and Public Health. 12mo,		00
Fuertes's Water and Public Health		50
Water-filtration Works12mo,	2	50
Ganguillet and Kutter's General Formula for the Uniform Flow of Water in		-
Rivers and Other Channels. (Hering and Trautwine.)8vo,	4	00
Hazen's Clean Water and How to Get ItLarge 12mo,		50
Filtration of Public Water-supplies8vo.	3	ÓO
Hazelhurst's Towers and Tanks for Water-works8vo	2	50
Herschel's 115 Experiments on the Carrying Capacity of Large, Riveted, Meta	ı	
Conduits8vo,		00
Hoyt and Grover's River Discharge8vo,	2	00
Hubbard and Kiersted's Water-works Management and Maintenance.		
8vo,	4	00
*Lyndon's Development and Electrical Distribution of Water Power.		
8vo,	3	00
Mason's Water-supply. (Considered Principally from a Sanitary Stand-		
point.)8vo.	4	00
* Merriman's Treatise on Hydraulics. 9th Edition, Rewritten8vo,	4	00
* Molitor's Hydraulics of Rivers, Weirs and Sluices8vo,	2	00
* Morrison and Brodie's High Masonry Dam Design8vo,	1	5 0
* Richards's Laboratory Notes on Industrial Water Analysis8vo,		50
Schuyler's Reservoirs for Irrigation, Water-power, and Domestic Water-		
supply. Second Edition, Revised and Enlarged Large 8vo,	6	00
* Thomas and Watt's Improvement of Rivers4to,		00
Turneaure and Russell's Public Water-supplies8vo,		00
* Wegmann's Design and Construction of Dams. 6th Ed., enlarged4to,		ÓΟ
Water-Supply of the City of New York from 1658 to 1895 4to,		00
Whipple's Value of Pure WaterLarge 12mo,		00
Williams and Hazen's Hydraulic Tables8vo,		50
Wilson's Irrigation Engineering		00
Wood's Turbines		50
Troot 5 Turbines	-	00
MATERIALS OF ENGINEERING.		
Baker's Roads and Pavements8vo,	5	00
Treatise on Masonry Construction	5	00
Black's United States Public WorksOblong 4to,	5	00
* Blanchard and Drowne's Highway Engineering, as Presented at the		
Second International Road Congress, Brussels, 19108vo,	2	00
Bleininger's Manufacture of Hydraulic Cement. (In Preparation.)	_	• •
* Bottler's German and American Varnish Making. (Sabin.). Large 12mo, Burr's Elasticity and Resistance of the Materials of Engineering8vo,		50
Burr's Elasticity and Resistance of the Materials of Engineering		50
Byrne's Highway Construction	Ð	00
Inspection of the Materials and Workmanship Employed in Construction.	_	~~
16mo, Church's Mechanics of Engineering8vo,		00
Church's Mechanics of Engineering	в	00
Mechanics of Solids (Being Parts I, II, III of Mechanics of Engineer-		
ing8vo,	4	50
Du Bois's Mechanics of Engineering.	_	
Vol. I. Kinematics, Statics. KineticsSmall 4to,	7	50
Vol. II. The Stresses in Framed Structures, Strength of Materials and		
Theory of FlexuresSmall 4to,	10	
* Eckel's Building Stones and Clays		00
* Cements, Limes, and Plasters		00
Fowler's Ordinary Foundations8vo,		50
* Greene's Structural Mechanics8vo,	2	50
Holley's Analysis of Paint and Varnish Products. (In Press.) *Lead and Zinc PigmentsLarge 12mo,		
* Lead and Zinc PigmentsLarge 12mo,	3	00
8		
· ·		

* Hubbard's Dust Preventives and Road Binders8vo,	\$ 3	00
Johnson's (C. M.) Rapid Methods for the Chemical Analysis of Special Steels.		
Steel-making Alloys and GraphiteLarge 12mo,	3	00
Johnson's (J. B.) Materials of ConstructionLarge 8vo, Keep's Cast Iron8vo,		00 50
Lanza's Applied Mechanics	7	50
Lowe's Paints for Steel Structures. 12mo	í	
Lowe's Paints for Steel Structures	2	
* Martin's Text Book on Mechanics. Vol. I. Statics	1	
* Vol. II. Kinematics and Kinetics	1	
* Vol. III. Mechanics of Materials	1	
Maurer's Technical Mechanics	4	
Merrill's Stones for Building and Decoration	5	00
* Strength of Materials	1	
Metcalf's Steel. A Manual for Steel-users12mo,	2	
Morrison's Highway Engineering8vo,		50
* Murdock's Strength of Materials	2	00
Patton's Practical Treatise on Foundations8vo,		00
Rice's Concrete Block Manufacture8vo,		00
Richardson's Modern Asphalt Pavement8vo,		00
Richey's Building Foreman's Pocket Book and Ready Reference.16mo, mor. * Cement Workers' and Plasterers' Edition (Building Mechanics' Ready	5	.00
Reference Series)		50
Handbook for Superintendents of Construction 16mo, mor.		00
*Stone and Brick Masons' Edition (Building Mechanics' Ready	-	•
Reference Series)	1	50
* Ries's Clays: Their Occurrence, Properties, and Uses8vo,		00
* Ries and Leighton's History of the Clay-working Industry of the United		
States8vo,		50
Sabin's Industrial and Artistic Technology of Paint and Varnish8vo,		00
* Smith's Strength of Material12mo,	1	
Snow's Principal Species of Wood8vo,		50
Spalding's Hydraulic Cement. 12mo, Text-book on Roads and Pavements. 12mo,		00
* Taylor and Thompson's Concrete Costs		00
* Factor on Poinforced Concrete Design		00
* Extracts on Reinforced Concrete Design		00
Thurston's Materials of Engineering. In Three Parts8vo,		00
Part I. Non-metallic Materials of Engineering and Metallurgy8vo,	2	00
Part II. Iron and Steel8vo,	3	50
Part III. A Treatise on Brasses, Bronzes, and Other Alloys and their		
Constituents8vo,		50
Tillson's Street Pavements and Paving Materials8vo,	4	00
Turneaure and Maurer's Principles of Reinforced Concrete Construction. Second Edition, Revised and Enlarged8vo,	,	50
Waterbury's Cement Laboratory Manual		00
* Laboratory Manual for Testing Materials of Construction12mo,		50
Wood's (De V.) Treatise on the Resistance of Materials, and an Appendix on	-	•
the Preservation of Timber 840	2	00
Wood's (M. P.) Rustless Coatings: Corrosion and Electrolysis of Iron and		
Steel8vo,	4	00
RAILWAY ENGINEERING.		
Andrews's Handbook for Street Railway Engineers3×5 inches, mor.	1	25
Berg's Buildings and Structures of American Railroads4to,		00
Brooks's Handbook of Street Railroad Location16mo. mor.		50
* Burt's Railway Station Service		00
Butts's Civil Engineer's Field-book16mo, mor.		50
Crandall's Railway and Other Earthwork Tables8vc,		50
Crandall and Barnes's Railroad Surveying		00
* Crockett's Methods for Earthwork Computations		50
Dredge's History of the Pennsylvania Railroad. (1879)	o	28
*Gilbert Wightman and Saunders's Subways and Tunnels of New York. 8vo,	4	00
Godwin's Railroad Engineers' Field-book and Explorers' Guide. 16mo, mor.		50

Hudson's Tables for Calculating the Cubic Contents of Excavations and Em-	_	
bankments8vo,	\$ 1	00
Ives and Hilts's Problems in Surveying, Railroad Surveying and Geodesy		
Molitor and Beard's Manual for Resident Engineers16mo,	1	
Nagle's Rield Manual for Railroad Engineers		00
* Orrock's Railroad Structures and Estimates		00
Philbrick's Field Manual for Engineers16mo, mor.	3	
Raymond's Railroad Field Geometry	2	00
Elements of Railroad Engineering8vo,	3	50
Railroad Engineer's Field Book. (In Preparation.) Roberts' Track Formulæ and Tables16mo, mor.	_	
Roberts' Track Formulæ and Tables		00
Searles's Field Engineering		00
Railroad Spiral		50 50
Webb's Economics of Railroad Construction		50
Railroad Construction		00
Wellington's Economic Theory of the Location of RailwaysLarge 12mo,		00
Wilson's Elements of Railroad-Track and Construction12mo,	2	00
DRAWING.		
Barr and Wood's Kinematics of Machinery	2	50
* Bartlett's Mechanical Drawing		00
* "		50
* Bartlett and Johnson's Engineering Descriptive Geometry8vo,	1	50
Blessing and Darling's Descriptive Geometry. (In Press.)		
Elements of Drawing. (In Press.)		
Coolidge's Manual of Drawing	1	00
Coolidge and Freeman's Elements of General Drafting for Mechanical EngineersOblong 4to,		50
Durley's Kinematics of Machines		00
Emch's Introduction to Projective Geometry and its Application8vo,		50
Hill's Text-book on Shades and Shadows, and Perspective8vo,		00
Jamison's Advanced Mechanical Drawing8vo,		00
Elements of Mechanical Drawing8vo,	2	50
Jones's Machine Design:	_	
Part I. Kinematics of Machinery8vo,	1	
Part II. Form, Strength, and Proportions of Parts8vo, * Kimball and Barr's Machine Design8vo,	3	00
MacCord's Elements of Descriptive Geometry8vo,		00
Kinematics; or, Practical Mechanism		00
Mechanical Drawing4to,	4	
Velocity Diagrams8vo,	1	
McLeod's Descriptive GeometryLarge 12mo,		50
* Mahan's Descriptive Geometry and Stone-cutting8vo,		50
Industrial Drawing. (Thompson.)		50 00
Reed's Topographical Drawing and Sketching4to,	5	
* Reid's Mechanical Drawing. (Elementary and Advanced.)8vo,	2	
Text-book of Mechanical Drawing and Elementary Machine Design8vo,	3	00
Robinson's Principles of Mechanism8vo,		00
Schwamb and Merrill's Elements of Mechanism8vo,		00
Smith (A. W.) and Marx's Machine Design8vo,	3	
Smith's (R. S.) Manual of Topographical Drawing. (McMillan.)8vo,	2 1	50 25
* Titsworth's Elements of Mechanical DrawingOblong 8vo, Tracy and North's Descriptive Geometry. (In Press.)	٠ ٦	23
Warren's Elements of Descriptive Geometry, Shadows, and Perspective. 8vo,	3	50
Elements of Machine Construction and Drawing8vo,	7	
Elements of Plane and Solid Free-hand Geometrical Drawing12mo,	1	00
General Problems of Shades and Shadows8vo,	3	00
Manual of Elementary Problems in the Linear Perspective of Forms and	_	
Shadow		00
Manual of Elementary Projection Drawing	_	50 25
Weisbach's Kinematics and Power of Transmission. (Hermann and	•	20
Klein.)8vo,	5	00
Wilson's (H. M.) Topographic Surveying8vo,		50
10		

* Wilson's (V. T.) Descriptive Geometry8vo,		
Free-hand Lettering		00 50
Woolf's Elementary Course in Descriptive GeometryLarge 8vo,		00
ELECTRICITY AND PHYSICS.		
* Abegg's Theory of Electrolytic Dissociation. (von Ende.)12mo,		25
Andrews's Hand-book for Street Railway Engineers 3×5 inches mor. Anthony and Ball's Lecture-notes on the Theory of Electrical Measure-		25
ments12mo,		00
Anthony and Brackett's Text-book of Physics. (Magie.)Large 12mo, Benjamin's History of Electricity8vo,		00
Ratte's Lead Refining and Electrolysis 8vo		00
* Burgess and Le Chatelier's Measurement of High Temperatures. Third		00
Edition		00
* Collins's Manual of Wireless Telegraphy and Telephony12mo,		50
Crehore and Squier's Polarizing Photo-chronograph		00
* Danneel's Electrochemistry. (Merriam.)		25
Dolezalek's Theory of the Lead Accumulator (Storage Battery). (von Ende.)		00
12mo,		50
Duhem's Thermodynamics and Chemistry. (Burgess.)		00
* Getman's Introduction to Physical Science		50
Gilbert's De Magnete. (Mottelay)8vo,		50
* Hanchett's Alternating Currents		00
Hering's Ready Reference Tables (Conversion Factors)16mo, mor.		5 0
* Hobart and Ellis's High-speed Dynamo Electric Machinery8vo,		00
Holman's Precision of Measurements8vo,		00
Telescope-Mirror-scale Method, Adjustments, and TestsLarge 8vo, * Hutchinson's High-Efficiency Electrical Illuminants and Illumination.	U	75
Large 12mo,		5 0
* Jones's Electric Ignition		00
* Vol. 18vo,		50 50
* Vol. II		00
* Koch's Mathematics of Applied ElectricitySmall 8vo,		00
Landauer's Spectrum Analysis. (Tingle.)8vo,		00
* Lauffer's Electrical Injuries	0	50
Löb's Electrochemistry of Organic Compounds. (Lorenz.)		00
* Lyndon's Development and Electrical Distribution of Water Power8vo,		00
* Lyons's Treatise on Electromagnetic Phenomena. Vols, I. and II. 8vo, each, Michie's Elements of Wave Motion Relating to Sound and Light8vo,		00
* Morgan's Physical Chemistry for Electrical Engineers		50
* Norris's Introduction to the Study of Electrical Engineering8vo,		50
Norris and Dennison's Course of Problems on the Electrical Characteristics of		
Circuits and Machines. (In Press.)	10	=0
* Parshall and Hobart's Electric Machine Design	12	90
Large 12mo.	3	50
* Rosenberg's Electrical Engineering. (Haldane Gee—Kinzbrunner.)8vo,		00
* Ryan's Design of Electrical Machinery:		
* Vol. I. Direct Current Dynamos		50
Vol. II. Alternating Current Transformers		50
(In Preparation.)	_	•
Ryan, Norris, and Hoxie's Text Book of Electrical Machinery		50 00
Schapper's Laboratory Guide for Students in Physical Chemistry12mo, * Tillman's Elementary Lessons in Heat8vo.		50
* Timbie's Elements of ElectricityLarge 12mo,		00
* Answers to Problems in Elements of Electricity12mo, Paper		25
Tory and Pitcher's Manual of Laboratory PhysicsLarge 12mo,	2	00
Ulke's Modern Electrolytic Copper Refining8vo,		00
* Waters's Commercial Dynamo Design8vo,	2	00

LAW.

* Davis's Elements of Law	* Brennan's Hand-book of Useful Legal Information for Business Men.		
* Treatise on the Military Law of United States	16mo, mor.		
**Dudley's Military Law and the Procedure of Courts-martial. Large 12mo, mor. 1.50 **Wait's Engineering and Architectural Jurisprudence	* Treatise on the Military I aw of United States Sys		
Manual for Courts-martial.			
Wait's Engineering and Architectural Jurisprudence. Sheep, 6 Law of Contracts. Sheep, 6 Law of Contracts. Shoep, 6 Sheep, 6 She			
Law of Contracts.	Wait's Engineering and Architectural Jurisprudence8vo,	6	00
Law of Operations Preliminary to Construction in Engineering and Architecture. 8vo, 5 00 Sheep, 5 50 MATHEMATICS. Baker's Elliptic Functions. 8vo, 1 50 Briggs's Elements of Plane Analytic Geometry. (Bôcher.) 12mo, 1 00 Briggs's Elements of Plane Analytic Geometry. (Bôcher.) 12mo, 1 00 Byerly's Harmonic Functions. 8vo, 1 00 Cycoffin's Vector Analysis. 12mo, 2 50 Compton's Manual of Logarithmic Computations. 12mo, 2 50 Compton's Manual of Logarithmic Computations. 12mo, 1 50 * Dickson's College Algebra. Large 12mo, 1 50 * Introduction to the Theory of Algebraic Equations. Large 12mo, 1 50 * Introduction to Projective Geometry and its Application. 8vo, 2 7 Siske's Functions of a Complex Variable. 8vo, 1 00 Halsted's Elementary Synthetic Geometry. 8vo, 1 75 * Rational Geometry. 8vo, 1 75 * Rational Geometry. 8vo, 1 75 * Synthetic Projective Geometry. 8vo, 1 75 * Manual of Lectures on the Theory of Elliptic Functions. 8vo, 5 00 * Hyde's Grassmann's Space Analysis. 8vo, 1 00 * Johnson's (J. B.) Three-place Logarithmic Tables: Vest-pocket size, paper, 0 15 * Mounted on heavy cardboard, 8×10 inches, 0 25 * Mounted on heavy cardboard, 8×10 inches, 0 25 * Mounted on heavy cardboard, 8×10 inches, 0 25 * Mounted on heavy cardboard, 8×10 inches, 0 25 * Mounted on heavy cardboard, 8×10 inches, 0 25 * Mounted on heavy cardboard, 8×10 inches, 0 25 * Mounted on heavy cardboard, 8×10 inches, 0 25 * Differential Equations. 12mo, 1 50 * Theoricial Mechanics 12mo, 1 50 * Treatise on Differential Calculus. Large 12mo, 1 50 * Theoricial Mechanics of Applied Electricity. 8vo, 1 60 * Part I. Problems on Machine Design. Large 12mo, 1 50 * Treatise on Differential Differential Equations. Small 8vo, 1 75 * Koch's Mathematics of Applied Electricity. 8vo, 3 00 * Laplace's Philosophical Essay on Probabilities. (Truscott and Emory.) 12mo, 2			
MATHEMATICS. Baker's Elliptic Functions	Law of Contracts	3	00
MATHEMATICS.		5	ΔΛ
Baker's Elliptic Functions			
Briggs's Elements of Plane Analytic Geometry. (Bôcher.) 12mo, 1 00	•		
Briggs's Elements of Plane Analytic Geometry. (Bôcher.) 12mo, 1 00	Baker's Elliptic Functions	1	50
* Buchanan's Plane and Spherical Trigonometry	Briggs's Elements of Plane Analytic Geometry. (Bocher.)12mo,		
Chandler's Elements of the Infinitesimal Calculus. 12mo, 2 00 * Coffin's Vector Analysis. 12mo, 1 50 * Compton's Manual of Logarithmic Computations. 12mo, 1 50 * Dickson's College Algebra. Large 12mo, 1 50 * Introduction to the Theory of Algebraic Equations. Large 12mo, 1 25 Emch's Introduction to Projective Geometry and its Application. 8vo, 2 50 Piske's Functions of a Complex Variable. 8vo, 1 50 * Elements of Geometry. 8vo, 1 50 * Elements of Geometry. 8vo, 1 50 * Rational Geometry. 8vo, 1 50 * Synthetic Projective Geometry 12mo, 1 50 * Hancock's Lectures on the Theory of Elliptic Functions 8vo, 5 00 Hyde's Grassmann's Space Analysis. 8vo, 1 00 * Honson's (J. B.) Three-place Logarithmic Tables: Vest-pocket size, paper, 0 15 * Mounted on heavy cardboard, 8 × 10 inches, 2 20 Johnson's (W. W.) Abridged Editions of Differential and Integral Calculus. Large 12mo, 1 vol. 2 50 Curve Tracing in Cartesian Co-ordinates 12mo, 1 00 Differential Equations. 8vo, 1 00 * Theory of Errors and the Method of Least Squares. 12mo, 1 50 Theory of Errors and the Method of Least Squares. 12mo, 1 50 Treatise on Differential Calculus. Large 12mo, 1 50 Treatise on Ordinary and Partial Differential Equations. Large 12mo, 3 00 Treatise on Ordinary and Partial Differential Equations. Large 12mo, 3 50 Karapetof's Engineering Applications of Higher Mathematics: 8vo, 3 00 Laplace's Philosophical Essay on Probabilities. (Truscott and Emory.) 12mo, 2 50 * Koch's Mathematics of Applied Electricity. 8vo, 3 00 Laplace's Philosophical Essay on Probabilities. (Truscott and Emory.) 12mo, 2 50 * Ludlow's Logarithmic and Trigonometric Tables. 8vo, 3 00 Laplace's Philosophical Essay on Probabilities. (Truscott and Emory.) 12mo, 2 50 * Ludlow's Logarithmic and Trigonometric Tables. 8vo, 1 00 Manning's Irrational Numbers and their Representation by Sequences and 50 * Uniformational Numbers and their Representation by Sequences and 8vo, 1 10 * Vol. II. Kinematics and Kinetics. 12mo, 1 55 * Vol. III. Kinematics and Kinetics	* Buchanan's Plane and Spherical Trigonometry8vo,		
**Coffin's Vector Analysis			
Compton's Manual of Logarithmic Computations. 12mo, 1 50			
* Dickson's College Algebra. Large 12mo, 1 50 * Introduction to the Theory of Algebraic Equations. Large 12mo, 1 25 Emch's Introduction to Projective Geometry and its Application. 8vo, 2 50 Fiske's Functions of a Complex Variable. 8vo, 1 00 Halsted's Elementary Synthetic Geometry. 8vo, 1 75 * Rational Geometry. 12mo, 1 50 Synthetic Projective Geometry. 8vo, 1 75 * Rational Geometry. 12mo, 1 50 Synthetic Projective Geometry. 8vo, 1 00 * Hancock's Lectures on the Theory of Elliptic Functions 8vo, 5 00 * Hyde's Grassmann's Space Analysis. 8vo, 1 00 * Johnson's (J. B.) Three-place Logarithmic Tables: Vest-pocket size, paper, 9 15 * Mounted on heavy cardboard, 8 × 10 inches, 2 20 Johnson's (W. W.) Abridged Editions of Differential and Integral Calculus. Large 12mo, 1 vol. 2 50 Curve Tracing in Cartesian Co-ordinates. 12mo, 1 00 Elementary Treatise on Differential Calculus. Large 12mo, 1 50 * Theoretical Mechanics. 8vo, 1 00 Theory of Errors and the Method of Least Squares. 12mo, 3 00 Treatise on Differential Calculus. Large 12mo, 3 00 Treatise on Ordinary and Partial Differential Equations. Large 12mo, 3 00 Treatise on Ordinary and Partial Differential Equations. Large 12mo, 3 50 Karapetoff's Engineering Applications of Higher Mathematics: * Part I. Problems on Machine Design. Large 12mo, 2 00 * Koch's Mathematics of Applied Electricity. 8vo, 3 00 * Luplace's Philosophical Essay on Probabilities. (Truscott and Emory.) 12mo, 2 00 * Luplace's Philosophical Essay on Probabilities. (Truscott and Emory.) 12mo, 2 00 * Ludlow's Logarithmic and Trigonometric Tables. 8vo, 1 00 * Ludlow's Logarithmic and Trigonometry and Logarithmic and Other Tables. 8vo, 1 00 Macfarlane's Vector Analysis and Quaternions. 8vo, 1 00 Macfarlane's Vector Analysis and Quaternions. 8vo, 1 00 Manning's Irrational Numbers and their Representation by Sequences and Series. 12mo, 1 25 * Vol. II. Kinematics and Kinetics. 12mo, 1 25 * Vol. III. Mechanics of Materials. 12mo, 1 50 * Vol. III. Mechanics of Materials. 12mo, 1 50	Compton's Manual of Logarithmic Computations		
Emch's Introduction to Projective Geometry and its Application			
Piske's Functions of a Complex Variable			
Halsted's Elementary Synthetic Geometry. 8vo, 1 50			
Elements of Geometry			
* Rational Geometry	Flaments of Geometry		
Synthetic Projective Geometry. 8vo, 1 00 * Hancock's Lectures on the Theory of Elliptic Functions 8vo, 5 00 * Hyde's Grassmann's Space Analysis. 8vo, 1 00 * Johnson's (J. B.) Three-place Logarithmic Tables: Vest-pocket size, paper, 100 copies, 5 00 * Mounted on heavy cardboard, 8 × 10 inches, 2 20 * Mounted on heavy cardboard, 8 × 10 inches, 2 20 Johnson's (W. W.) Abridged Editions of Differential and Integral Calculus. Large 12mo, 1 vol. 2 50 Curve Tracing in Cartesian Co-ordinates. 12mo, 1 00 Differential Equations. 8vo, 1 00 Elementary Treatise on Differential Calculus. Large 12mo, 1 50 Elementary Treatise on the Integral Calculus. Large 12mo, 1 50 * Theoretical Mechanics. 12mo, 3 00 Treatise on Differential Calculus. Large 12mo, 3 00 Treatise on Differential Calculus. Large 12mo, 3 00 Treatise on Ordinary and Partial Differential Equations. Large 12mo, 3 00 Treatise on Ordinary and Partial Differential Equations. Large 12mo, 3 00 Karapetoff's Engineering Applications of Higher Mathematics: 8vo, 1 00 * Koch's Mathematics of Applied Electricity. 8vo, 3 00 * Koch's Mathematics of Applied Electricity. 8vo, 3 00 * Ludlow's Logarithmic and Trigonometric Tables. 8vo, 1 00 * Ludlow's Logarithmic and Trigonometric Tables. 8vo, 1 00 * Ludlow and Bass's Elements of Trigonometry and Logarithmic and Other Tables. 8vo, 1 00 * Trables. 8vo, 1 00 * Trables. 8vo, 1 00 Manning's Irrational Numbers and their Representation by Sequences and Series. 12mo, 1 25 * Matrin's Text Book on Mechanics. Vol. I. Statics 12mo, 1 25 * Vol. III. Kinematics and Kinetics. 12mo, 1 50 * Vol. III. Kinematics and Materials. 12mo, 1 50 * Vol. III. Mechanics of Materials. 12mo, 1 50	* Rational Geometry		
Hyde's Grassmann's Space Analysis			
* Johnson's (J. B.) Three-place Logarithmic Tables: Vest-pocket size, paper,			
* Mounted on heavy cardboard			
* Mounted on heavy cardboard, 8 × 10 inches, 10 copies, 2 00 Johnson's (W. W.) Abridged Editions of Differential and Integral Calculus. Large 12mo, 1 vol. 2 50 Curve Tracing in Cartesian Co-ordinates. 12mo, 1 00 Differential Equations. 8vo, 1 00 Elementary Treatise on Differential Calculus. Large 12mo, 1 50 Elementary Treatise on the Integral Calculus. Large 12mo, 1 50 * Theoretical Mechanics. 12mo, 1 50 Treatise on Differential Calculus. Large 12mo, 1 50 Treatise on Differential Calculus. Large 12mo, 3 00 Treatise on Differential Calculus. Large 12mo, 3 00 Treatise on Ordinary and Partial Differential Equations. Large 12mo, 3 50 Karapetoff's Engineering Applications of Higher Mathematics: * Part I. Problems on Machine Design. Large 12mo, 8 vo, 3 00 Laplace's Philosophical Essay on Probabilities. (Truscott and Emory.) 12mo, 2 00 * Le Messurier's Key to Professor W. W. Johnson's Differential Equations. * Ludlow's Logarithmic and Trigonometric Tables. 8vo, 1 00 * Ludlow and Bass's Elements of Trigonometry and Logarithmic and Other Tables. 8vo, 1 00 * Trigonometry and Tables published separately. Each, 2 00 Macfarlane's Vector Analysis and Quaternions. 8vo, 1 00 MacMahon's Hyperbolic Functions. 8vo, 1 00 Manning's Irrational Numbers and their Representation by Sequences and Series. 12mo, 1 25 * Martin's Text Book on Mechanics. Vol. I. Statics 12mo, 1 50 * Vol. III. Kinematics and Kinetics, 12mo, 1 50 * Vol. III. Mechanics of Materials. 12mo, 1 50			
# 10 copies, 2 00 Johnson's (W. W.) Abridged Editions of Differential and Integral Calculus. Large 12mo, 1 vol. 2 50 Curve Tracing in Cartesian Co-ordinates			
Large 12mo, 1 vol. 2 50 Curve Tracing in Cartesian Co-ordinates 12mo, 1 00 Differential Equations 8vo, 1 00 Elementary Treatise on Differential Calculus Large 12mo, 1 50 Elementary Treatise on the Integral Calculus Large 12mo, 1 50 * Theoretical Mechanics 12mo, 3 00 Theory of Errors and the Method of Least Squares 12mo, 3 00 Treatise on Differential Calculus Large 12mo, 3 00 Treatise on Differential Calculus Large 12mo, 3 00 Treatise on Ordinary and Partial Differential Equations Large 12mo, 3 00 Treatise on Ordinary and Partial Differential Equations Large 12mo, 3 00 Treatise on Ordinary and Partial Differential Equations Large 12mo, 3 50 Karapetoff's Engineering Applications of Higher Mathematics *Part I. Problems on Machine Design Large 12mo, 0 75 * Koch's Mathematics of Applied Electricity 8vo, 3 00 Laplace's Philosophical Essay on Probabilities (Truscott and Emory 12mo, 2 00 * Ludlow's Logarithmic and Trigonometric Tables 8vo, 1 00 * Ludlow and Bass's Elements of Trigonometry and Logarithmic and Other Tables 8vo, 2 00 * Trigonometry and Tables published separately Each, 2 00 Macfarlane's Vector Analysis and Quaternions 8vo, 1 00 McMahon's Hyperbolic Functions 8vo, 1 00 Manning's Irrational Numbers and their Representation by Sequences and Series 12mo, 1 25 * Martin's Text Book on Mechanics Vol. I. Statics 12mo, 1 25 * Vol. III. Kinematics and Kinetics 12mo, 1 50 * Vol. III. Kinematics and Kinetics 12mo, 1 50 * Vol. III. Mechanics of Materials 12mo, 1 50 * Vol. III. Mechanics of Materials 12mo, 1 50 * Vol. III. Mechanics of Materials 12mo, 1 50 * Vol. III. Mechanics of Materials 12mo, 1 50 * Vol. III. Mechanics of Materials 12mo, 1 50 * Vol. III. Mechanics of Materials 12mo, 1 50 * Vol. III. Mechanics of Materials 12mo, 1 50 * Vol. III. Mechanics of Materials 12mo, 1 50 * Vol. III. Mechanics 12mo, 1 50 * Vol.	* 10 copies,		
Differential Equations.	Large 12mo, 1 vol.	2	50
Elementary Treatise on Differential Calculus. Large 12mo, 1 50 Elementary Treatise on the Integral Calculus. Large 12mo, 3 00 *Theoretical Mechanics			
Elementary Treatise on the Integral Calculus. Large 12mo, 3 00 * Theoretical Mechanics	Differential Equations		
* Theoretical Mechanics			
Theory of Errors and the Method of Least Squares. 12mo, 1 50 Treatise on Differential Calculus. Large 12mo, 3 00 Treatise on Ordinary and Partial Differential Equations. Large 12mo, 3 50 Treatise on Ordinary and Partial Differential Equations. Large 12mo, 3 50 Karapetoff's Engineering Applications of Higher Mathematics: * Part I. Problems on Machine Design. Large 12mo, 0 75 * Koch's Mathematics of Applied Electricity. 8vo, 3 00 Laplace's Philosophical Essay on Probabilities. (Truscott and Emory.) 12mo, 2 00 * Le Messurier's Key to Professor W. W. Johnson's Differential Equations. * Ludlow's Logarithmic and Trigonometric Tables. 8vo, 1 00 * Ludlow and Bass's Elements of Trigonometry and Logarithmic and Other Tables. 8vo, 2 00 * Trigonometry and Tables published separately. Each, 2 00 Macfarlane's Vector Analysis and Quaternions. 8vo, 1 00 Manning's Irrational Numbers and their Representation by Sequences and Series. 12mo, 1 25 * Martin's Text Book on Mechanics. Vol. I. Statics 12mo, 1 50 * Vol. III. Kinematics and Kinetics. 12mo, 1 50 * Vol. III. Mechanics of Materials. 12mo, 1 50			
Treatise on Differential Calculus	Theory of Errors and the Method of Least Squares		
Treatise on Ordinary and Partial Differential Equations. Large 12mo, Starapetoff's Engineering Applications of Higher Mathematics: * Part I. Problems on Machine Design. Large 12mo, 0 75 * Koch's Mathematics of Applied Electricity. 8vo, 3 00 Laplace's Philosophical Essay on Probabilities. (Truscott and Emory.) 12mo, 2 00 * Le Messurier's Key to Professor W. W. Johnson's Differential Equations. Small 8vo, 1 75 * Ludlow's Logarithmic and Trigonometric Tables. 8vo, 1 00 * Ludlow and Bass's Elements of Trigonometry and Logarithmic and Other Tables. 8vo, 2 00 * Trigonometry and Tables published separately. Each, 2 00 Macfarlane's Vector Analysis and Quaternions. 8vo, 1 00 McMahon's Hyperbolic Functions. 8vo, 1 00 Manning's Irrational Numbers and their Representation by Sequences and Series. 12mo, 1 25 * Martin's Text Book on Mechanics. Vol. I. Statics 12mo, 1 50 * Vol. III. Kinematics and Kinetics. 12mo, 1 50 * Vol. III. Mechanics of Materials. 12mo, 1 50	Treatise on Differential CalculusLarge 12mo,	3	00
Karapetoff's Engineering Applications of Higher Mathematics: * Part I. Problems on Machine Design	Treatise on the Integral Calculus		
* Part I. Problems on Machine Design. Large 12mo, 0 75 * Koch's Mathematics of Applied Electricity. 2 00 * Laplace's Philosophical Essay on Probabilities. (Truscott and Emory.) 12mo, 2 00 * Le Messurier's Key to Professor W. W. Johnson's Differential Equations. Small 8vo, 1 75 * Ludlow's Logarithmic and Trigonometric Tables. 8vo, 1 00 * Ludlow and Bass's Elements of Trigonometry and Logarithmic and Other Tables. 8vo, 2 00 * Trigonometry and Tables published separately. Each, 2 00 Macfarlane's Vector Analysis and Quaternions. 8vo, 1 00 Manning's Irrational Numbers and their Representation by Sequences and Series. 12mo, 1 25 * Martin's Text Book on Mechanics. Vol. I. Statics 12mo, 1 25 * Vol. III. Kinematics and Kinetics. 12mo, 1 50 * Vol. III. Mechanics of Materials. 12mo, 1 50		3	
* Koch's Mathematics of Applied Electricity		0	
* Le Messurier's Key to Professor W. W. Johnson's Differential Equations. * Ludlow's Logarithmic and Trigonometric Tables. Swo, 1 00 * Ludlow and Bass's Elements of Trigonometry and Logarithmic and Other Tables. Swo, 3 00 * Trigonometry and Tables published separately. Each, 2 00 Macfarlane's Vector Analysis and Quaternions. Swo, 1 00 Manning's Irrational Numbers and their Representation by Sequences and Series. 12mo, 1 25 * Martin's Text Book on Mechanics. Vol. I. Statics 12mo, 1 25 * Vol. III. Kinematics and Kinetics. 12mo, 1 50 * Vol. III. Mechanics of Materials. 12mo, 1 50	* Koch's Mathematics of Applied Electricity 8vo,		
* Ludlow's Logarithmic and Trigonometric Tables. 8vo, 1 00 * Ludlow and Bass's Elements of Trigonometry and Logarithmic and Other Tables. 8vo, 3 00 * Trigonometry and Tables published separately. Each, 2 00 McMahon's Hyperbolic Functions. 8vo, 1 00 Manning's Irrational Numbers and their Representation by Sequences and Series. 12mo, 1 25 * Martin's Text Book on Mechanics. Vol. I. Statics 12mo, 1 25 * Vol. III. Kinematics and Kinetics, 12mo, 1 50 * Vol. III. Mechanics of Materials. 12mo, 1 50		2	00
* Ludlow's Logarithmic and Trigonometric Tables	Small 8vo.	1	75
Tables. 8vo, 3 00 * Trigonometry and Tables published separately. Each, 2 00 Macfarlane's Vector Analysis and Quaternions. 8vo, 1 00 McMahon's Hyperbolic Functions. 8vo, 1 00 Manning's Irrational Numbers and their Representation by Sequences and Series. 12mo, 1 25 * Martin's Text Book on Mechanics. 12mo, 1 25 * Vol. II. Kinematics and Kinetics. 12mo, 1 50 * Vol. III. Mechanics of Materials. 12mo, 1 50	* Ludlow's Logarithmic and Trigonometric Tables 8vo,	1	00
Macfarlane's Vector Analysis and Quaternions. 8vo, 1 1 00 McMahon's Hyperbolic Functions. 8vo, 1 1 00 Manning's Irrational Numbers and their Representation by Sequences and Series. 12mo, 1 125 * Martin's Text Book on Mechanics. 12 Izmo, 1 12 Izmo, 1 12 Izmo, 1 150 * Vol. II. Kinematics and Kinetics. 12 mo, 1 150 * 10	Tables		
McMahon's Hyperbolic Functions. 8vo, 1 00 Manning's Irrational Numbers and their Representation by Sequences and Series. 12mo, 1 25 * Martin's Text Book on Mechanics. 12mo, 1 25 * Vol. II. Kinematics and Kinetics. 12mo, 1 50 * Vol. III. Mechanics of Materials. 12mo, 1 50			
Manning's Irrational Numbers and their Representation by Sequences and Series. 1 2mo, 1 25 * Martin's Text Book on Mechanics. 12 2mo, 1 25 * Vol. II. Kinematics and Kinetics. 12 mo, 1 50 * Vol. III. Mechanics of Materials. 12 mo, 1 50			
* Martin's Text Book on Mechanics. Vol. I. Statics 12 mo, 1 25 * Vol. II. Kinematics and Kinetics 12 mo, 1 50 * Vol. III. Mechanics of Materials 12 mo, 1 50	Manning's Irrational Numbers and their Representation by Sequences and		
* Vol. II. Kinematics and Kinetics			
* Vol. III. Mechanics of Materials12mo, 1 50			
• • •			
	•		

Mathematical Monographs. Edited by Mansfield Merriman and Robert		
S. WoodwardOctavo, each	\$ 1	00
No. 1. History of Modern Mathematics, by David Eugene Smith.		
No. 2. Synthetic Projective Geometry, by George Bruce Halsted. No. 3. Determinants, by Laenas Gifford Weld. No. 4. Hyper-		
bolie Functions, by James McMahon. No. 5. Harmonic Func-		
bolie Functions, by James McMahon. No. 5. Harmonic Functions, by William E. Byerly. No. 6. Grassmann's Space Analysis, by Edward W. Hyde. No. 7. Probability and Theory of Errors,		
by Edward W. Hyde. No. 7. Probability and Theory of Errors,		
by Robert S. Woodward. No. 8. Vector Analysis and Quaternions,		
by Alexander Macfarlane. No. 9. Differential Equations, by		
William Woolsey Johnson. No. 10. The Solution of Equations, by Mansfield Merriman. No. 11. Functions of a Complex Variable,		
by Thomas S. Fiske.		
Maurer's Technical Mechanics	4	00
Merriman's Method of Least Squares		00
Solution of Equations	1	00
* Moritz's Elements of Plane Trigonometry8vo,	2	00
Rice and Johnson's Differential and Integral Calculus. 2 vols. in one.	٠.	
Large 12mo, Elementary Treatise on the Differential Calculus Large 12mo,		50 00
Smith's History of Modern Mathematics8vo,		00
* Veblen and Lennes's Introduction to the Real Infinitesimal Analysis of One	•	00
Variable8vo,	2	00
* Waterbury's Vest Pocket Hand-book of Mathematics for Engineers.		
2₹×5∰ inches, mor.		00
* Enlarged Edition, Including Tablesmor.	1	
Weld's Determinants		00
Woodward's Probability and Theory of Errors		00
Woodward's Propagatity and Process of Briefs.	•	•
MECHANICAL ENGINEERING.		
	ъ.	
MATERIALS OF ENGINEERING, STEAM-ENGINES AND BOILE		
Bacon's Forge Practice		50
Baldwin's Steam Heating for Buildings	2	50 50
* Bartlett's Mechanical Drawing		00
* " " Abridged Ed8vo,		50
* Bartlett and Johnson's Engineering Descriptive Geometry8vo,	1	50
* Burr's Ancient and Modern Engineering and the Isthmian Canal 8vo,		50
Carpenter's Heating and Ventilating Buildings8vo,		00
* Carpenter and Diederichs's Experimental Engineering		00
Compton's First Lessons in Metal Working	1	50
Compton and De Groodt's Speed Lathe		50
Coolidge's Manual of Drawing 8vo paper	1	00
Coolidge and Freeman's Elements of General Drafting for Mechanical En-		
gineersOblong 4to,		50
Cromwell's Treatise on Belts and Pulleys		50
Dingey's Machinery Pattern Making	1 2	50 00
Durley's Kinematics of Machines	4	00
Flanders's Gear-cutting Machinery Large 12mo,	3	
Flather's Dynamometers and the Measurement of Power12mo,	3	00
Rope Driving	2	00
Gill's Gas and Fuel Analysis for Engineers	1	25
* Greene's Pumping Machinery		00 00
Hering's Ready Reference Tables (Conversion Factors)16mo, mor.		50
* Hobart and Ellis's High Speed Dynamo Electric Machinery 8vo,		00
Hutton's Gas Engine8vo,		00
Jamison's Advanced Mechanical Drawing8vo,		00
Elements of Mechanical Drawing		50
Jones's Gas Engine8vo, Machine Design:	4	00
Part I. Kinematics of Machinery8vo,	1	50
Part II. Form, Strength, and Proportions of Parts 8vo,		00

* Kaup's Machine Shop PracticeLarge 12mo		25
* Kent's Mechanical Engineer's Pocket-Book 16mo, mor. Kerr's Power and Power Transmission 8vo, * Kimball and Barr's Machine Design 8vo,		00
* Kimball and Barr's Machine Design		00
* King's Elements of the Mechanics of Materials and of Power of Trans-	٠	•
mission8vo,	2	50
* Lanza's Dynamics of Machinery8vo,	2	50
Leonard's Machine Shop Tools and Methods		00
* Levin's Gas Engine8vo,		00
* Lorenz's Modern Refrigerating Machinery. (Pope, Haven, and Dean)8vo, MacCord's Kinematics; or, Practical Mechanism8vo,		00
Mechanical Drawing		00
Velocity Diagrams		50
MacFarland's Standard Reduction Factors for Gases	ī	
Mahan's Industrial Drawing. (Thompson.)	3	
Mehrtens's Gas Engine Theory and DesignLarge 12mo,	2	5 0
Miller, Berry, and Riley's Problems in Thermodynamics and Heat Engineer-	_	
iny	2	75 50
* Parchall and Hobert's Flectric Machine Design Small 4to half leather	12	50
* Peele's Compressed Air Plant. Second Edition, Revised and Enlarged. 8vo,		50
* Perkins's Introduction to General Thermodynamics	1	
Poole's Calorific Power of Fueis 8vo	3	
* Porter's Engineering Reminiscences, 1855 to 1882	3	00
Randall's Treatise on Heat. (In Press.)		
* Reid's Mechanical Drawing. (Elementary and Advanced.)8vo,	2	00
Text-book of Mechanical Drawing and Elementary Machine Design.8vo,	3	
Richards's Compressed Air	1	50 00
Schwamb and Merrill's Elements of Mechanism	_	00
Smith (A. W.) and Marx's Machine Design		00
Smith's (O.) Press-working of Metals		00
Sorel's Carbureting and Combustion in Alcohol Engines. (Woodward and Preston.)		
Preston.) Large 12mo,		00
Stone's Practical Testing of Gas and Gas Meters	3	50
Thurston's Animal as a Machine and Prime Motor, and the Laws of Energetics.		^^
12mo, Treatise on Friction and Lost Work in Machinery and Mill Work8vo,		00
* Tillson's Complete Automobile Instructor		50
* Titsworth's Elements of Mechanical DrawingOblong 8vo,		25
Warren's Elements of Machine Construction and Drawing 8vo.	7	
* Waterbury's Vest Pocket Hand-book of Mathematics for Engineers.		
$2\frac{7}{4} \times 5\frac{7}{4}$ inches, mor.		00
$2\frac{7}{4} \times 5\frac{7}{4}$ inches, mor.		00 50
$2\frac{7}{4} \times 5\frac{7}{4}$ inches, mor.	1	50
* Enlarged Edition, Including Tables	1 5	50 00
* Enlarged Edition, Including Tables	1 5 5	50 00 00
$2\frac{7}{4} \times 5\frac{7}{4}$ inches, mor.	1 5 5	50 00
* Enlarged Edition, Including Tables	1 5 5	50 00 00
* Enlarged Edition, Including Tables	1 5 5	50 00 00
* Enlarged Edition, Including Tables	1 5 5 2 7	50 00 00 50
* Enlarged Edition, Including Tables	1 5 5 2 7	50 00 00 50
* Enlarged Edition, Including Tables	1 5 5 2 7 6	50 00 50 50
* Enlarged Edition, Including Tables	1 5 5 2 7 6	50 00 50 50 50
* Enlarged Edition, Including Tables. mor. * Enlarged Edition, Including Tables. mor. Weisbach's Kinematics and the Power of Transmission. (Herrmann- Klein.). 8vo, Machinery of Transmission and Governors. (Hermann-Klein.) 8vo, Wood's Turbines. 8vo, * MATERIALS OF ENGINEERING. Burr's Elasticity and Resistance of the Materials of Engineering. 8vo, * Mechanics of Solids (Being Parts I, II, III of Mechanics of Engineering). * Svo, * Greene's Structural Mechanics. 8vo, * 8vo,	1 5 5 2 7 6	50 00 50 50
* Enlarged Edition, Including Tables. mor. * Enlarged Edition, Including Tables. mor. Weisbach's Kinematics and the Power of Transmission. (Herrmann- Klein.). 8vo, Machinery of Transmission and Governors. (Hermann-Klein.) 8vo, Wood's Turbines. 8vo, * MATERIALS OF ENGINEERING. Burr's Elasticity and Resistance of the Materials of Engineering. 8vo, * Mechanics of Solids (Being Parts I, II, III of Mechanics of Engineering). * Svo, * Greene's Structural Mechanics. 8vo, * 8vo,	1 5 5 2 7 6 4 2	50 00 50 50 50
* Enlarged Edition, Including Tables	1 5 5 2 7 6 4 2	50 00 00 50 50 50 50 00
* Enlarged Edition, Including Tables	1 5 5 2 7 6 4 2 3	50 00 50 50 50 50 50 50 60 60
* Enlarged Edition, Including Tables	1 5 5 2 7 6 4 2 3 3 6	50 00 50 50 50 50 50 60 60 60 60
* Enlarged Edition, Including Tables	1 5 5 2 7 6 4 2 3 3 6	50 00 50 50 50 50 50 50 60 60
* Enlarged Edition, Including Tables	1 5 5 2 7 6 4 2 3 3 6 6 2	50 00 00 50 50 50 50 00 60 60 50
* Enlarged Edition, Including Tables. mor. Weisbach's Kinematics and the Power of Transmission. (Herrmann—Klein.). 8vo, Machinery of Transmission and Governors. (Kermann—Klein.) 8vo, Wood's Turbines. 8vo, MATERIALS OF ENGINEERING. Burr's Elasticity and Resistance of the Materials of Engineering. 8vo, Church's Mechanics of Engineering. 8vo, Mechanics of Solids (Being Parts I, II, III of Mechanics of Engineering). * Greene's Structural Mechanics. 8vo, Holley's Analysis of Paint and Varnish Products. (In Press.) * Lead and Zinc Pigments. Large 12mo, Johnson's (C. M.) Rapid Methods for the Chemical Analysis of Special Steels, Steel-Making Alloys and Graphite Large 12mo, Johnson's (J. B.) Materials of Construction. 8vo, Keep's Cast Iron. 8vo, * King's Elements of the Mechanics of Materials and of Power of Transmission. 8vo,	1 5 5 2 7 6 4 2 3 3 6 6 2 2	50 00 50 50 50 50 50 00 00 50 50
* Enlarged Edition, Including Tables. mor. Weisbach's Kinematics and the Power of Transmission. (Herrmann—Klein.). 8vo, Machinery of Transmission and Governors. (Kermann—Klein.). 8vo, Wood's Turbines. 8vo, MATERIALS OF ENGINEERING. Burr's Elasticity and Resistance of the Materials of Engineering. 8vo, Church's Mechanics of Engineering. 8vo, Mechanics of Solids (Being Parts I, II, III of Mechanics of Engineering). * Greene's Structural Mechanics. 8vo, Holley's Analysis of Paint and Varnish Products. (In Press.) * Lead and Zinc Pigments. Large 12mo, Johnson's (C. M.) Rapid Methods for the Chemical Analysis of Special Steels, Steel-Making Alloys and Graphite Large 12mo, Johnson's (J. B.) Materials of Construction. 8vo, Keep's Cast Iron. 8vo, Keep's Cast Iron. 8vo, Lanza's Applied Mechanics. 8vo, Lanza's Applied Mechanics. 8vo, Lowe's Paints for Steel Structures. 12mo,	1 5 5 2 7 6 4 2 3 3 6 6 2 2 7	50 00 00 50 50 50 50 00 60 60 50
* Enlarged Edition, Including Tables. mor. Weisbach's Kinematics and the Power of Transmission. (Herrmann—Klein.). 8vo, Machinery of Transmission and Governors. (Fiermann—Klein.) 8vo, Wood's Turbines. 8vo, MATERIALS OF ENGINEERING. Burr's Elasticity and Resistance of the Materials of Engineering. 8vo, Mechanics of Engineering. 8vo, Mechanics of Solids (Being Parts I, II, III of Mechanics of Engineering). * Greene's Structural Mechanics. 8vo, Holley's Analysis of Paint and Varnish Products. (In Press.) * Lead and Zinc Pigments. Large 12mo, Johnson's (C. M.) Rapid Methods for the Chemical Analysis of Special Steels, Steel-Making Alloys and Graphite Large 12mo, Johnson's (J. B.) Materials of Construction 8vo, Keep's Cast Iron. 8vo, King's Elements of the Mechanics of Materials and of Power of Transmission. 8vo, Lanza's Applied Mechanics. 8vo,	1 5 5 2 7 6 4 2 3 3 6 6 2 2 7 1	50 00 50 50 50 50 50 00 50 50 50 50

Maurer's Technical Mechanics		90
Merriman's Mechanics of Materials		00
* Strength of Materials		00
* Mundoole's Strongth of Materials 12mo		00
* Murdock's Strength of Materials		00
Smith's (A. W.) Materials of Machines	ı	
* Smith's (H. E.) Strength of Material	í	
Thurston's Materials of Engineering		00
Part I. Non-metallic Materials of Engineering,8vo,		00
Part II. Iron and Steel		50
Part III. A Treatise on Brasses, Bronzes, and Other Alloys and their		•
Constituents	9	50
* Waterbury's Laboratory Manual for Testing Materials of Construction.		•
12mo.	1	56
Wood's (De V.) Elements of Analytical Mechanics		00
Treatise on the Resistance of Materials and an Appendix on the	٠	•
Preservation of Timber8vo.	9	00
Wood's (M. P.) Rustless Coatings. Corrosion and Electrolysis of Iron and	_	•
Steel	4	06
D100 11111111111111111111111111111111	-	00
STEAM-ENGINES AND BOILERS.		
SIEAM-ENGINES AND BUILERS.		
Berry's Temperature-entropy Diagram. Third Edition Revised and En-		
larged	2	50
Carnot's Reflections on the Motive Power of Heat. (Thurston.)12mo,		50
Chose's Art of Pottern Moking		50
Chase's Art of Pattern Making		00
Dawson's "Engineering" and Electric Traction Pocket-book10mo, mor.		00
* Gebhardt's Steam Power Plant Engineering8vo,		00
Goss's Locomotive Performance		00
Hemenway's Indicator Practice and Steam-engine Economy12mo.	2	00
Hirshfeld and Barnard's Heat Power Engineering. (In Press.)	-	-
Hutton's Heat and Heat-engines	5	00
Mechanical Engineering of Power Plants		00
Kent's Steam Boiler Economy		00
Kneass's Practice and Theory of the Injector		50
MacCord's Slide-valves		00
Meyer's Modern Locomotive Construction4to.		00
Miller, Berry, and Riley's Problems in Thermodynamics8vo, paper,		75
Moyer's Steam Turbine8vo,		00
Peabody's Manual of the Steam-engine Indicator		50
Tables of the Properties of Steam and Other Vapors and Temperature-	•	00
Entropy Table	1	00
Thermodynamics of the Steam-engine and Other Heat-engines 8vo,		00
* Thermodynamics of the Steam Turbine	_	00
Valve-gears for Steam-engines		50
Peabody and Miller's Steam-boilers8vo,		00
* Perkins's Introduction to General Thermodynamics12mo.		50
Pupin's Thermodynamics of Reversible Cycles in Gases and Saturated Vapors.	•	-
(Osterberg.)	1	25
Reagan's Locomotives: Simple, Compound, and Electric. New Edition.	-	
Large 12mo.	3	50
Sinclair's Locomotive Engine Running and Management		00
Smart's Handbook of Engineering Laboratory Practice		50
Snow's Steam-boiler Practice8vo,		00
Spangler's Notes on Thermodynamics		00
Valve-gears8vo,	2	50
Spangler, Greene, and Marshall's Elements of Steam-engineering 8vo,		00
Thomas's Steam-turbines		00
Thurston's Handbook of Engine and Boiler Trials, and the Use of the Indi-	_	
cator and the Prony Brake8vo,	5	00
Manual of Steam-boilers, their Designs Construction, and Operation 8vo,		00
Manual of the Steam-engine		
Part I. History, Structure, and Theory8vo,	6	00
Part II. Design, Construction, and Operation8vo,	6	00
15		

Wehrenfennig's Analysis and Softening of Boiler Feed-water. (Patterson.)	• 4	00
Weisbach's Heat, Steam, and Steam-engines. (Du Bois)		00
Weisbach's Heat, Steam, and Steam-engines. (Du Bois.) 8vo, Whitham's Steam-engine Design 8vo.		00
Wood's Thermodynamics, Heat Motors, and Refrigerating Machines 8vo,	4	00
MECHANICS PURE AND APPLIED.		
Church's Mechanics of Engineering8vo,	6	00
Mechanics of Fluids (Being Part IV of Mechanics of Engineering). 8vo,		00
* Mechanics of Internal Work	1	50
Notes and Emergles in Machanian		
Notes and Examples in Mechanics		00 50
Du Bois's Elementary Principles of Mechanics:		
Vol. I. Kinematics		50 00
Mechanics of Engineering. Vol. I		50
Vcl. IISmall 4to,		00
* Greene's Structural Mechanics		50 25
James's Kinematics of a Point and the Rational Mechanics of a Particle.	1	20
Large 12mo,	2	00
* Johnson's (W. W.) Theoretical Mechanics	3	00
mission	2	50
Lanza's Applied Mechanics	7	5 0
		25
* Vol. II. Kinematics and Kinetics		50 50
Maurer's Technical Mechanics	4	00
* Merriman's Elements of Mechanics		00
* Michie's Elements of Analytical Mechanics		00
Robinson's Principles of Mechanism		00
Sanborn's Mechanics Problems. Large 12mo, Schwamb and Merrill's Elements of Mechanism		50 00
Wood's Elements of Analytical Mechanics		00
Principles of Elementary Mechanics12mo,	1	25
MEDICAL.		
* Abderhalden's Physiological Chemistry in Thirty Lectures. (Hall and		
Defren.)		00
* Bolduan's Immune Sera		50
* Bolduan's Immune Sera. 12mo, Bordet's Studies in Immunity. (Gay.) 8vo,		00
* Chapin's The Sources and Modes of Infection Large 12mo, Davenport's Statistical Methods with Special Reference to Biological Varia-	3	00
tions	1	50
Ehrlich's Collected Studies on Immunity. (Bolduan.)8vo.		00
* Fischer's Nephritis		50 00
* Oedema		00
*de Fursac's Manual of Psychiatry. (Rosanoff and Collins.)Large 12mo,		50
* Hammarsten's Text-book on Physiological Chemistry. (Mandel.)8vo, Jackson's Directions for Laboratory Work in Physiological Chemistry8vo,		00 25
Lassar-Cohn's Praxis of Urinary Analysis. (Lorenz.)		00
* Lauffer's Electrical Injuries		50
Mandel's Hand-book for the Bio-Chemical Laboratory		50 00
* Pauli's Physical Chemistry in the Service of Medicine. (Fischer.)12mo,		25
* Pauli's Physical Chemistry in the Service of Medicine. (Fischer.)12mo, * Pozzi-Escot's Toxins and Venoms and their Antibodies. (Cohn.)12mo,	1	00
Rostoski's Serum Diagnosis. (Bolduan.)		00
Whys in Pharmacy12mo,		00
Salkowski's Physiological and Pathological Chemistry. (Orndorff.)8vo,	2	50

* Satterlee's Outlines of Human Embryology12mo,	\$1	25
Smith's Lecture Notes on Chemistry for Dental Students8vo,		50
* Whipple's Tyhpoid Fever Large 12mo,		90
* Woodhull's Military Hygiene for Officers of the Line Large 12mo,		50
* Personal Hygiene	1	00
Worcester and Atkinson's Small Hospitals Establishment and Maintenance,		
and Suggestions for Hospital Architecture, with Plans for a Small		
Hospital12mo,	1	25
METALLURGY.		
Betts's Lead Refining by Electrolysis 8vo, Bolland's Encyclopedia of Founding and Dictionary of Foundry Terms used	4	00
Bolland's Encyclopedia of Founding and Dictionary of Foundry Terms used		
in the Practice of Moulding		00
Iron Founder		50
" Supplement		50
* Borchers's Metallurgy. (Hall and Hayward.)8vo,	3	00
* Burgess and Le Chatelier's Measurement of High Temperatures. Third	4	00
Edition		00
Goesel's Minerals and Metals: A Reference Book16mo, mor.		00
* Iles's Lead-smelting		50
Johnson's Rapid Methods for the Chemical Analysis of Special Steels,	-	-
Steel-making Alloys and Graphite Large 12mo,	3	00
Keep's Cast Iron		50
Metcalf's Steel. A Manual for Steel-users	2	00
Minet's Production of Aluminum and its Industrial Use. (Waldo.) 12mo,	2	5 0
* Palmer's Foundry PracticeLarge 12mo,		00
* Price and Meade's Technical Analysis of Brass		00
* Ruer's Elements of Metallography. (Mathewson.)8vo,		00
Smith's Materials of Machines		00
Tate and Stone's Foundry Practice		00
Part I. Non-metallic Materials of Engineering, see Civil Engineering,	8	w
page 9.		
Part II. Iron and Steel	3	50
Part II. Iron and Steel	٠	•
Constituents8vo.	2	50
Ulke's Modern Electrolytic Copper Refining8vo,	3	00
West's American Foundry Practice12mo,		50
Moulders' Text Book	2	50
MINERALOGY.		
* Browning's Introduction to the Rarer Elements	1	50
Rrush's Manual of Determinative Mineralogy (Penfield) 840		00
Butler's Pocket Hand-book of Minerals		00
Chester's Catalogue of Minerals		00
Cloth,	1	25
* Crane's Gold and Silver8vo,		00
Dana's First Appendix to Dana's New "System of Mineralogy" Large 8vo,	1	00
Dana's Second Appendix to Dana's New "System of Mineralogy."	_	•
Large 8vo, Manual of Mineralogy and Petrography12mo,		50
Manual of Mineralogy and Petrography		00
Minerals and How to Study Them	12	50
Text-book of Mineralogy		00
Douglas's Untechnical Addresses on Technical Subjects		00
Eakle's Mineral Tables8vo,		25
* Eckel's Building Stones and Clays		00
* Eckel's Building Stones and Clays	3	00
* Groth's The Optical Properties of Crystals. (Jackson.)8vo,		50
Groth's Introduction to Chemical Crystallography (Marshall)12mo,		25
* Hayes's Handbook for Field Geologists		5 0
	-	
Iddings's Igneous Rocks		00 00

Johannsen's Determination of Rock-forming Minerals in Thin Sections. 8vo, With Thumb Index	•=	~~
* Martin's Laboratory Guide to Qualitative Analysis with the Blow-pipe		60
Merrill's Non-metallic Minerals: Their Occurrence and Uses 8vo, Stones for Building and Decoration 8vo, * Penfield's Notes on Determinative Mineralogy and Record of Mineral Tests.	4	00
8vo, paper, Tables of Minerals, Including the Use of Minerals and Statistics of	0	50
Domestic Production8vo,		00
* Pirsson's Rocks and Rock Minerals		50 25
* Ries's Clays: Their Occurrence, Properties and Uses		00
* Ries and Leighton's History of the Clay-working industry of the United States		50
* Rowe's Practical Mineralogy Simplified12mo,		25
* Tillman's Text-book of Important Minerals and Rocks		00
Washington's Manual of the Chemical Analysis of Rocks	Z	w
MINING.		
* Beard's Mine Gases and Explosions Large 12mo,		00
* Crane's Gold and Silver		
* 8vo, mor.	5	00
* Ore Mining Methods	_	
* Dana and Saunders's Rock Drilling		
Eissler's Modern High Explosives		
* Gilbert Wightman and Saunders's Subways and Tunnels of New York. 8vo, Goesel's Minerals and Metals: A Reference Book	4	00
Ihlseng's Manual of Mining 8vo,		00
* Iles's Lead Smelting		50
* Peele's Compressed Air Plant		50 00
Riemer's Shaft Sinking Under Difficult Conditions. (Corning and Peele.)8vo, * Weaver's Military Explosives		00
Wilson's Hydraulic and Placer Mining. 2d edition, rewritten12mo, Treatise on Practical and Theoretical Mine Ventilation12mo.		50 25
SANITARY SCIENCE.	•	20
Association of State and National Food and Dairy Departments, Hartford Meeting, 1906	3	00
Jamestown Meeting, 19078vo.	3	00
* Bashore's Outlines of Practical Sanitation		25
Sanitation of a Country House	1	
* Chapin's The Sources and Modes of InfectionLarge 12mo,	3	00
Folwell's Sewerage. (Designing, Construction, and Maintenance.)8vo, Water-supply Engineering8vo.	3	00 00
Fowler's Sewage Works Analyses		00
Fuertes's Water-filtration Works	_	50
Water and Public Health	1	50 50
* Modern Baths and Bath Houses8vo,	3	00
Sanitation of Public Buildings	1	50
8vo,	4	00
Hazen's Clean Water and How to Get It Large 12mo,		50
Filtration of Public Water-supplies	3	00. 00
Leach's Inspection and Analysis of Food with Special Reference to State		
Control		50 25
Water-supply. (Considered principally from a Sanitary Standpoint).	_	
* Mast's Light and the Behavior of OrganismsLarge 12mo.		00 50
18	_	

Merriman's Elements of Sanitary Engineering		00
Ogden's Sewer Construction8vo,		00
Sewer Design	2	00
* Ogden and Cleveland's Practical Methods of Sewage Disposal for Res-	_	
idences, Hotels and Institutions		50
Parsons's Disposal of Municipal Refuse	2	00
Prescott and Winslow's Elements of Water Bacteriology, with Special Refer-	_	
ence to Sanitary Water Analysis12mo,		50
* Price's Handbook on Sanitation		50
Richards's Conservation by Sanitation8vo,		50
Cost of Cleanness		00
Cost of Food. A Study in Dietaries		00
Cost of Living as Modified by Sanitary Science		00
Cost of Shelter12mo,	1	00
Richards and Woodman's Air, Water, and Food from a Sanitary Stand-	_	
point8vo,	2	00
* Richey's Plumbers', Steam-fitters', and Tinners' Edition (Building		
Mechanics' Ready Reference Series) 16mo, mor.		50
Rideal's Disinfection and the Preservation of Food8vo,		00
Soper's Air and Ventilation of Subways12mo,		50
Turneaure and Russell's Public Water-supplies		00
Venable's Garbage Crematories in America	2	00
Method and Devices for Bacterial Treatment of Sewage 8vo,	3	00
Ward and Whipple's Freshwater Biology. (In Press.)		
Whipple's Microscopy of Drinking-water8vo,	3	50
* Typhoid Fever	3	00
Value of Pure WaterLarge 12mo,	1	00
Winslow's Systematic Relationship of the CoccaceæLarge 12mo,	2	50
MISCELLANEOUS.		
4 m - 12	_	~~
* Burt's Railway Station Service		00
* Chapin's How to Enamel		00 00
* Chapin's How to Enamel	1	00
* Chapin's How to Enamel	1	00 50
* Chapin's How to Enamel. 12mo, Emmons's Geological Guide-book of the Rocky Mountain Excursion of the International Congress of Geologists. Large 8vo, Ferrel's Popular Treatise on the Winds. 8vo,	1 1 4	00 50 00
* Chapin's How to Enamel. 12mo, Emmons's Geological Guide-book of the Rocky Mountain Excursion of the International Congress of Geologists. Large 8vo, Ferrel's Popular Treatise on the Winds. 8vo, Fitzgerald's Boston Machinist. 18mo,	1 1 4 1	50 00 00
* Chapin's How to Enamel. 12mo, Emmons's Geological Guide-book of the Rocky Mountain Excursion of the International Congress of Geologists. Large 8vo, Ferrel's Popular Treatise on the Winds. 8vo, Fitzgerald's Boston Machinist. 18mo, * Fritz, Autobiography of John 8vo,	1 1 4 1 2	50 00 00 00
* Chapin's How to Enamel	1 1 4 1 2 0	50 00 00 00 00 75
* Chapin's How to Enamel	1 1 4 1 2 0 2	50 00 00 00 75 50
* Chapin's How to Enamel	1 1 4 1 2 0 2	50 00 00 00 00 75
* Chapin's How to Enamel	1 4 1 2 0 2 5	50 00 00 00 75 50
* Chapin's How to Enamel	1 1 4 1 2 0 2 5	50 00 00 00 75 50 00
* Chapin's How to Enamel	1 1 4 1 2 0 2 5	50 00 00 75 50 00
* Chapin's How to Enamel	1 1 4 1 2 0 2 5 3 5	50 00 00 75 50 00 50 00
* Chapin's How to Enamel. 12mo, Emmons's Geological Guide-book of the Rocky Mountain Excursion of the International Congress of Geologists. Large 8vo, Ferrel's Popular Treatise on the Winds. 8vo, Fitzgerald's Boston Machinist. 18mo, ** Fritz, Autobiography of John 8vo, Gannett's Statistical Abstract of the World 24mo, Haines's American Railway Management. 12mo, Hanausek's The Microscopy of Technical Products. (Winton) 8vo, Jacobs's Betterment Briefs. A Collection of Published Papers on Organized Industrial Efficiency. 8vo, Metcalfe's Cost of Manufactures, and the Administration of Workshops. 8vo, ** Parkhurst's Applied Methods of Scientific Management 8vo, Putnam's Nautical Charts. 8vo,	1 1 4 1 2 0 2 5 3 5	50 00 00 75 50 00
* Chapin's How to Enamel	1 1 4 1 2 0 2 5 3 5 2 2	50 00 00 75 50 00 50 00
* Chapin's How to Enamel. 12mo, Emmons's Geological Guide-book of the Rocky Mountain Excursion of the International Congress of Geologists. Large 8vo, Ferrel's Popular Treatise on the Winds. 8vo, Fitzgerald's Boston Machinist. 18mo, ** Fritz, Autobiography of John 8vo, Gannett's Statistical Abstract of the World. 24mo, Haines's American Railway Management. 12mo, Hanausek's The Microscopy of Technical Products. (Winton) 8vo, Jacobs's Betterment Briefs. A Collection of Published Papers on Organized Industrial Efficiency. 8vo, Metcalfe's Cost of Manufactures, and the Administration of Workshops. 8vo, ** Parkhurst's Applied Methods of Scientific Management 8vo, Putnam's Nautical Charts. 8vo, Ricketts's History of Rensselaer Polytechnic Institute 1824–1894. Large 12mo,	1 1 4 1 2 0 2 5 3 5 2 2	50 00 00 75 50 00 50 00
* Chapin's How to Enamel	1 1 4 1 2 0 2 5 3 5 2 2 2	50 00 00 75 50 00 50 00 00
* Chapin's How to Enamel	1 1 4 1 2 0 2 5 3 5 2 2 2 2 2 2	50 00 00 00 75 50 00 50 00 00 00
* Chapin's How to Enamel	1 1 4 1 2 0 2 5 3 5 2 2 2 2 2 2 2 2	50 00 00 00 75 50 00 50 00 00 00 00
* Chapin's How to Enamel	1 1 4 1 2 0 2 5 3 5 2 2 2 3 2 2 5	50 00 00 00 75 50 00 50 00 00 00 00 00
* Chapin's How to Enamel	1 14 12 02 5 3 5 22 2 5 2 2 5	50 00 00 00 75 50 00 50 00 00 00 00 00 00 00 00 00 00
* Chapin's How to Enamel	1 14 12 02 5 3 5 22 2 5 2 2 5	50 00 00 75 50 00 50 00 00 00 00 00 00 00 00 00 00
* Chapin's How to Enamel	1 14 12 02 5 3 5 22 2 5 2 2 5	50 00 00 00 75 50 00 50 00 00 00 00 00 00 00 00 00 00
* Chapin's How to Enamel	1 14 12 02 5 3 5 22 2 5 2 2 5	50 00 00 75 50 00 50 00 00 00 00 00 00 00 00 00 00
*Chapin's How to Enamel	1 14 12 02 5 3 5 22 2 5 2 2 5	50 00 00 75 50 00 50 00 00 00 00 00 00 00 00 00 00
* Chapin's How to Enamel	1 14 12 02 5 3 5 22 2 5 2 2 1	50 00 00 00 75 50 00 00 00 00 00 00 00 00 00 00 00 00
*Chapin's How to Enamel	1 14 12 02 5 3 5 22 2 3 2 2 5 2 2 5	50 00 00 75 50 00 50 00 00 00 00 00 00 00 00 00 00

